

Minto Mine

Environmental Monitoring, Surveillance and Reporting Plan

2018-01

Prepared by: Minto Explorations Ltd. Minto Mine January 2018

### Minto Mine Environmental Monitoring, Surveillance and Reporting Plan

#### First Issue: June 2014

#### **Revision History**

Revision Number	Issue Date	Description and Revisions Made		
2014-1	June 2014	First issue		
2015-1	December 2015	Revisions made as per requirements of WUL QZ14-031		
2016-1	February 2016	Revisions made as per EMRSP comments from the Yukon Government and Selkirk First Nation		
2016-02	July 2016	Revisions made as per direction from Yukon Water Board letter April 26, 2016		
2018-01	January 2018	<ul> <li>Revisions made in the following sections: <ul> <li>2.1 – Update to stations and frequencies</li> <li>2.2 – Updated with new wells and lysimeters</li> <li>3.3 – Updated with actual leach pad construction</li> <li>5 – Updated physical monitoring plan</li> <li>7.4 – Updated with conditions from Schedule C – QML-0001.</li> </ul> </li> </ul>		

# **Table of Contents**

1	Intro	oduction	1
	1.1	Project Description	3
2	Wate	ter Monitoring Program	6
	2.1	Surface Water Surveillance Program	10
	2.1.	.1 Hydrology Rating Curve Development	13
	2.2	Groundwater Monitoring Program	13
	2.3	Seepage Monitoring Program	
3	Geod	chemical Monitoring Program	21
	3.1	Acid Base Accounting (ABA) Monitoring Program	21
	3.1.	.1 Internal (On-site) Monitoring	21
	3.1.	.2 External (Off-site) Verification	21
	3.1.	.3 Summary of Sampling and Analytical Frequency	22
	3.1.	.4 ABA Program Reporting	22
	3.1.	.5 Overburden and Waste Rock	23
	3	3.1.5.1 Open Pit Waste Rock	23
	3	3.1.5.2 Underground Development Waste	24
	3.1.	.6 Tailings Solids	24
	3.1.	.7 Construction Materials	24
	3.2	Waste Rock Management Verification Program	25
	3.3	Low Grade and Oxide Ore Metals Leaching Characterization Program	26
	3.3.	.1 Introduction	26
	3.3.	.2 Material Descriptions	26
	3.3.	.3 Construction Details	27
	3.3.	.4 Monitoring	27
4	Mete	eorological Monitoring Program	27
	4.1	Climate Monitoring Program	28
	4.2	Snow Survey Program	28
5	Phys	sical Monitoring Program	
6	Aqua	atic Environmental Monitoring Program	34

6.1 Me	tal Mine Effluent Regulations Monitoring Programs38	8
6.1.1	Metal Mine Effluent Monitoring	8
6.1.2	Environmental Effects Monitoring	9
6.1.2.	1 Site Characterization	Э
6.1.2.	2 Effluent Characterization40	D
6.1.2.	3 Effluent Sublethal Toxicity Testing	D
6.1.2.	4 Supporting Water Quality40	0
6.2 Sec	diment Quality and Toxicity Monitoring42	2
6.2.1	Sediment Quality42	2
6.2.2	Sediment Toxicity Testing4	3
6.3 Per	riphyton and Benthic Invertebrate Tissue Monitoring44	4
6.3.1	Periphyton Chlorophyll α44	4
6.3.2	Periphyton Community	4
6.3.3	Periphyton Tissue4	5
6.3.4	Benthic Invertebrate Community4	5
6.3.4.	1 Benthic Invertebrate Tissue40	6
6.4 Fisl	h Monitoring Program4	7
6.4.1	Supporting Measurements48	8
7 Terrestri	al Environment Monitoring Program49	9
7.1 Inv	asive Plant Species Monitoring Program49	9
7.1.1	Invasive Plants Mitigation49	9
7.1.1.	1 Site access	Э
7.1.1.	2 Plant Selection	9
7.1.1.	3 Erosion Control	0
7.1.1.	4 Soil Salvage	0
7.1.2	Invasive Plants Monitoring	0
7.1.3	Invasive Plants Reporting52	1
7.2 Wi	Idlife Monitoring Program	2
7.3 Erc	sion and Sedimentation Monitoring Program5	7
7.4 Veg	getation Metal Uptake Program	8
8 Progress	ive Reclamation Effectiveness Monitoring Program60	D

9	Quali	ity As	ssurance and Quality Control Programs	61
9	9.1	Qua	ality Assurance	61
ļ	9.2	Qua	ality Control	62
(	9.3	Envi	rironmental Monitoring Programs QA/QC	63
	9.3.1	1	Hydrology QA/QC	63
	9.3.2	2	Meteorology Monitoring Program QA/QC	63
	9.3.3	3	Hydrogeology Monitoring Program QA/QC	64
0	9.4	Exte	ernal Laboratory QA/QC	64
9	9.5	On-s	site Laboratory QA/QC	64
	9.5.1	1	On-site Lab Verification	65
9	9.6	Field	d Instrumentation QA/QC	67
10	Data	Eval	luation and Reporting	69
11	Refe	rence	es	71

# List of Tables

Table 1-1: 2016 EMSRP Regulatory Concordance Table
Table 2-1: Minto Mine Monitoring Station Descriptions and Coordinates
Table 2-2: Water Quality and Hydrology Monitoring Program Requirements         12
Table 2-3: Operational Groundwater Monitoring       1
Table 2-4: Seepage Monitoring Survey Locations and Sampling Frequency
Table 3-1: Acid Base Accounting Monitoring Program Requirements       22
Table 3-2: Criteria for Construction Grade Waste Rock as per the WUL and QML
Table 4-1: Snow Survey Course Locations       29
Table 5-1: Physical Monitoring Program Mine Structures and Instrumentation
Table 5-2: Physical Monitoring Program Roles and Responsibilities         34
Table 6-1: AEMP Programs and Components       3!
Table 6-2: Metal Mine Effluent Monitoring Program Requirements and Frequency         38

Table 6-3: Site Characterization Information in the EEM Study Design Report       39
Table 6-4: AEMP Laboratory Analysis for Water, Sediment and Tissue samples
Table 7-1: Common and Scientific Names of High Priority Yukon Invasive Plant Species, as defined by YISC
Table 7-2: Wildlife Monitoring Activities    54
Table 7-3: Wildlife Sighting Log
Table 7-4: Wildlife and Hazing Tracking Form
Table 7-5: Erosion and Sediment Monitoring Schedule    57
Table 9-1: Quality Control Sample Descriptions    62
Table 9-2: Coefficient of Correlation between Minto Mine On-site Laboratory and Maxxam for Total and         Dissolved Metals         67
Table 9-3: Correlation between Minto Mine On-site Laboratory, Maxxam and ALS for Nutrients and TSS
Table 10-1: EMSRP Monitoring Program Reporting Requirements

# List of Figures

Figure 1-1:	Minto Mine Location Map4
Figure 1-2:	Minto Mine Access Location5
Figure 2-1:	Water Quality Monitoring Station Locations8
Figure 2-2:	Water Quality Monitoring Station Locations (McGinty Creek)9
Figure 2-3:	Groundwater Monitoring Site Locations17
Figure 2-4:	Seepage Monitoring Program Locations20
Figure 3-1:	Open Pit Drill Hole ABA Sampling Flow Chart23
Figure 3-2:	Underground Waste Rock ABA Sampling Flow Chart24
Figure 4-1:	Sample Snow Survey Field Form
Figure 6-1:	AEMP Monitoring Locations
Figure 6-2:	AEMP Benthic Invertebrate Community Monitoring Locations under the EEM Program 37

Figure 7-1: Vegetation Metal Uptake Program Monitoring Stations	59
Figure 9-1: In-situ Field Parameters Calibration Log	68

# **List of Appendices**

- Appendix 1: Minto Mine Surface Water Quality Monitoring Standard Operating Procedures
- Appendix 2: Minto Mine Surface Water Hydrology Standard Operating Procedures
- Appendix 3: Minto Mine Groundwater Monitoring Plan
- Appendix 4: Minto Mine Physical Monitoring Plan
- Appendix 5: Summary of AEMP Study Design Components and Supporting Measures
- Appendix 6: Benthic Sampling SOP
- Appendix 7: Yukon Invasive Plants by Taxonomy
- Appendix 8: Minto Mine Vegetation Metal Uptake Monitoring Plan

# List of Acronyms

Acronym	Definition
A2P	Area 2 Pit
AAS-GF	Atomic Absorption Spectroscopy – Graphite Furnace
ABA	Acid-Base Accounting
AP	Acid generating potential
ARD	Acid Rock Drainage
BMP	Best management practices
C(T)	Total copper
CALA	Canadian Association for Laboratory Accreditation
Capstone	Capstone Mining Corporation
CEQG	Canadian Environmental Quality Guidelines
COC	Chain of command
CPUE	Catch per Unit Effort
DOC	Dissolved organic carbon
DPP	Drive point piezometer
DRP	Minto Mine Decommissioning and Reclamation Plan
DSTSF	Dry stack tailings storage facility
EEM	Environmental Effects Monitoring
EMSRP	Environmental Monitoring, Surveillance and Reporting Plan
ICP	Inductively coupled plasma
ICP-MS	Inductively coupled plasma – mass spectrometry
IROD	Ice-rich overburden dump
MCDS	Minto Creek Detention Structure
Minto	Minto Explorations Ltd.
MintoEx	Minto Explorations Ltd.
MMER	Metal Mine Effluent Regulations
MVF	Mill valley fill
MVFES2	Mill Valley Fill Extension Stage 2
MWD	Main waste dump
NP	Neutralizing potential
PRL	Plan Requirement Letter
QA/QC	Quality Assurance/Quality Control
QML	Quartz Mining Licence
RISS	Regulatory Information Submission System
ROD	Reclamation overburden dump
SECP	Sediment and Erosion Control Plan
S(T)	Total sulphur
SFN	Selkirk First Nation
SOP	Standard operating procedure
SWD	South West Dump
TSS	Total suspended solids
WSP	Water Storage Pond
WUL	Water Use Licence QZ14-031

Acronym	Definition
YISC	Yukon Invasive Species Council
YWB	Yukon Water Board

# **1** Introduction

The Environmental Monitoring, Surveillance and Reporting Plan (EMSRP) is a requirement of Quartz Mining Licence QML-0001 (QML) and Water Use Licence QZ14-031 (WUL). The QML defines the EMSRP as "a plan that describes methods and techniques for collecting monitoring information regarding environmental conditions at the Undertaking, as well as quantitative thresholds which trigger the implementation of adaptive management strategies".

The contents of the EMSRP include requirements of both the QML and WUL including the conditions related to the water monitoring program, geochemical monitoring program, meteorological monitoring program, physical monitoring program, aquatic environmental monitoring program, terrestrial environment monitoring program, progressive reclamation effectiveness monitoring program and quality assurance and quality control programs. The EMSRP has been developed to meet the requirements of the QML Plan Requirements Letter (dated in 2014-12-18 (PRL)), and WUL conditions 83 through 104.

Additionally, as a metal mine in the Yukon, the Minto Mine is required to comply with the *Metal Mine Effluent Regulations* (MMER) (Metal Mine Effluent Regulations, 2002), which regulates the monitoring frequency and reporting of effluent discharged from the Minto Mine.

The requirements are summarized below, as they pertain to the Minto Mine. Table 1-1 summarizes the regulatory monitoring requirements and key personnel involved with the management of the requirements, as well as the section of the EMSRP which provides details of the monitoring programs. This EMSRP replaces the previous 2016 *Environmental Monitoring, Surveillance and Reporting Plan,* submitted in July 2016 by Minto Explorations Ltd. and approved in December 2016.

The content of this EMSRP was originally derived from the *Plan Requirement Guidance for Quartz Mining Projects* (Yukon Government, 2013) and this recent itineration and has been prepared to meet the requirements of the WUL and the QML as well as includes provisions for the Phase VII expansion.

	2018 EMSRP Regulatory Concordance Table			
Monitoring Program	Associated Licence or Regulation	EMSRP Licence Required Updates	Regulatory Monitoring Programs - Key Managers	EMSRP Section
Water Monitoring Program	WUL		Environmental Manager	2
Surface Water Surveillance Program	WUL	WUL 85, 86, Schedule 1	Environmental Manager	2.1
Groundwater Monitoring Program	WUL	WUL 90 a-i, 91	Environmental Manager	2.2
Seepage Monitoring Program	WUL	WUL 92 a-b, 93	Environmental Manager	2.3

Table 1-1: 2018 EMSRP Regulatory Concordance Table

	2018 EMSRP Regulatory Concordance Table			
Monitoring Program	Associated Licence or Regulation	EMSRP Licence Required Updates	Regulatory Monitoring Programs - Key Managers	EMSRP Section
Geochemical Monitoring Program	WUL	WUL 94 / QML PRL 3 (c)	Chief Geologist	3
Acid Base Accounting (ABA) Monitoring Program	WUL	WUL 95	Chief Geologist	3.1
Waste Rock Management Verification Program	WUL	WUL 95	Chief Geologist	3.2
Meteorological Monitoring Program	WUL		Environmental Manager	4
Climate Monitoring Program	WUL	WUL 96	Environmental Manager	4.1
Snow Survey Program	WUL	WUL 96	Environmental Manager	4.2
Physical Monitoring Program	WUL / QML	WUL 97 a-h, 98, 99 a-b / QML PRL 3(a) (b)	Chief Engineer	5
Aquatic Environmental Monitoring Program	WUL / MMER	WUL 102	Environmental Manager	6
Metal Mine Effluent Regulations Monitoring Programs	WUL / MMER	WUL 101 a	Environmental Manager	6.1
Sediment Quality and Toxicity Monitoring	WUL	WUL 101 b	Environmental Manager	6.2
Periphyton and Benthic Invertebrate Tissue Monitoring	WUL	WUL 101 c	Environmental Manager	6.3
Fish Monitoring Program	WUL / MMER	WUL 101 a	Environmental Manager	6.4
Terrestrial Environment Monitoring Program	QML		Environmental Manager	7
Invasive Plant Species Monitoring Program	QML		Environmental Manager	7.1
Wildlife Monitoring Program	QML		Environmental Manager	7.2
Erosion and Sedimentation Monitoring Program	QML		Environmental Manager	7.3

	2018 EMSRP Regulatory Concordance Table							
Monitoring Program	Associated Licence or Regulation EMSRP Licence Required Updates		Regulatory Monitoring Programs - Key Managers	EMSRP Section				
Vegetation Metal Uptake Program	QML	QML PRL 3 (d)	Environmental Manager	7.4				
Progressive Reclamation Effectiveness Monitoring Program	WUL / QML		Environmental Manager	8				
Quality Assurance and Quality Control Programs	WUL	WUL 103, 104	Environmental Manager	9				

# **1.1 Project Description**

The Minto Mine is a copper-gold mine owned 100% by Minto Explorations Ltd. (Minto), a wholly owned subsidiary of Capstone Mining Corporation (Capstone). The Minto Mine commenced commercial production in October 2007. The Minto Mine is located within Selkirk First Nation (SFN) Category A Settlement Land Parcel R-6A, approximately 240 km northwest of Whitehorse, Yukon and 41 km southwest of Pelly Crossing (Figure 1-1). After crossing the Yukon River, either by summer barge or winter ice bridge, access to the mine site is via a 27 km access road along the Yukon River and up the Minto Creek drainage (Figure 1-2). Crews and supplies are transported by air during the spring thaw and fall freeze-up.

The Minto Mine is an existing and fully operational copper and gold mine. The Minto Mine is currently an open pit and underground mining operation with conventional crushing, grinding, and flotation to produce copper concentrates with significant gold and silver credits. Concentrates are exported internationally via the Port of Skagway, Alaska for smelting and sale. Minto Mine is currently in Phase V/VI of development and has entered into the permitting process for Phase VII Expansion.

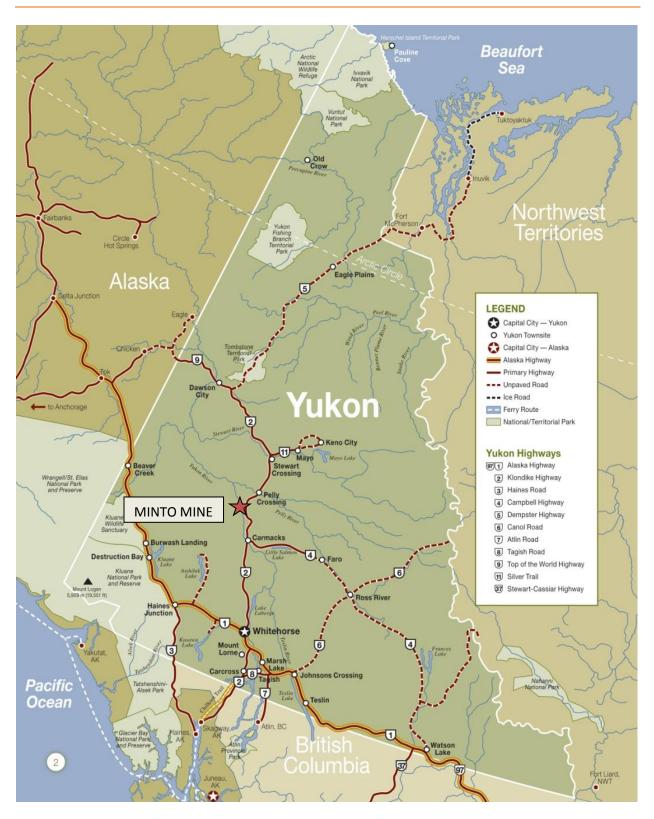


Figure 1-1: Minto Mine Location Map

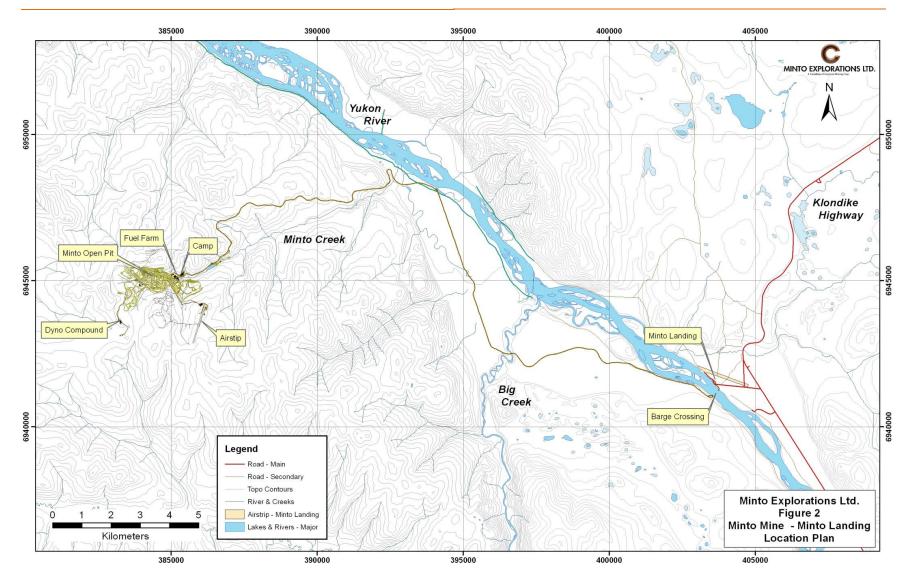


Figure 1-2: Minto Mine Access Location

# 2 Water Monitoring Program

Water quality and hydrology monitoring at the Minto Mine is conducted in accordance with the requirements outlined in WUL and in the MMER. Monitoring programs for water quality and hydrology at the Minto Mine, McGinty Creek, groundwater, and seepage are detailed below in Sections 2.1 through 2.3; details regarding water monitoring and the MMER are presented in Section 6.1. Monitoring stations are described in Table 2-1 and are shown in Figure 2-1, and Figure 2-2. The locations of several monitoring stations are not identified in Table 2-1 and Figure 2-1 as a result of monitoring stations will not be developed until the associated Phase V/VI and Phase VII structures have been constructed. As the Phase V/VI and Phase VII mine plan progresses the specific locations of these monitoring stations will be identified, established, and included in the Annual Report.

The location description, and expected frequency of monitoring are summarized in the tables within this section.

		UTM Coordinates –		
Station	Description	Zo	ne 8	
		Easting	Northing	
W1	Lower Reach of Minto Creek	392445	6948251	
W2	Minto Creek, upstream of the Minto Creek/Yukon River confluence where the access road crosses Minto Creek	392584	6948402	
W3	Minto Creek, at the federal MMER compliance point	387000	6945778	
W4	Yukon River, upstream of the confluence with Minto Creek	394070	6948203	
W5	Yukon River, downstream of the confluence with Minto Creek	392583	6949119	
W6	Tributary on the North side of Minto Creek	387583	6946392	
W7	Mouth of the tributary on the south side of Minto Creek, approximately 0.8 km downstream of W3	387546	6946034	
W8A	Eastern collection sump from the DSTSF	385716	6945012	
W10	Headwaters of Minto Creek (south-west fork at headwaters)	383855	6943364	
W12	Main Pit and Main Pit Tailings Management Facility	384544	6945137	
W12A	Discharge from Main pit			
W14	Tailings thickener overflow	385223	6945089	
W15	Upper Minto Creek storm water collection sump, downstream of the overburden dump, just upstream of Main Pit	384181	6944708	
W16	Water Storage Pond	386402	6945559	
W16A	Discharge from the Water Storage Pond	386679	6945664	
W17	Water Storage Pond dam seepage	386679	6945664	
W35	South Diversion Ditch	385223	6944427	
W45	Area 2 Pit and Area 2 Pit Tailings Management Facility	384912	6944068	

Table 2-1:	Minto Mine M	Ionitoring Station	Descriptions and	Coordinates
------------	--------------	--------------------	------------------	-------------

		UTM Coordinates –		
Station	Description	20 Easting	ne 8 Northing	
W46	Minto Creek, downstream of W7 and W6 tributaries	387873	6946301	
W50	Minto Creek, approximately 50 m downstream of the toe of the Water Storage Pond Dam and downstream of the inflow of the treated water	386747	6945682	
MC-1	Minto Creek upstream of Canyon	390967	6947528	
WTP	Treated water from water treatment plant when RO not operating	385126	6945154	
RO	Treated water from RO	385126	6945154	
W51	Area 2 Stage 3 Pit (until water breaches the saddle elevation)			
W52	Ridgetop North Pit and Ridgetop North Pit Tailings Management Facility			
W53	Ridgetop South Pit			
W54	Main Dam seepage			
W55	Tailings Diversion Ditch	386209	6945007	
W62	MVFES2 Collection Sump	386079	6945335	
C4	Tributary on the south side of Minto Creek, downstream of W3	388407	6946571	
C10	Tributary on the south side of Minto Creek, downstream of W3	391868	6947914	
MN	Minto North pit water	384342	6946090	
MN-0.2	Upper west arm of McGinty Creek (Reference Station)	382267	6947299	
MN-0.5	West arm of McGinty Creek just upstream of the confluence with the east arm	385251	6951262	
MN-1.5	Upper east arm of McGinty Creek downstream of the Minto North deposit	384473	6947055	
MN-2.5	East arm of McGinty Creek just upstream of confluence with the west arm	385493	6950788	
MN-4.5	Lower mainstream McGinty Creek near confluence with Yukon River	386231	6952851	
UG 1	Minto South underground mine dewatering	384916	6944098	
UG 2	Wildfire underground mine dewatering			
UG 3	Copper Keel underground mine dewatering			
UG 4	Minto East underground mine dewatering			
UG 5	Minto North underground mine dewatering			
UG 6	Minto East 2 underground mine dewatering			

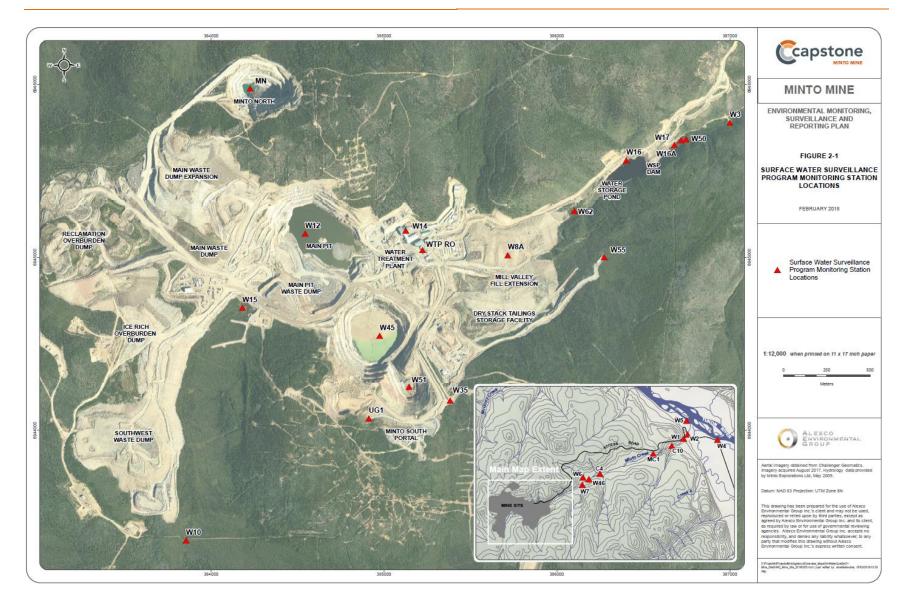


Figure 2-1: Water Quality Monitoring Station Locations

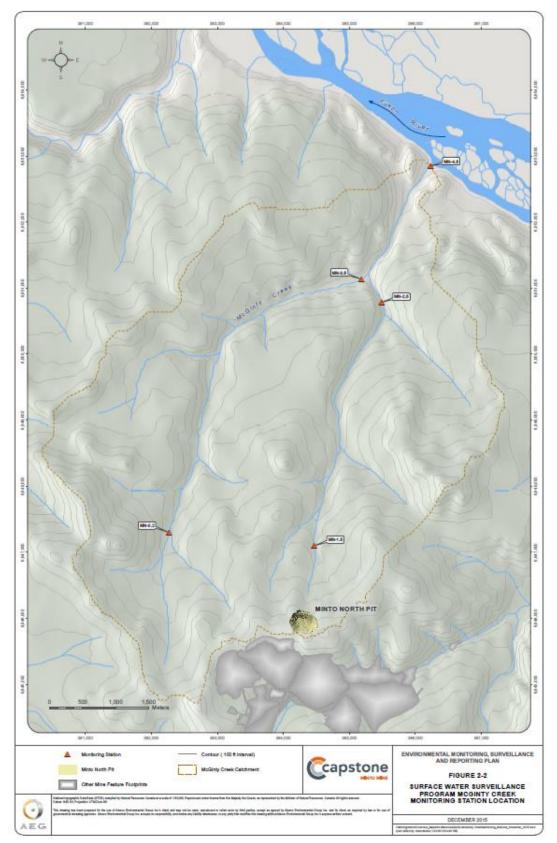


Figure 2-2: Water Quality Monitoring Station Locations (McGinty Creek)

## 2.1 Surface Water Surveillance Program

The objective of the Surface Water Surveillance Program is to monitor surface water quality and hydrological conditions at stations within the operational mine area, downstream stations which are influenced by mine effluent discharge, and downstream reference stations which are not exposed to effluent. Water quality and hydrology monitoring is conducted in accordance with the requirements outlined in the WUL and reflected in Table 2-2. Monitoring areas can generally be characterized as sites at or near the active mine site and associated facilities, and on Minto Creek, the Yukon River, McGinty Creek and non-impacted drainages. Sampling locations and coordinates are updated annually as part of the WUL Annual Report.

The Surface Water Surveillance Program monitoring schedule contains weekly, monthly, and quarterly water quality monitoring requirements, and continuous, weekly and monthly monitoring requirements for surface water hydrology and water conveyance flows (Table 2-2). Analytical requirements include insitu field parameters, physical parameters, nutrients, total and dissolved metals, dissolved organic carbon (DOC), and bioassays. Water quality analysis is performed by an external laboratory (for physical parameters, nutrients, total and DOC) and the Minto Mine internal laboratory (for copper, aluminum, cadmium, selenium, ammonia, nitrite, nitrate and total suspended solids). A combination of continuous water level indicators and inline flow metering systems are used for sites that require continuous monitoring. Calculated flow measurements, determined using the mid-section method with a current meter, are used for sites that require weekly and monthly monitoring.

Monitoring procedures for the water quality monitoring are guided by the *Minto Mine Surface Water Quality Monitoring Standard Operating Procedures* (Appendix 1). The water quality standard operating procedures (SOPs) were developed in accordance with the best management practices (BMP) found in the *Protocols Manual for Water Quality Sampling in Canada* (CCME, 2011), *Guidance Document for the Sampling and Analysis of Metal Mining Effluents* (Environment Canada, 2001) and *Ambient Freshwater and Effluent Sampling Manual* (Clark, 2003).

Monitoring procedures for the hydrological monitoring are guided by the *Minto Mine Surface Water Hydrology Standard Operating Procedure* (Appendix 2). The hydrology SOPs were developed in accordance with the BMPs found in the *Guidance Document for Flow Measurement of Metal Mining Effluents* (Environment Canada, 2001) and in the *Manual of British Columbia Hydrometric Standards* (Ministry of Environment, 2009).

The Minto Mine Surface Water Quality Monitoring Standard Operating Procedures and Minto Mine Surface Water Hydrology Standard Operating Procedure are updated on an as-required basis to ensure that the BMPs described in the documents remain current.

Station	Flow	Water	Field		Analytical ite	Internal Suite	96- Hr	48-Hr	Chronie	c Toxicity Testing
Station	Flow	Level	Parameters Frequency	Frequency	Analytical Suite	Frequency	Pass/ Fail	Pass/ Fail	Frequency	Test
W1	С	-	-	-	-	-	-	-		
W2	-	-	W/Wd	W/Wd	A,N,DOC	Wd	-	-	Md	CD-7d
W3	С	-	W/Wd	W/Wd	A,N,DOC	Wd	Md	Md	-	-
W4	-	-	Q	Q	A,N, DOC	-	-	-	-	-
W5	-	-	Q	Q	A,N, DOC	-	-	-	-	-
W6	М	-	М	М	A,N, DOC	-	-	-	-	-
W7	С	-	М	М	A,N,DOC	-	-	-	-	-
W8A	-	-	W	W	A,N	W	-	-	-	-
W10	-	-	М	М	A,N	-	-	-	-	-
W12	-	W-WL, TV	М	М	A,N	-	-	-	-	-
W12A	Wd		Wd	Wd	A,N					
W14	-	-	М	М	В	-	-	-	-	-
W15	С	-	М	М	A,N, DOC	Wd	-	-	-	-
W16	-	W-WL	Mnf/Wd	Mnf/Wd	A,N, DOC	Wnf	-	-	-	-
W16A	Wd	-	Wd	Wd	A,N,DOC	Wd	Md	Md	-	-
W17	С	-	W/Wd	W/Wd	A,N, DOC	Wd	-	-	-	-
W35	С	-	М	М	A,N, DOC	Wd			-	-
W45	Cdw	W-WL, TV	М	М	A,N	-	-	-	-	-
W46	М	-	М	М	A,N,DOC	-	-	-	-	-
W50	M/Wd	-	M/Wd	M/Wd	A,N,DOC	Wd	М	М	М	CD-7d
MC-1	С	-	M/Wd	M/Wd	A,N,DOC	-	-	-	-	-
WTP	Wd	-	Wd	Wd	A,N,DOC	Wd	-	-	-	-
RO	Wd	-	Wd	Wd	A,N,DOC	Wd	-	-	-	-
W51	Cdw	W-WL	М	М	A,N	-	-	-	-	-
W52	Cdw	W-WL, TV	М	М	A,N	-	-	-	-	-
W53	Cdw	W-WL	М	М	A,N	-	-	-	-	-
W54	С	-	М	М	A,N	-	-	-	-	-
W55	М	-	М	М	A,N	-	-	-	-	-
W62	С		М	М	A,N					
C4	М	-	М	М	A,N,DOC	-	-	-	-	-
C10	М	-	М	М	A,N,DOC	-	-	-	-	-
MN	Cdw	W-WL	М	М	A,N	-	-	-	-	-
MN-0.2	М	-	М	М	A,N,DOC	-	-	-	-	-

Chattan	el	Water	Field		Analytical ite	Internal Suite	96- Hr	48-Hr	Chronic Toxicity Testing		
Station	Flow	Level	Parameters Frequency	Frequency	Analytical Suite	Frequency	Pass/ Fail	Pass/ Fail	Frequency	Test	
MN-0.5	М	-	М	М	A,N,DOC	-	-	-	-	-	
MN-1.5	С	-	М	М	A,N,DOC	-	-	-	-	-	
MN-2.5	С	-	М	М	A,N,DOC	-	-	-	-	-	
MN-4.5	С	-	М	М	A,N,DOC	-	-	-	-	-	
UG 1*	Cdw	-	М	М	A,N	-	-	-	-	-	
UG 2*	Cdw	-	М	М	A,N	-	-	-	-	-	
UG 3*	Cdw	-	М	М	A,N	-	-	-	-	-	
UG 4*	Cdw	-	М	М	A,N	-	-	-	-	-	
UG 5*	Cdw	-	М	М	A,N	-	-	-	-	-	
UG 6*	Cdw	-	М	М	A,N	-	-	-	-	-	
C: Continuo	usly			A: Physical parameters, conductivity, total suspended solids, total dissolved solids, hardness, alkalinity, sulphate, ICP scan- total metals, ICP – dissolved metals							
W: Weekly				B: Physical par	rameters, condu	ctivity, total diss	olved solid	ls, alkalinit	y, sulphate, ICP -	- dissolved metals	
Wd: Weekly	while disch	narging		N: Nutrients: A	mmonia-N, Nitr	ate-N, Nitrite-N					
Wnf: Weekl	y, when no	t frozen		Field paramete	e <b>rs:</b> In-situ pH, C	onductivity, Tem	perature,	Dissolved	Oxygen		
M: Monthly				Internal lab pa and total suspe		olved metals: cop	pper, alum	iinum, cad	mium, selenium	; ammonia, nitrite, nitrate	
Md: Month	y while disc	charging		DOC: Dissolved	d organic carbon						
Mnf: Month	ily, when no	en not frozen 96 hr Pass/Fail: Rainbow trout static bioassay, 96 hrs at 100%, pH non-adjusted									
Cdw: Continuous when dewatering       48 hr Pass/Fail: Daphnia magna static bioassay, 48 hrs at 100%, pH non-adjusted											
WL: Surface Water Level Elevation       CD-7d: Chronic Toxicity – Ceriodaphnia dubia 7-day test (EPS 1/RM/21)											
TV: Track Tailings Volume CT-30-d: Chronic toxicity – 30-day Early Stage Toxicity for Rainbow Trout (EPS 1/RM/2						(28)					
				CA-72hr: Chronic Toxicity – 72-hour for Algae (EPS 1/RM/25)							

\* Underground water quality sites will be monitored while areas remain active or maintained.

Definitions made in the EMSRP Table 2-2 that are not included in the WUL include the following:

- The "B" Analytical Suite has been defined in Table 2-2 as physical parameters, conductivity, total dissolved solids, alkalinity, sulphate, ICP – dissolved metals. No definition of the suite was provided in the WUL.
- The metals description in the internal lab parameters have been defined as dissolved metals: copper, aluminum, cadmium and selenium in lieu of copper, aluminum, cadmium selenium as described in the WUL.
- The acronym Wnf has been defined as "weekly, when not frozen".

#### 2.1.1 Hydrology Rating Curve Development

Minto collects hydrometric data throughout the open water season using the velocity-area method of discharge calculation. Measurements are conducted manually and paired with staff gauge observations and site photographs. Paired Solinst leveloggers and barologgers are utilized to collect the continuous stage record.

The rating curves are developed using data management software or excel. Date, time, staff gauge height and discharge measured is imported into the software and the rating curve is built. Any suspect measurements are verified against photos and field notes (e.g. if they differ greatly from the stagedischarge relationship). This can be due to the effects of ice or other changing control conditions. Rating curve development thus considers which measurements should be included and when and where shifts to the rating are appropriate. All measurements within the continuous period are included in the hydrographs (in the Annual Report). Rating curve shifts are used at some Minto sites where appropriate.

Barometrically compensated Solinst water level data are then imported into Aquarius software from .CSV files which are exported from Solinst software following compensation. Aquarius allows for adjustment of the Solinst record to match the staff gauge observations, for development of rating curves with the field data, and for automatic processing of continuous discharge records. This preserves the raw data in an easy to reference format and changes can be made to the data at any time which then cascade through the various time series. For example, at new sites, rating curves may improve after several seasons and alter a previous year's continuous record as high or low ends of the rating curve become well defined. Stage time series are adjusted for drift, offset and erroneous data are deleted or excluded from discharge computation if they are deemed ice affected. The rating curve is automatically applied to the continuous stage record for a specified time period to create the continuous discharge time series.

## 2.2 Groundwater Monitoring Program

The objective of the Groundwater Monitoring Program is to monitor potential impacts on groundwater from the mine project components. Groundwater-related monitoring at Minto is accomplished through monitoring groundwater wells, vibrating wire piezometers and thermistors. The Groundwater Monitoring Program includes several components including groundwater water quality, aquifer characterization, evaluation of longitudinal flow paths, leaching tests, and the monitoring of long-term phreatic levels in tailing management facilities. Details of the Groundwater Monitoring Program components are discussed in the *Groundwater Monitoring Plan* in Appendix 3.

Monitoring areas are both up-gradient and down-gradient of mine activities and include, but are not limited to, the dry stack tailings storage facility (DSTSF), mill area, Main Pit Tailings Management Facility, Area 2 Pit Tailings Management Facility, Minto North Pit, mill valley fill, waste rock dumps, water storage pond (WSP), and areas where future mine components are planned. The purpose of the monitoring wells is to provide information to better understand the potential for off-site migration of contamination and

to better understand and define source terms and conditions of waste emplacement, for comparison to source terms used in the Water Balance and Water Quality model. Groundwater monitoring instrumentation locations are shown on Figure 2-3.

Groundwater wells are sampled for water quality monitoring, as per the procedures summarized in the *Standard Guide for Sampling Ground-Water Monitoring Wells* (ASTM, 2013).

Groundwater samples will be collected and analyzed for the parameters described below:

- Physical Parameters, Conductivity, Total Dissolved Solids, Alkalinity, Sulphate, ICP Scan Dissolved Metals.
- Nutrients: Ammonia-N, Nitrate-N, Nitrite-N and Phosphorous.
- In-situ Field Parameters: pH, Conductivity and Temperature.

Groundwater samples will be submitted to an accredited laboratory for analysis.

Groundwater wells at Minto include multi-level monitoring wells, stand pipe wells, and drivepoint wells. The "Westbay MP" multilevel monitoring system allow for monitoring below shallow permafrost as the system can be operated with antifreeze in the sealed access pipe. Standpipe wells are simple wells consisting of a standpipe tube inserted into a borehole. Drivepoint wells are small diameter wells that are used to monitor shallow groundwater conditions.

Thermistor strings are used to measure ground temperature profiles in boreholes, and in particular permafrost conditions at Minto. Thermistor strings consist of multiple temperature sensor nodes distributed along a single multi-conductor cable, installed within or attached to the outside of grouted PVC pipe. EBA and RST thermistor strings have been installed on site. Thermistors are read using a basic ohmmeter and RST thermistors are read using the RST TH2016B readout unit.

Vibrating wire piezometer strings are used to measure pore water pressure profiles in boreholes. They consist of multiple vibrating wire sensors installed on PVC pipe in grouted boreholes. RST vibrating wire piezometers are installed on site and data is collected with the RST VW2106 readout unit.

Lysimeters are used for monitoring the water within the waste rock piles. Passive lysimeters provide data needed to complement and refine the existing soil cover and geochemical models, as well as characterize the variability in waste rock and candidate cover soils. Results of the lysimeter monitoring will be used to augment the understanding of how water moves through the WRDs, providing a basis for more accurate water and load balance prediction. Lysimeter locations and installation details are outlined in the Minto Mine *Groundwater Monitoring Plan* (Appendix 3).

The groundwater monitoring station locations, category and frequencies are provided in Table 2-3 for operational monitoring. Details on the locations and monitoring frequencies for vibrating wire piezometers and thermistor strings are provided in the *Physical Monitoring Plan*. Planned stations (such as MP-1 and A2P-1) will follow the same monitoring frequency as existing stations outlined in the *Physical* 

*Monitoring Plan* (Appendix 4). The Minto Mine *Groundwater Monitoring Plan* has been included as Appendix 3 and includes details on the criteria used for selection of the monitoring points.

	Well ID	Depth or description	Quality	Level	Rationale
Up-gradient of	MW17-08	Zone 1 (44.7 mbgs)	В	В	Background well; higher frequency not warranted
Mine		Zone 2 (34.1 mbgs)	В	В	Background well; higher frequency not warranted
Activities		Zone 3 (23.4 mbgs)	В	В	Background well; higher frequency not warranted
		Zone 4 (8.2 mbgs)	В	В	Background well; higher frequency not warranted
Southwest	MW12-DP1	NA	Stop mo	nitoring	Dry or frozen - little record
Waste Dump	MW12-DP2	NA	Stop mo	nitoring	Dry or frozen - little record
	MW12-DP3	NA	Stop mo	nitoring	Dry or frozen - little record
	MW17-09	Zone 1 (57.2 mbgs)	S	S	Seasonal variability sufficient
Main Waste	MW09-01	Zone 1 (44 mbgs)	Stop mo	nitoring	Repeatedly dry; replaced by MW17-10
Dump		Zone 2 (34 mbgs)	Stop mo	nitoring	Repeatedly dry; replaced by MW17-10
		Zone 3 (26 mbgs)	Stop mo	nitoring	Repeatedly dry; replaced by MW17-10
	MW17-10	Zone 1 (85.5 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (75 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (61 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (53.5 mbgs)	А	S	Likely to be dry often – freshet monitoring only
Dry Stack	MW12-06	Zone 1 (142 mbgs)	S	S	Seasonal variability sufficient
Tailings		Zone 2 (123 mbgs)	S	S	Seasonal variability sufficient
Storage Facility and		Zone 3 (93 mbgs)		S	Currently not sampled with no immediate need to change
Mill Valley Fill		Zone 4 (66 mbgs)	S	S	Seasonal variability sufficient
Expansion		Zone 5 (35 mbgs)	5	S	Currently not sampled with no immediate need to
				-	change
		Zone 6 (18 mbgs)	S	S	Seasonal variability sufficient
Main Pit	MW12-07	Zone 1 (115 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (88 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (66 mbgs)		S	Currently not sampled with no immediate need to change
Minto North	MW09-03	Zone 1 (38 mbgs)	S	S	Seasonal variability sufficient
Pit		Zone 2 (24 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (11 mbgs)		S	Currently not sampled with no immediate need to change
	MW17-11	Zone 1 (96.9 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (75.5 mbgs)		S	Currently not sampled with no immediate need to change
		Zone 3 (58.8 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (40.5 mbgs)	S	S	Seasonal variability sufficient
		Zone 5 (16.1 mbgs)		S	Dry
Water Storage	MW12-05	Zone 1 (132 mbgs)	S	S	Seasonal variability sufficient
Pond		Zone 2 (110 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (94 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (69 mbgs)	S	S	Seasonal variability sufficient
		Zone 5 (52 mbgs)	S	S	Seasonal variability sufficient
		Zone 6 (26 mbgs)		S	Currently not sampled with no immediate need to change
		Zone 7 (15 mbgs)	S	S	Seasonal variability sufficient

#### Table 2-3: Operational Groundwater Monitoring

Mine Project Component	Monitoring Well ID	Westbay Zone Depth or description	Quality	Level	Rationale
Water Storage	MW17-12	Zone 1 (143.4 mbgs)	S	S	Seasonal variability sufficient
pond		Zone 2 (129.6 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (111.4 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (91.5 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 5 (80.9 mbgs)	S	S	Seasonal variability sufficient
		Zone 6 (70.2 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 7 (50.4 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 8 (35.2 mbgs)	S	S	Seasonal variability sufficient

As part of its Groundwater Monitoring Program, Minto has designed a tracer study with the objective to evaluate the natural gradient flow paths from source(s) to receptors via groundwater pathways. Details on this study, including groundwater monitoring locations sampled and sampling frequency, is provided within the *Groundwater Monitoring Plan* (Appendix 3).

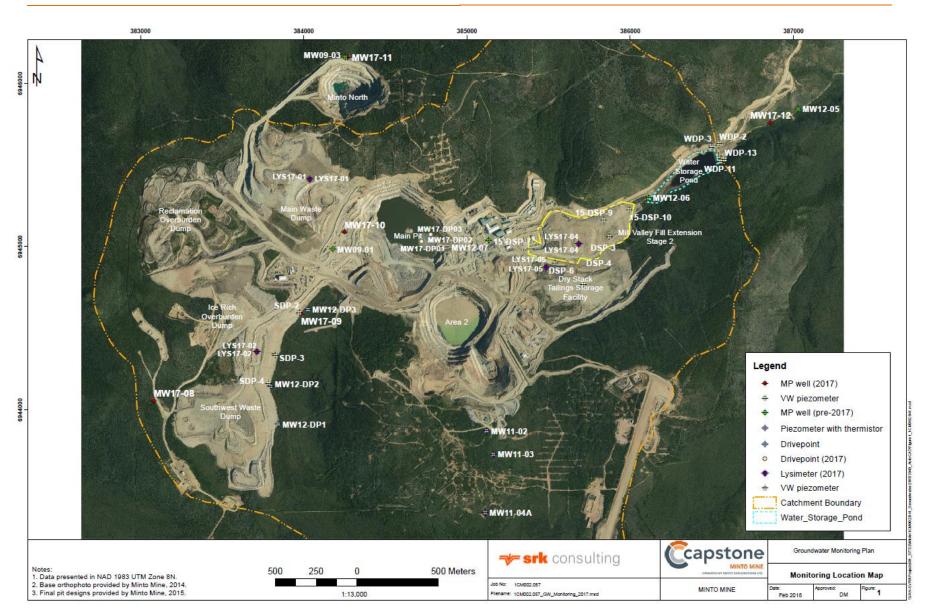


Figure 2-3: Groundwater Monitoring Site Locations

# 2.3 Seepage Monitoring Program

The objective of the Seepage Monitoring Program is to assess and monitor potential acid rock drainage and metal leaching conditions at the Minto Mine. The program includes a survey for seepage of all project components including pit wall seepage; ore stockpile areas; overburden dumps; waste rock dumps including low grade, medium grade and high grade waste storage areas; dry stack tailing storage facility (DSTSF); mill valley fill (MVF) area (extension 1 and 2); mill area; and other known seepage locations. The monitoring locations and monitoring frequency are summarized in Table 2-4, and the analytical parameters required for seepage samples are also detailed in Table 2-4. Seepage survey locations and routes are shown on Figure 2-4.

There are several monitoring sites in the Surface Water Surveillance Program that provide seepage water quality information. The scheduled monitoring frequency and analytical parameters for these sites is detailed in Section 2.1. The Surface Water Surveillance Program monitoring sites that provide information related to seepage water quality include W8A, W17, and W62.

As a result of the construction of the Mill Valley Fill Extension Stage 2 (MVFES2) the Minto Creek Detention Structure (MCDS) was decommissioned and replaced with the MVFES2 Collection Sump. The MVFE2 Collection Sump is monitored as monitoring site W62 (detailed in Section 2.1). Water quality monitoring at W62 is scheduled on a monthly basis for in-situ field parameters, nutrients, physical parameters, conductivity, total suspended solids, total dissolved solids, hardness, alkalinity, sulphate, total and dissolved metals. Flow monitoring will be measured continuously. Physical monitoring of the MVFE2 Collection Sump is detailed in Section 5 as part of the Physical Monitoring Program.

Survey Locations	Monitoring Frequency	Analytical Parameters
Ore stockpile areas		
Overburden dumps	Twice yearly; once in	Physical parameters, Conductivity, Total
Waste rock dumps	spring runoff conditions (typically May) and	Dissolved Solids, Alkalinity, Sulphate, ICP Scan- Dissolved Metals
Drystack tailings storage facility	once in early fall	
Mill Area	conditions (typically September). Note that	Ammonia-N, Nitrate-N, Nitrite-N and Phosphorous
Mill Valley Fill Extension (Stage 1 and 2)	Pit walls can only be surveyed if safe	In-situ parameters- pH, Conductivity and
Water Storage Pond Dam Seepage	conditions are present.	Temperature
Pit Walls		

Seepage surveys are carried out along the toe of each location shown on Figure 2-4. For each seepage monitoring event, survey routes are recorded using the tracking function of a GPS. Where actively flowing seepage is encountered, a sample is collected according to the following protocols:

- 1. Record sample location using GPS.
- 2. Take three photos at each station: one close-up photograph, showing the substrate the seepage is interacting with; one up-gradient photograph, showing the area from which the seepage is flowing; and one downgradient photograph, showing the seepage flow path and area that the seepage reports to.
- 3. Take water quality sample as per the *Minto Mine Surface Water Quality Monitoring Standard Operating Procedures.*

For each sample, field data and observations are recorded on a purpose-designed form. This form includes fields for the following information:

- Date and time of sample collection;
- Coordinates of station location;
- Weather at time of sample collection;
- Reference numbers of photographs taken;
- Field measurements of pH, conductivity, temperature;
- Sketch of the sampling location, showing any relevant features (e.g. location of toe, pools of water, trace of surface water flow, site features such as roads, ditches, sumps);
- Water colour, turbidity, and presence of any precipitates or mineral staining; and
- Colour of sediment on filter and number of filters used.

Where the location of the downgradient toe of the monitoring location changes over time, the route surveyed will change such that, for any given monitoring event, monitoring will be carried out along the downgradient toe. New station names will be used in areas where the downgradient toe of a facility changes.

Results from the Seepage Monitoring Program will be compared to the source terms used in the Water Balance and Water Quality Model; additionally results will be summarized in the WUL Annual Report.

The feasibility of measuring flow rates at seeps as part of the Seepage Monitoring Program development and implementation was evaluated. However, based on site observations, the seeps have insufficient flow to be able to determine accurate flow measurements. Additionally, estimating the flows would not be appropriate and could potentially provide erroneous information.

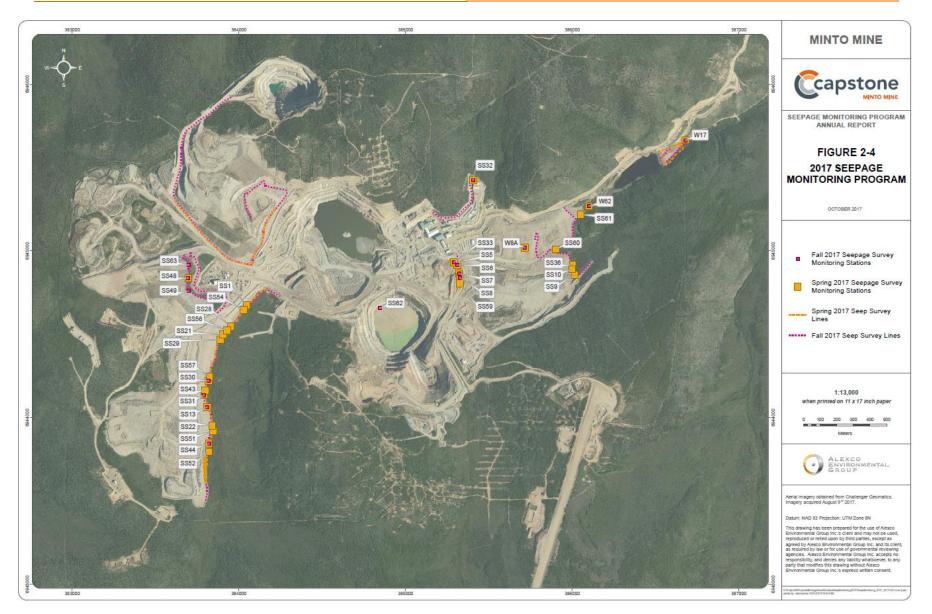


Figure 2-4: Seepage Monitoring Program Locations

# 3 Geochemical Monitoring Program

The Geochemical Monitoring Program is comprised of the following components:

- The Acid Base Accounting (ABA) Program, which provides for monitoring of overburden and waste rock derived from the underground and open pit mining operations, and tailings from milling;
- The Waste Rock Management Verification Program; and
- Low Grade and Oxide Ore Metals Leaching Characterization Program.

These programs are detailed in Sections 3.1 to 3.2. Details relating to the waste rock sampling and analysis is provided in the *Minto Mine Phase V/VI Expansion Waste Rock and Overburden Management Plan* (WROMP) (Minto, 2014).

# 3.1 Acid Base Accounting (ABA) Monitoring Program

#### 3.1.1 Internal (On-site) Monitoring

On-site ABA monitoring is carried out on drill cuttings from every blast hole. Samples are collected for grade control purposes, and a portion of each sample is sent for total sulphur (S(T)) and total carbon (C(T)) analyses at the on-site laboratory.

Following analysis, S(T) and C(T) results are converted into equivalent acid potential (AP-S(T)) and neutralization potential (NP-C(T)) values, and NP-C(T):AP-S(T) ratios are calculated for each sample. The NP-C(T):AP-S(T) values are plotted for each drill hole in a given blast pattern (along with other assay results), and mine geologists use the mine's grade control software to define polygons outlining contiguous zones of waste rock types- either bulk waste or waste with an NP-C(T):AP-S(T) ratio less than 3.0. Additional details about on-site monitoring and waste handling procedures can be found in the WROMP (Minto, 2014).

#### 3.1.2 External (Off-site) Verification

Composite samples from each waste class for each blast are formed from the individual samples that are subject to on-site monitoring for S(T) and C(T). These composite samples are both tested on-site and sent off-site to a commercial laboratory to provide external verification for quality control purposes. The external verification samples will be analysed for a broader range of parameters, including paste pH, total sulphur, sulphate sulphur, total inorganic carbon, modified neutralization potential (Modified NP) and metals by aqua regia digestion with ICP finish. Modified NP will be analysed using the MEND (1991) method to allow direct comparison with pre-production characterization (MEND, 1991).

#### 3.1.3 Summary of Sampling and Analytical Frequency

A summary of the ABA sampling methods that are used by Minto for collection of overburden, waste rock, tailings solids, and construction materials are summarized in sections 3.1.5, 3.1.6, and 3.1.7 respectively. ABA sample frequency, sample type and analysis requirements are summarized in Table 3-1.

Material	Sample Frequency	Sampling Type	Analytical Requirement
Overburden	Sampled when overburden is mined	Representative sampling whenever overburden is mined	<ol> <li>Internal Laboratory: S(T) and C(T)</li> <li>External Laboratory: ABA and trace element analyses</li> </ol>
	Each blast hole	Split of grade control sample (single hole composite of blast hole cuttings)	<ol> <li>Internal Laboratory: S(T) and C(T)</li> </ol>
Open Pit Waste Rock	Pre-selected based on the drill pattern, the ABA sampling occurs every 4-5 drill holes equilaterally in a drill pattern which is typically 20-25 m apart. The aim is to ensure even coverage for ABA analysis throughout the drill pattern.	Composite ABA samples are created based on the waste zone polygons. The number of ABA samples that go into the composite sample will depend on the size of the waste zone polygon and number of ABA samples taken within that polygon.	<ol> <li>Internal Laboratory: S(T) and C(T)</li> <li>External Laboratory: ABA and trace element analyses</li> </ol>
Underground Waste Rock	One sample for every 50m of development (represents ~ 3300 tonnes of waste rock)	Representative composite grab sample from transfer pad pile	<ol> <li>Internal Laboratory: S(T) and C(T)</li> <li>External Laboratory: ABA and trace element analyses</li> </ol>
Tailings Solids	Monthly	One composite sample per month comprised of weekly final tailings sample	1. External Laboratory: ABA and trace element analyses

Table 3-1: Acid Base Accounting Monitoring Program Requirements

#### 3.1.4 ABA Program Reporting

Analytical results are added to the existing mine ABA database and will be reported on an annual basis as part of the WUL and QML Annual Report. The report will include:

- Comparison between new and historical data (including discussion), and
- Comparison of NP/AP and sulphide sulphur (log NP/AP versus log percent sulphide sulphur graph).

#### 3.1.5 Overburden and Waste Rock

The objective of the overburden and waste rock ABA test program is to classify all overburden, waste rock and low grade, partially oxidized material mined at the Minto Mine and disposed of on surface. Classification is done through a combination of logging of lithology and related characteristics by the mine geologist during sample collection, and subsequent chemical analysis (determination of copper, sulphur and carbon content). Further details of the segregation of waste rock at Minto Mine is detailed in the WROMP. SOPs support the execution of the program and ensure that consistent field observations and sampling protocols are followed. Brief summaries of sampling procedures for open pit and underground waste rock are included in the following two subsections for reference.

#### 3.1.5.1 Open Pit Waste Rock

The sampling procedure for sampling for open pit development waste is summarized in Figure 3-1.

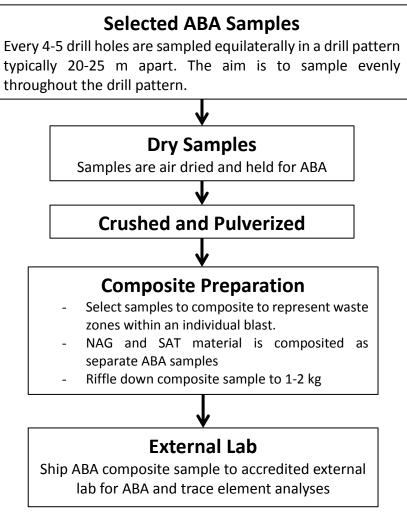


Figure 3-1: Open Pit Drill Hole ABA Sampling Flow Chart

#### 3.1.5.2 Underground Development Waste

The sampling procedure for sampling for underground development waste is summarized in Figure 3-2, and is detailed below.

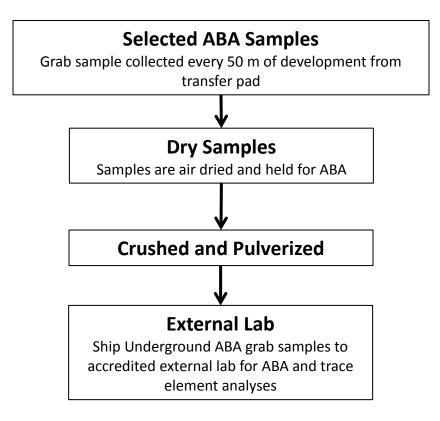


Figure 3-2: Underground Waste Rock ABA Sampling Flow Chart

#### 3.1.6 Tailings Solids

The objective of the tailings solids monitoring program is to maintain an inventory of the geochemical properties of the tailings produced during the project life. This is achieved through analysis of monthly composite tailings samples that are formed by combining weekly grab samples. Each week, a grab sample is collected which contributes the monthly composite sample. The monthly composite is air dried and sent to an accredited laboratory for ABA and trace element analysis. Analytical results are added to the existing mine database and reported on an annual basis as part of the WUL and QML Annual Report.

## **3.1.7** Construction Materials

ABA test work must be conducted on all mined materials proposed for use in construction. Testing of potential construction material will occur during routine pit operations as described in Section 3.1.5, and

will be carried out on-site. Construction material must meet the requirements outlined in the WUL and QML to be used for construction:

WUL	QML
Total copper content of <0.10%	Copper content no greater than 0.10%
NP:AP greater than or equal to 3	NP:AP of at least 3:1
Total sulphur content of less than 0.3%	Total sulphur content of no greater than 0.3%

## 3.2 Waste Rock Management Verification Program

The Waste Rock Management Verification Program supports the waste rock management procedures at the mine. The results of this program will be detailed in the WUL and QML Annual Report.

The program includes detailed record-keeping on the types and quantity of waste rock placed at each location, and monitoring and verification of the characteristics of the waste rock stored at each location as per the WROMP.

Minto tracks all material dispatched between sources and destinations generated using the mine's production tracking database system. This data is based on load count sheets compiled by the mining contractor.

A monthly dump sampling program takes place at Minto. The procedure is as follows:

- 1. At monthly intervals, mine personnel will visit every dump crest that was active over the preceding month, as determined by an analysis of the production tracking database system.
- 2. At 25 m intervals along each active dump crest, the waste rock will be manually sampled.
- 3. For each sample, one shovel-full of material will be collected and labelled. Particles greater than fist size will be manually rejected at the time of sampling.
- 4. The resulting samples will be crushed, pulverized, and split in Minto's assay lab such that a representative sample is obtained.
- 5. Each sample will be analyzed at site for copper, total sulphur (S(T)), and total carbon (C(T)) content using an Eltra CS-800 induction furnace with infrared detectors.
- 6. S(T) and C(T) values are converted into equivalent acid potential (AP-S(T)) and neutralization potential (NP-C(T)) values, and NP-C(T):AP-S(T) ratios are calculated for each sample.
- 7. Resulting NP-C(T):AP-S(T) ratio values are compared to the segregation criteria and assigned 'Pass' or 'Fail' verification designations.

If two or more adjacent failures occur, the crest will be resampled at 5 m intervals over each 25 m crest section represented by the failed samples. Sampling and analysis will follow steps 3 through 6 in the procedure described above. The average copper grade and NP-C(T) and AP-S(T) for the suspect zone will

be calculated, and then the (Average NP-C(T)) : (Average AP-S(T)) ratio value for the zone will be calculated. Isolated failures will be accepted with no further action.

If the calculated bulk zone NP-C(T):AP-S(T) ratio is below the segregation criteria for the dump, further sampling will be carried out to define the limits of the zone in three dimensions. Should the material remain non-conforming it will be evaluated as to whether it is appropriate to remain in place or excavate it to a waste rock dump that will be saturated at closure. If it is determined to be a geochemical risk (i.e. large volume concentrated in one area) to the waste dump it will be excavated and relocated to one of the waste rock dump locations that will ultimately be saturated; no relocation will occur if the non-conforming waste rock is already located where saturated conditions will exist in the long term (i.e. in an in-pit dump below the expected final water table elevation).

# 3.3 Low Grade and Oxide Ore Metals Leaching Characterization Program

#### 3.3.1 Introduction

Clause 94 of Water Licence QZ14-031 included a requirement to update the Geochemical Monitoring Program to include detailed metals leaching characterization from low-grade ore and oxide ore. The text of Clause 94 is copied here for ease of reference:

94) The Licensee shall update the Geochemical Monitoring Program to include a monitoring and geochemical characterization program that will produce detailed metals leaching characterization from the low-grade ore and oxide ore.

This section of the EMSRP is intended to satisfy the Clause 94 requirement. However, Minto does not characterize any of the mined material on site as either low-grade ore or oxide ore and therefore in the strictest sense it is not possible to comply with this licence condition. In an attempt to address the intent of this clause, Minto has assumed that testing of the lowest grade ore material (categorized as Blue Ore by the site mine operations department) and of partially oxidized ore (categorized as POX by the site mine operations department) will be adequate.

#### 3.3.2 Material Descriptions

Blue Ore is defined as ore grade material having a total copper content range of 0.5 to 0.99%. On site, Blue Ore is stockpiled in the ore stockpiles area south of the mill, between the ridge hosting the Area 2 Stage 2 Pit and the combined Dry Stack Tailings Storage Facility and the Mill Valley Fill Extension.

POX is defined as ore grade material that is partially oxidized and having a similar copper content range as Blue ore (0.5 to 0.99%). POX was stockpiled west of the Main Pit and east of the Main Waste Dump- in the past, two separate ore stockpiles (one POX and one Blue Ore stockpile) had been developed in this general area.

#### 3.3.3 Construction Details

The characterization and monitoring has been completed by construction of a large scale on-site leaching test for each material type (Blue Ore and POX), paired with static laboratory tests to define the geochemical characteristics of the materials being tested.

The leaching tests therefore consist of two large leach pads (each nominally 5 m x 5 m), with both leach pads being lined with a Bituminous Geosynthetic Membrane (BGM) liner. The first pad (designated as LP#1), has been loaded with a depth of 1 to 2 m with run-of-stockpile POX, while the second pad (designated as LP#2) has been loaded with a depth of 1 to 2 m with run of stockpile Blue Ore. The leach pads are subject to ambient site temperature and precipitation conditions, and collection of leachate is accomplished by appropriate grading of the leach pad base and installation of a drain pipe through the BGM liner to allow collection of leachate samples.

Static laboratory testing consists of sampling and analysis of test materials during the initial construction of the test in the manner described for both internal and external laboratory analysis of waste rock under the ABA Monitoring Program.

The Meteorological Monitoring Program results provide companion meteorological data to complement the leaching tests.

#### 3.3.4 Monitoring

Monitoring of leach pads will consist of monthly collection and analysis of water samples from each drain pipe during non-frozen months, with sampling and analysis protocols adopted from the Seepage Monitoring Program. The study will continue for a period 13 to 18 months, with the minimum 13 month period representing a monitoring period beginning in April-May of 2018 and terminating following April – May of 2019. This duration will allow the monitoring results to capture a measure of variability.

## 4 Meteorological Monitoring Program

Meteorological Monitoring at the Minto Mine consists of meteorological monitoring and data collecting, including data on rainfall, snowfall, temperature, evaporation, wind speed and direction, and total sunshine hours. The Meteorological Monitoring Program is comprised of the Climate Monitoring Program (section 4.1) and the Snow Survey Program (section 4.2).

Data collected under the Meteorological Monitoring Program, along with baseline climatic data, provides input for the following mine projects:

- Site water management;
- Prediction for yearly water events (e.g. freshet);
- Design of water storage, conveyance and discharge systems; and
- Design of flood control structures on the road network.

## 4.1 Climate Monitoring Program

The objective of the Climate Monitoring Program is to collect climatic data specifically for the Minto Mine site. The monitoring areas consist of a meteorology station located north east of the Minto Mine airstrip. The meteorological station logs parameters at hourly intervals. The loggers are downloaded twice per month. During the download process, staff inspect the meteorological station for inoperative equipment.

The meteorology station is a research grade Campbell Scientific station that records the following parameters: maximum wind speed, minimum wind speed, average wind speed, wind direction, precipitation (rain and snow), temperature, relative humidity, pan evaporation, barometric pressure, solar radiation, outgoing radiation and calculated evapotranspiration.

The meteorology station was installed October 15, 2010 and runs on a Campbell Scientific CR1000 datalogger. Met Station 2 consists of a 10 m tower with instrumentation to measure air temperature, incident solar radiation, outgoing radiation, precipitation – rain and snowfall, barometric pressure, evapotranspiration, relative humidity, and wind speed, direction and events.

Data are averaged over the one-hour archiving period and then saved to the datalogger. In late November 2014, a wireless link was established with the Met Station 2 to allow remote real-time data viewing and downloads. Additionally, in November 2014, a Geonor T200 vibrating wire precipitation gauge was installed.

Winter precipitation is measured with the Geonor T200 precip gauge that uses antifreeze to melt solid precipitation into a container. The amount of precipitation is measured by using vibrating wire load sensors.

Incoming solar radiation is measured with a SP Lite2 Silicon Pyranometer. The SP Lite2 measures incoming solar radiation (sun plus sky radiation) with a photodiode detector. Output from the photodiode is a current, which is converted to voltage by an internal shunt resistor. The SP Lite2 can be used in solar energy applications such as plant growth, thermal convection and evapotranspiration.

The evapotranspiration calculation was incorporated into the Campbell Scientific program in July 2012.

Evapotranspiration is calculated as mm of water loss per hour. The datalogger measures energy fluxes required to calculate evapotranspiration utilizing the solar radiation sensor.

An evaporation pan and sensor for measuring outgoing radiation was commissioned in 2016.

Data is downloaded, compiled and reported in monthly and annual WUL reporting.

## 4.2 Snow Survey Program

The objective of the Snow Survey Program is to collect snow data used for calculating the snow water equivalent specifically at the Minto Mine. Snow water equivalents are inputs to the Minto Mine Site

Water Balance models. Three courses are surveyed during the first week of February, March & April each year. If conditions permit, Minto will additionally survey the snow courses in May. These courses are East-facing (near the Dyno compound), North-facing (near the airstrip) and South-facing (above the Tank Farm), detailed in Table 4-1. Along each course, ten stations are sampled using a machined core tube with cutting end and scale with assembly. The parameters collected during the surveys include snow depth, core length, core weight, snow density, weather, site conditions, snowpack conditions, crust layers, and snow temperature.

Course	Description	Aspect		UTM	
Location	tion Description Aspe		Easting	Northing	
Dyno	East of the Dyno compound on an east facing slope along a cut line surrounded by moderately densely tree area.	East Facing	8V 383 594	694 3377	
Fuel Farm	North of the Minto Mine fuel farm on a south facing slope in a sparse to moderately densely treed area.	South Facing	8V 385 061	694 5318	
Airstrip	Northeast of the Minto Mine airstrip on a north facing slope in a sparsely treed area.	North Facing	8V 386 255	694 4284	

Snow sampling procedures are conducted following a standard operating procedure, developed in accordance with the BC Ministry of Environment's *Snow Survey Sampling Guide* (Ministry of Environment, 1981). The Snow Survey Program was reviewed and authorized as part of the licencing process for QZ14-031. A sample field data sheet is provided in Figure 4-1.

-	:	12 (1/1)	1					
Driving wr	rench use	d? (Y/N)						
Station No.	With dirt	epth (cm) Without dirt	Core Length (cm)	Weight: Tube & Core	Weight: Tube only before	Snow Water Equivalent (cm)	Density (%)	
11488411	plug	plug			sampling			
1	64	62	54	39	24	15	24.2	
2	63	61	48	36	24	12	19.7	
3	69	67	56	39	24	15	22.4	
4	67	65	49	38	24	14	21.5	
5	67	65	52	39	24	15	23.1	
6	69	67	53	38	24	14	20.9	
7	71	69	53	39	24	15	21.7	
8	72	70	61	41	24	17	24.3	
9	73	71	63	42	24	18	25.4	
10	76	74	63	42	24	18	24.3	
11	76	74	60	40	24	16	21.6	
12	70	67	56	39	24	15	22.4	
Total	694	674	549	391	240	151	246.1	
Average	69.4	67.4	54.9	39.1	24	15.1	22.4	
Checked Field Note		s & date):						0.7
Weather:	Clear & si	unny					Snow Temp:	-6°C
		Surfa	ce snow c	onditions:			Remarks:	
Wet Soft		Soft					Density ra	
Dry X		Crusted	х				to 24.3% =	4.6%
Flat		Drifted					Av core to	snow
Freeze Thaw						depth = 81		
		Sar	npling con	ditions:	L			12215
	Easy		Moderate	e Difficult		Station 9 discarded (outlier).		

Figure 4-1: Sample Snow Survey Field Form

## **5** Physical Monitoring Program

The objective of the Physical Monitoring Program is to monitor the performance of key mine infrastructure and workings. Outlined in Table 5-1 is the mine infrastructure that requires monitoring under the Physical Monitoring Program; the infrastructure descriptions and instrumentation in place are further outlined in Table 5-1.

The Physical Monitoring Program consists of two main components: instrumentation to measure ground conditions and deformation; and, regular geotechnical inspections. Instrumentation to measure ground conditions and deformation include the following:

- Survey hubs;
- Inclinometers;
- Thermistors; and

• Vibrating Wire Piezometers.

Instrumentation (new or replaced) is installed in accordance with design reports / recommendations of third-party engineer, including those from past geotechnical inspections.

Monitoring and inspection schedules for each structure and associated reporting requirements are detailed in the *Physical Monitoring Plan* (Appendix 4).

Table 5-1: Physical Monitoring Program Mine Structures and Instrumentation

Structure	Description	Instrumentation
Area 2 Pit and Area 2 Pit Tailings Management Facility (A2PTMF)	The Area 2 Pit was completed in 2015 to the extents licensed under Phase IV (Stages 1 and 2); the pit was extended to the south as part of Phase V/VI (Stage 3 and Stage 3 Expansion), scheduled to be complete in 2018. Tailings deposition into Area 2 Stage 2 pit (A2S2) began in March, 2015 and the pit is now maintained as a tailings management facility. Dumping of NP:AP<3 waste rock (SAT), intended to be below the final water table at closure, has commenced into the pit.	<ul> <li>Survey hubs</li> <li>GroundProbe radar (during active mining)</li> </ul>
Area 2 Underground	The Area 2 underground began development in 2016 and is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production mining is currently taking place using a longhole stoping method and is expected to be completed in 2018.	None
Area 118 Pit	Mining of the Area 118 Pit was carried out in 2014. As part of Area 2 Stage 3 pit mining, overburden is being dispatched to the Area 118 pit, referred to as the Area 118 Backfill Dump.	Survey hubs
Area 118 Backfill Dump	The Area 118 Backfill Dump is included in the Phase V/VI licence and commenced in 2017. Construction will continue for the duration of the Area 2 Stage 3 Pit. The dump will fill in the Area 118 Pit.	None
Area 118 Underground	The Area 118 underground began development in 2013 and was completed in 2016. It is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production mining took place using a longhole stoping method.	None
Big Creek Bridge	Bridge on the Minto access road crossing Big Creek, located at Km 19. Licenced under Type B water licence MS15-094.	None
Barge Landings	Barge landings on the Minto access road at the Yukon river. Licensed under Type B water license MS15-094.	None
Camp	The camp consists of several connected bunkhouse buildings (Sherwood, Minto, Selkirk), a kitchen building, and several separate buildings including the gym and Site Services offices.	None
Copper Keel and Wildfire Underground	The Copper Keel and Wildfire underground are in the phase V/VI mining plan and have not commenced yet.	N/A

Structure	Description	Instrumentation
Dry Stack Tailings Storage Facility (DSTSF)	Construction of the DSTSF with filtered tailings placement was carried out from 2007 to November 2011. As part of progressive reclamation activities in 2012-2013, the DSTSF was covered with a layer of overburden approximately one to four meters thick. The DSTSF began showing deformation in 2009, interpreted as primarily horizontal sliding towards the north/northeast on an ice-rich layer in the underlying overburden, several meters above bedrock. The movement has continued since then but at a decreasing rate in response to construction of both the Mill Valley Fill waste rock buttress and the Mill Valley Fill Extension 2 waste rock buttress.	<ul> <li>Survey hubs</li> <li>Thermistors</li> <li>Inclinometers</li> <li>Piezometers</li> </ul>
Ice Rich Overburden Dump (IROD)	Originally constructed as a free-standing rockfill structure to contain ice-rich overburden. The IROD is no longer active and is now entirely surrounded by the Southwest Waste Dump rockfill. The area has been reclaimed with the Southwest Waste Dump in 2017.	None
Main Pit (Area 1 Pit) and Main Pit Tailings Management Facility (MPTMF)	slurry tailings denosition into the nit began in 2012 and the nit is now	
Main Pit Dump	The Main Pit Dump is included in the Phase V/VI licence. Construction commenced in 2017. The dump is located on the southwest side of the Main Pit.	Survey hubs
Main Waste Dump (MWD)	The Main Waste Dump stores waste rock released during the mining of the first three stages of the Main Pit. The dump is no longer active.	Inclinometer
Main Waste Dump Expansion (MWDE)		
Main Waste Dump Wrap (MWDW) This dump is a reclamation feature to shallow the slopes of the Main Waste Dump for reclamation purposes.		None
Mill Site	The mill site consists of the mill building, crusher and crusher stockpile pad.	None
Mill Valley Fill Extension (MFVE)	A waste rock buttress to the north of the DSTSF, constructed from January 2012 to March 2013 to prevent or decrease movement of the DSTSF.	Survey hubs
Mill Valley Fill Extension 2 (MVFE2)	An extension of the MVFE waste rock buttress to the northeast, constructed from November 2015 to August 2016 to further decrease movement of the DSTSF.	<ul><li>Piezometers</li><li>Survey hubs</li><li>Inclinometers</li></ul>

Structure	Description	Instrumentation	
Mill Valley Fill Extension 2 Collection Sump	A replacement sump for the Minto Creek Detention Structure (MCDS), constructed in 2016. It detains surface water considered impacted from upstream sub-catchment areas and directs it to the MPTMF or water treatment plant.	None	
Minto Access Road	Road from the Yukon River barge crossing to the mine site. Licenced under Type B water licence MS15-094.	None	
Minto East Underground	Ramping to the Minto East underground began development in 2017 and is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production will use a longhole stoping method and is expected to start in 2018.	None	
Minto North Pit	Mining of the North Pit was completed in September 2016. The pit is currently inactive and the access is barricaded.	None	
Ore Stockpiles	There are two primary ore stockpiles on site – North and South stockpile. These are located south of the crusher and east of the Area 2 pit.	None	
Reclamation Overburden Dump (ROD)	Received the bulk of the overburden released as part of Phase IV and earlier mining of the Main Pit. The material in the ROD is available for use in reclamation of the mine at closure.	None	
Ridgetop Pit (Ridgetop North Pit, Ridgetop South Pit)	The Ridgetop Pits are included in the Phase V/VI licence and has not commenced yet. Mining is planned to start in 2018.	GroundProbe radar (during mining)	
Ridgetop Waste Dump	The Ridgetop Waste Dump is included in the Phase V/VI licence and has not commenced yet. Dumping is planned to start in 2018.	N/A	
South Diversion Ditch	This structure was decommissioned in 2017 to allow for Area 2 Stage 3 Expansion mining activities.	None	
South Wall Buttress (SWB)	Waste rock buttress constructed against the Main Pit south wall from 2009-2011 as a result of instability in the south wall of the pit.	Survey hubs	
Southwest Waste Dump (SWD)	The Southwest Waste Dump (SWD) stores waste rock released during phase IV mining. Dumping at the SWD is now complete and reclamation re-sloping began in 2015. Re-sloping is expected to be completed in 2018.	<ul> <li>Survey hubs</li> <li>Inclinometers</li> <li>Thermistors</li> <li>Piezometers</li> </ul>	
Tailings Diversion Ditch (TDD)	A diversion ditch located south of the DSTSF to divert unimpacted water around the tailings facility. The intake structure was extended in 2017 to allow for the decommissioning of the South Diversion Ditch with A2S3 Expansion mining.	None	
Water Storage Pond Dam (WSP)	The Water Storage Pond and Dam are located east of the mine along Minto Creek. The dam was constructed in 2006 as a clay-core water retention dam for collecting precipitation and surface water runoff at the site. Maximum depth of water at the face of the dam is approximately 15 m.	<ul> <li>Survey hubs</li> <li>Thermistors</li> <li>Piezometers</li> </ul>	

Roles and responsibilities for the Physical Monitoring Program are detailed in Table 5-2, below.

Role	Responsibilities
Mine Technician Assistants	<ul> <li>Collect instrumentation data at specified frequencies</li> <li>Input data into monitoring spreadsheets/databases</li> <li>Internal reporting of monitoring data</li> <li>Maintain equipment</li> </ul>
Geotechnical Engineers	<ul> <li>QA/QC of data collection</li> <li>Ensure compliance with license requirements</li> <li>Monthly and Annual Water Licence reporting</li> <li>Visual inspections at specified frequencies</li> <li>Communicate with consultants as required</li> <li>Review and update <i>Physical Monitoring Plan</i></li> </ul>
Environmental Department	<ul> <li>Compile Monthly and Annual Water Licence reports</li> <li>Visual inspections of water diversion/collection structures</li> </ul>
Chief Engineer	<ul> <li>Review Monthly and Annual Physical Monitoring reports</li> <li>Ensure compliance with license requirements</li> </ul>

The Physical Monitoring Program is updated annually as part of the WUL and QML Annual Report. New instrumentation, replaced damaged instrumentation and changes in monitoring methods and procedures are detailed if applicable. Results and interpretation of the program are detailed in the Annual Report. Furthermore, the Physical Monitoring Program is reported as part of the WUL monthly reporting; each month a Geotechnical Engineer reviews, summarizes and signs a report detailing the information collected as part of the Physical Monitoring Program.

## 6 Aquatic Environmental Monitoring Program

Under the WUL Minto is required to implement an Aquatic Environmental Monitoring Program (AEMP) as part of the EMSRP. The AEMP includes several elements as listed in the WUL. Specifically, Clause 101 of the WUL indicates:

The Aquatic Environmental Monitoring Program shall be updated to include:

a) MMER Environmental Effects Monitoring;

b) Sediment Toxicity sampling, analyses and reporting; and

c) Invertebrate Tissue Chemistry sampling, analyses and reporting.

Clause 102 of the WUL indicates:

The Licensee shall review and evaluate the Aquatic Environmental Monitoring Program design every three (3) years and submit the findings to the Board, along with any recommendations for further refinements, as a part of the Annual Report, starting in 2016.

The WUL re-iterates the need for Environmental Effects Monitoring (EEM) under the Metal Mining Effluent Regulations (MMER) of the federal Fisheries Act in WUL Clauses 87 and 88. Minto has been implementing all aspects of the MMER (including EEM) in accordance with the regulation (Government of Canada, 2015) and technical guidance for EEM (Environment Canada, 2012) since becoming subject to the regulation on July 10, 2006. Similarly, the Minto Mine has been implementing environmental monitoring programs in accordance with WUL requirements since the issue of the first WUL in 1996 (WUL QZ96-006).

Section 6 provides an overview of the integrated AEMP, which includes EEM and the additional aquatic environmental monitoring requirements of the WUL. The Minto Mine's substantial routine effluent and water quality monitoring program, also implemented to meet requirements of both the MMER and the WUL, is presented elsewhere. Current components of the integrated AEMP include: site characterization, effluent characterization, effluent sublethal toxicity testing, supporting water quality, sediment quality, sediment toxicity testing, periphyton chlorophyll  $\alpha$ , periphyton tissue quality, periphyton community, benthic invertebrate tissue quality, fish population study, and other supporting measures (Table 6-1, Figure 6-1, Figure 6-2). In accordance with WUL Clause 108, the AEMP study design will be reviewed and evaluated every three years, with the findings and recommendations for further refinements submitted to the Yukon Water Board as part of the Annual Report starting in 2016. Each of the current AEMP components is described in the sections that follow. Additionally, a summary table of the AEMP programs and study design components and AEMP supporting measures is presented in Appendix 5.

AEMP Program	Components		AEMP Sections	
	Site Characterization			
	Effluent Characterization		1) Site Characterization	
	Effluent Sublethal Toxicity Testing	2) Effluent Characterization		
Environmental Effects Monitoring	Supporting Water Quality	_	3) Effluent Sublethal Toxicity Testing 4) Supporting Water Quality	
	Benthic Invertebrate Community	1		
	Fish Population Study <sup>1</sup>		<ol> <li>5) Sediment Quality</li> <li>6) Sediment Toxicity Testing</li> </ol>	
	Other Supporting Measures		7) Periphyton Chlorophyll α	
	Sediment Quality		8) Periphyton Community	
Sediment Quality and Toxicity	Sediment Toxicity Testing	_	8) Periphyton Tissue	
	Periphyton Chlorophyll α		<ul><li>9) Benthic Invertebrate Community</li><li>10) Benthic Invertebrate Tissue</li></ul>	
Deviale star and Devide Investerate Tiesus	Periphyton Community	1	11) Fish Population Study	
Periphyton and Benthic Invertebrate Tissue	Periphyton Tissue	1	12) Other Supporting Measures	
	Benthic Invertebrate Tissue			

#### **Table 6-1: AEMP Programs and Components**

Minto Explorations Ltd. Minto Mine


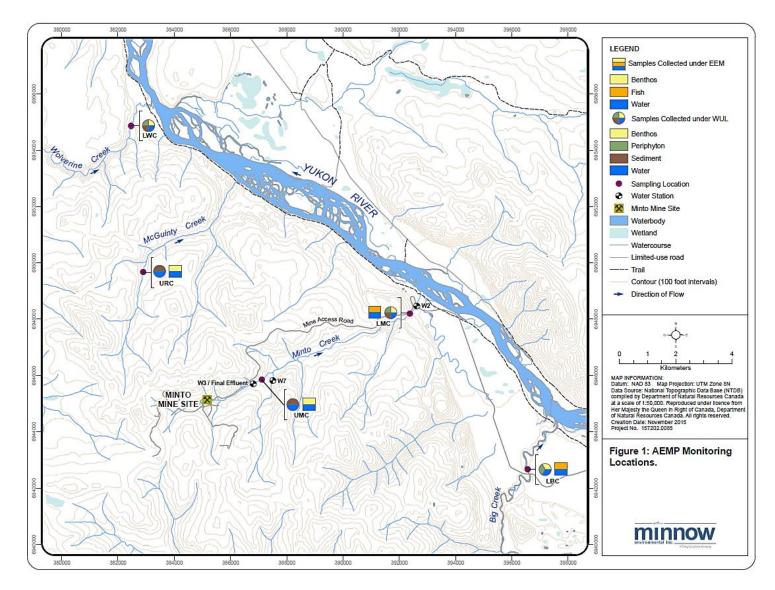


Figure 6-1: AEMP Monitoring Locations

Minto Explorations Ltd. Minto Mine

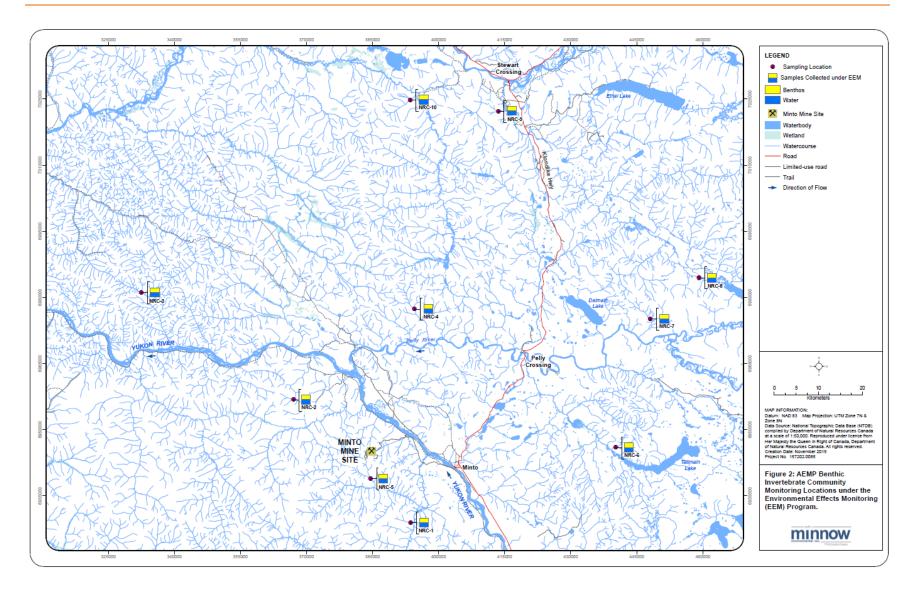

#### Figure 6-2: AEMP Benthic Invertebrate Community Monitoring Locations under the EEM Program

## 6.1 Metal Mine Effluent Regulations Monitoring Programs

The *Metal Mine Effluent Regulations* (MMER) Monitoring Programs are composed of Effluent Monitoring and the Environmental Effects Monitoring programs. Sections 6.1.1 and 6.1.2 describe each program.

## 6.1.1 Metal Mine Effluent Monitoring

The *Metal Mine Effluent Regulations* (MMER) outline requirements for monitoring and reporting of discharged effluent volume and quality under the MMER to Environment Canada. The Metal Mine Effluent Program aims to maintain compliance with the MMER and the program will be revised should regulation amendments occur. Specifically, the Metal Mine Effluent Program requires effluent monitoring with sampling at station W3, downstream of the end of pipe discharge (Figure 2-1). Effluent monitoring requirements are outlined in Table 6-2. Effluent monitoring samples are collected when there is a deposit of water at W3; testing occurs weekly for deleterious substances. Radium 226 and acute lethality tests are conducted quarterly due to the reduced frequency guidelines outlined in the MMER. The MMER specifies requirements for increased testing frequencies if the Radium 226 or acute lethality tests do not meet the prescribed standards as detailed in the MMER.

Weekly effluent monitoring samples are tested for the deleterious substances as described in the MMER including the total metals arsenic, copper, lead, nickel and zinc; total suspended solids (TSS) and pH. Weekly samples are collected at least 24 hours apart.

Reporting of the effluent monitoring results, and discharge volumes is required quarterly and annually to Environment Canada, under the Regulatory Information Submission System (RISS).

Water Quality Monitoring Stations	Monitoring Frequency	Analytical Parameters	
W/2 Compliance Deint	Weekly	<ol> <li>Effluent Volume</li> <li>Water Quality: in-situ field parameters, physical parameters, nutrients, and total metals</li> </ol>	
W3 – Compliance Point	Quarterly	3. Water Quality: Radium 226 and acute lethality tests on both Daphnia magna and Rainbow trout ( <i>Oncorhynchus mykiss</i> ).	

 Table 6-2: Metal Mine Effluent Monitoring Program Requirements and Frequency

#### 6.1.2 Environmental Effects Monitoring

Environmental Effects Monitoring under the MMER includes Site Characterization, Effluent Characterization, Effluent Sublethal Toxicity and Supporting Water Quality Monitoring.

#### 6.1.2.1 Site Characterization

Site characterization is prescribed for EEM under the MMER (Government of Canada, 2015), with requirements described in associated technical guidance (Environment Canada, 2012). Site characterization is required with every EEM Study Design Report, which is submitted to Environment Canada for review and approval every three years prior to the implementation of EEM biological monitoring. The purpose of site characterization is to provide a review and update of features of the site and the effluent receiving environment pertinent to the design of the EEM study (Table 6-3).

Component	Consideration
Mine History	Date of startup
	Dates of major operational changes
	Dates of changes to tailings management
	Dates of changes to effluent management
Current Operations	Mining processes
	Milling processes
	Water management
	Waste rock disposal
	Tailings disposal
	Wastewater disposal
	Reagent use
	Environmental protection processes
	Effluent management and discharge
	Effluent mixing
Effluent Quality	MMER routine compliance monitoring
	MMER effluent characterization
	MMER sublethal toxicity
	Other regulations applicable to effluent
Water Quality	MMER water quality characterization
Habitat Inventory and Classification	Habitat classification
	Physiography and geomorphology
	Hydrology
	Geology
	Substrates
	Plant communities
	Chemistry

#### Table 6-3: Site Characterization Information in the EEM Study Design Report

Component	Consideration
Fish and Other Aquatic Resources	Fish community
	Population abundance
	Benthic communities
	Other
Potential Confounding Factors	Historical versus current influences
	Other historical or current discharges or seeps

## 6.1.2.2 Effluent Characterization

Effluent characterization is also prescribed under MMER (Government of Canada, 2015) and described in associated technical guidance (Environment Canada, 2012). Briefly, MMER effluent characterization is conducted four times per year, not less than one month apart. Effluent characterization includes a broader suite of analytes than routine effluent monitoring under the MMER, including hardness, alkalinity, aluminum, cadmium, iron, mercury, molybdenum, selenium, ammonia and nitrate (Government of Canada, 2015). In accordance with the MMER, Minto no longer has to include mercury as concentrations have been less than  $0.10 \mu g/L$  in 12 consecutive samples collected for effluent characterization. As previously indicated, the Minto Mine completes substantial additional effluent quality monitoring, described elsewhere in the EMSRP.

#### 6.1.2.3 Effluent Sublethal Toxicity Testing

Effluent sublethal toxicity testing is also prescribed under MMER (Government of Canada, 2015) and associated technical guidance (Environment Canada, 2012). Effluent toxicity testing is required using a total of four tests; one each of a fish, invertebrate, algae and plant species. Minto Mine initially implemented these tests twice per year, but in accordance with the MMER now implements them once per year as more than three years of testing have been completed. Tests are completed using Environment Canada Biological Test Methods and include sublethal tests of rainbow trout (*Oncorhynchus mykiss*) development or fathead minnow (*Pimephales promelas*) survival and growth, the invertebrate *Ceriodaphnia dubia* survival and reproduction, the algae *Pseudokerchneriella subcapitata* growth, and the plant *Lemna minor* growth using Environment Canada test methods (1998, 2007, 2011).

## 6.1.2.4 Supporting Water Quality

Water quality monitoring is also prescribed under MMER (Government of Canada, 2015) and associated technical guidance (Environment Canada, 2012). Briefly, MMER water quality monitoring is conducted four times per year, not less than one month apart. MMER water quality monitoring is completed in lower Minto Creek (Station W2) and a reference tributary to Minto Creek (Station W7; Figure 6-1) and includes pH, hardness, alkalinity, electrical conductivity, aluminum, arsenic, cadmium, copper, iron, lead, molybdenum, nickel, selenium, zinc, total suspended solids, ammonia and nitrate (Government of Canada, 2015). In accordance with the MMER, Minto Mine no longer has to include mercury or radium-

226 as relaxation conditions have been met based on previous monitoring results. Water samples are also collected as supporting measures for biological sampling (periphyton, benthic invertebrates and fish) and include, at minimum, all analytes listed above (and generally those listed in Table 6-4). As with effluent quality monitoring, and as previously indicated, the Minto Mine completes substantial additional water quality monitoring, described elsewhere.

Water	Sediment	Periphyton and Benthic Tissue
Conductivity	Total Kjeldahl Nitrogen	Total Aluminum (Al)
Hardness (as CaCO <sub>3</sub> )	Particle Size	Total Antimony (Sb)
рН	Inorganic Carbon	Total Arsenic (As)
Total Suspended Solids	Inorganic Carbon (as CaCO₃ Equivalent)	Total Barium (Ba)
Total Dissolved Solids	Total Carbon by Combustion	Total Beryllium (Be)
Turbidity	Total Organic Carbon	Total Bismuth (Bi)
Alkalinity, Total	Total Aluminum (Al)	Total Boron (B)
Ammonia, Total (as N)	Total Antimony (Sb)	Total Cadmium (Cd)
Chloride (Cl)	Total Arsenic (As)	Total Calcium (Ca)
Fluoride (F)	Total Barium (Ba)	Total Cesium (Cs)
Nitrate (as N)	Total Beryllium (Be)	Total Chromium (Cr)
Nitrite (as N)	Total Bismuth (Bi)	Total Cobalt (Co)
Phosphorus (P)-Total dissolved	Total Cadmium (Cd)	Total Copper (Cu)
Phosphorus (P)-Total	Total Calcium (Ca)	Total Iron (Fe)
Sulfate (SO <sub>4</sub> )	Total Chromium (Cr)	Total Lead (Pb)
Cyanide, Total	Total Cobalt (Co)	Total Lithium (Li)
Dissolved Organic Carbon	Total Copper (Cu)	Total Magnesium (Mg)
Total Organic Carbon	Total Iron (Fe)	Total Manganese (Mn)
Total Inorganic Carbon	Total Lead (Pb)	Total Mercury (Hg)
Total and Dissolved Metals	Total Lithium (Li)	Total Molybdenum (Mo)
Aluminum (Al)	Total Magnesium (Mg)	Total Nickel (Ni)
Antimony (Sb)	Total Manganese (Mn)	Total Phosphorus (P)
Arsenic (As)	Total Mercury (Hg)	Total Potassium (K)
Barium (Ba)	Total Molybdenum (Mo)	Total Rubidium (Rb)
Beryllium (Be)	Total Nickel (Ni)	Total Selenium (Se)
Bismuth (Bi)	Total Phosphorus (P)	Total Sodium (Na)
Boron (B)	Total Potassium (K)	Total Strontium (Sr)
Cadmium (Cd)	Total Selenium (Se)	Total Tellurium (Te)
Calcium (Ca)	Total Silver (Ag)	Total Thallium (Tl)
Chromium (Cr)	Total Sodium (Na)	Total Tin (Sn)
Cobalt (Co)	Total Strontium (Sr)	Total Uranium (U)
Copper (Cu)	Total Thallium (Tl)	Total Vanadium (V)
Iron (Fe)	Total Tin (Sn)	Total Zinc (Zn)
Lead (Pb)	Total Titanium (Ti)	Total Zirconium (Zr)
Lithium (Li)	Total Uranium (U)	
Magnesium (Mg)	Total Vanadium (V)	

#### Table 6-4: AEMP Laboratory Analysis for Water, Sediment and Tissue samples

Water	Sediment	Periphyton and Benthic Tissue
Manganese (Mn)	Total Zinc (Zn)	
Mercury (Hg)		
Molybdenum (Mo)		
Nickel (Ni)		
Phosphorus (P)		
Potassium (K)		
Selenium (Se)		
Silicon (Si)		
Silver (Ag)		
Sodium (Na)		
Strontium (Sr)		
Thallium (Tl)		
Tin (Sn)		
Titanium (Ti)		
Uranium (U)		
Vanadium (V)		
Zinc (Zn)		

## 6.2 Sediment Quality and Toxicity Monitoring

The Sediment Quality and Toxicity Monitoring components of the AEMP are described in the following sections.

## 6.2.1 Sediment Quality

The objective of sediment quality monitoring is to determine if the Minto Mine has influenced the sediment quality of Minto Creek. Sediment quality monitoring is completed annually in September in both upper and lower Minto Creek (Figure 6-1, Appendix 5). Sediment quality of upper Minto Creek (immediately downstream of Station W3) is monitored and compared to the reference area located at upper McGinty Creek (Figure 6-1, Appendix 5). Sediment quality of lower Minto Creek is monitored and compared to the reference area lower Wolverine Creek (Figure 6-1, Appendix 5). Depositional areas, quiescent pools and wetted backwater locations are targeted as these areas contain more fine sediment (silt and clay) and the most recently deposited sediment.

At upper Minto and upper McGinty creeks, sediment samples are collected using a stainless steel or Teflon spoon (Figure 6-1, Appendix 5). Fine surficial sediment is collected from five stations to represent each area. A sample for sediment chemistry is collected at each station. Because sediment is sparsely distributed in the upper creek areas, one supporting sample for sediment physical characterization (particle size analysis) is collected as a composite sample from all five stations to represent the area. This effectively captures spatial variability within the area. Each sample is made up of at least 10 scoops. Samples in lower Minto and lower Wolverine Creek are collected using a hand corer for chemical characterization and a petite ponar grab sampler for particle size characterization. Fine surficial sediment

is collected from five stations to represent each area. The top 2 cm of three cores or grabs, respectively, are collected to make a composite sample for each station. Field sieving of the sediment samples is not necessary due to the particle size distributions. However, laboratory sieving to < 2.0 mm is standard practice and is applied in the AEMP sediment monitoring. Thus, all metal results are for < 2.0 mm sediment.

Following collection, sediment samples are kept cool and are sent to a Canadian Association for Laboratory Accreditation (CALA) accredited analytical laboratory for analysis as soon as possible. Sediment quality analytes include particle size, total organic carbon, total Kjeldahl nitrogen, metals and metalloids (Table 6-4).

Sediment quality of Minto Creek is evaluated in comparison to Canadian Environmental Quality Guidelines (CEQG) for sediment (CCME, 2014), by statistical contrast of exposed (Minto Creek) and reference areas and by comparison to previous sediment quality data to evaluate temporal change. Simultaneously extracted metals (SEM) and acid volatile sulfides (AVS) testing were considered but are most relevant to anoxic and sub-oxic sediment. The SEM and AVS tests would have limited value in upper Minto Creek where sediment is only present as a skim over sand or sand and rocks. Furthermore, sediment toxicity testing is captured with the ten-day toxicity tests.

## 6.2.2 Sediment Toxicity Testing

The objective of the sediment toxicity testing program is to determine if Minto Creek sediment adversely affects survival or growth of toxicity test organisms. Toxicity is evaluated using two standard sediment toxicity tests once a year in September, concurrent with sediment collections for sediment quality. Sediment toxicity tests are the 10-day *Chironomus dilutus* test of survival and growth (Environment Canada, 1997) and the 14-day *Hyalella azteca* test of survival and growth (Environment Canada, 2013). Sediment from lower Minto Creek and the reference area (lower Wolverine Creek) are tested (Figure 6-1, Appendix 5). Sediment in upper Minto Creek is too sparse to justify performing these tests.

Sediment for toxicity testing is collected using a petite ponar grab sampler as described above, with samples collected at the same five replicate stations in lower Minto Creek and lower Wolverine Creek (Figure 6-1, Appendix 5). At each station, the top 2 cm of sediment is collected from three ponar grabs and combined to provide sediment for both toxicity tests. Samples are kept cool until they can be sent to an experienced toxicity testing laboratory. Percent survival and dry weight (mg) of both organisms are measured in each test.

Sediment toxicity test results for lower Minto Creek are evaluated by statistical comparison to laboratory control results and reference sediment (lower Wolverine Creek) results, and by comparison to previous sediment toxicity test data to evaluate temporal change. Relationships between any observed sediment toxicity and sediment chemistry are also evaluated.

# 6.3 Periphyton and Benthic Invertebrate Tissue Monitoring

The Periphyton and Benthic Invertebrate Tissue Monitoring components of the AEMP are described in the following sections.

## 6.3.1 Periphyton Chlorophyll α

The objective of periphyton monitoring is to evaluate chlorophyll  $\alpha$  (productivity), community composition and tissue chemistry of periphyton in Minto Creek. Periphyton is made up of an assemblage of algae, bacteria, fungi and meiofauna attached to submerged substrates. The periphyton monitoring program is conducted on an annual basis (September).

Chlorophyll  $\alpha$ , a photosynthetic pigment, is used to characterize periphyton productivity in lower Minto Creek. Samples for chlorophyll  $\alpha$  are collected at five stations in each of lower Minto Creek and lower Wolverine Creek (reference; Figure 6-1, Appendix 5). At each station, samples are collected by first collecting five rocks from locations of similar depth and velocity. Periphyton is then scraped from the five rocks using a stainless steel razor blade and combined to form a composite sample. A sufficient volume of periphyton is scraped from the five rocks to be visible on the filter paper, and the associated surface area scraped is measured and recorded. Once all of the rocks are scraped, the filter paper is folded and placed in a black vial to avoid exposure to light (and potential photodegradation of chlorophyll  $\alpha$ ). The samples are frozen and later sent to a CALA accredited analytical laboratory for analysis of chlorophyll  $\alpha$ .

The volume of chlorophyll  $\alpha$  per unit area of stream (rock) surface is calculated as an index of periphyton productivity (mg/m<sup>2</sup>) and is evaluated in comparison to the British Columbia Water Quality Guideline for the protection of aquatic life (100 mg/m<sup>2</sup>; (BC MOE, 1985)), by statistical contrast of exposed (Minto Creek) and the reference area, and by comparison to previous chlorophyll  $\alpha$  data to evaluate temporal change.

## 6.3.2 Periphyton Community

The objective of the periphyton community monitoring is to determine if the Minto Mine has influenced the periphyton community of Minto Creek. Samples are collected from lower Minto Creek and lower Wolverine Creek (Figure 6-1, Appendix 5) at five replicate stations following the collection of representative rocks as described above. Periphyton community samples are collected by scraping a 4x4 cm<sup>2</sup> area on each of the five rocks collected at each station. Samples are placed in small plastic jars with water and preserved with Lugol's solution. Periphyton community samples are kept cool and sent to a taxonomist for identification. Samples from all five stations are analyzed separately.

The periphyton community of lower Minto Creek is evaluated on the basis of summary metrics of organisms per sample, number of taxa, Simpson's Diversity, Simpson's Evenness, Bray-Curtis Index (Environment Canada , 2012), density (cells/cm<sup>2</sup>), biomass (µg/cm<sup>2</sup>) and relative proportions of dominant taxon groups. Summary metrics are evaluated by statistical contrast of exposed (Minto Creek) and the reference area, and by comparison to previous periphyton community data to evaluate temporal change.

## 6.3.3 Periphyton Tissue

The objective of the periphyton tissue monitoring is to determine if the Minto Mine has influenced periphyton tissue quality of Minto Creek. Samples are collected from lower Minto Creek, lower Wolverine Creek (reference), and lower Big Creek (reference; Figure 6-1, Appendix 5) at five replicate stations following the collection of representative rocks as described above. Periphyton tissue samples are collected by scraping the five rocks per replicate station to form a composite sample. At least 0.2 g wet weight of periphyton is collected and placed in small plastic jars. Samples are kept cool and sent to a CALA accredited analytical laboratory for analysis of metals and metalloids (Table 6-4). Samples from all five stations are analyzed separately.

Periphyton tissue quality of Minto Creek is evaluated by statistical contrast of exposed (Minto Creek) and reference areas and by comparison to previous periphyton tissue quality data to evaluate temporal change. Relationships between periphyton tissue quality and water chemistry are also evaluated.

In 2016, weekly water quality sampling of lower Minto Creek and lower Big Creek will commence two months prior to periphyton tissue sample collection. This will aid in a comparison of Kd values that are averaged over the year versus those calculated in the two months prior.

#### 6.3.4 Benthic Invertebrate Community

The objective of benthic invertebrate community monitoring is to monitor benthic invertebrate community condition of lower and upper Minto Creek and compare them to respective reference areas. Benthic invertebrate community monitoring falls under two different regulatory requirements, the WUL and EEM. The WUL monitoring in undertaken annually (September) whereas the EEM is implemented every three years (also in September). The benthic invertebrate collection and assessment program is consistent with previously authorized versions.

Benthic invertebrate community monitoring under the WUL is completed at three areas, lower Minto Creek (exposed), lower Wolverine Creek (reference) and lower Big Creek (reference; Figure 6-1, Appendix 5), with five replicate stations per area. Benthic invertebrate community samples are collected using a Hess sampler (0.1 m2 sampling area; 500 µm mesh), with each replicate sample collected as a composite of three sub-samples. All sampling locations, both within and among areas, are selected based on similar substrate characteristics, water depths and water velocity. To collect the sample, all substrate within the Hess sampler is scrubbed until the area is cleaned of organisms, with organisms washed into the collection net by the current. The three sub-samples within a station are combined to form a composite. Composite samples are preserved with 10% buffered formalin and sent to a taxonomist for identification to the "lowest practical level".

Benthic invertebrate community monitoring under the EEM is currently undertaken using the Reference Condition Approach (RCA). Three stations in upper Minto Creek (the exposed area) are evaluated relative to the reference condition defined by ten RCA reference areas (chosen from reference sites evaluated in the previous EEM; Minnow 2015; Figure 2; Table 4) in accordance with the Canadian Aquatic Biomonitoring Network (CABIN) protocol for RCA studies (CABIN, 2012). Unlike the WUL benthic monitoring (a control-impact approach), only one sample is collected from each area (referred to as a site under CABIN). Samples are collected using a Hess sampler as described above.

Under both programs, benthic invertebrate community characteristics of Minto Creek are evaluated on the basis of summary metrics of invertebrate density (number of organisms per m2 calculated based on a sample area of 0.3 m2), number of taxa, Simpson's Diversity, Simpson's Evenness and Bray-Curtis Index (Environment Canada, 2012), and the relative proportions of dominant taxon groups. Summary metrics are evaluated by statistical contrast of exposed (Minto Creek) and the reference areas (using either a control-impact contrast or an RCA model) and by comparison to previous benthic invertebrate community data to evaluate temporal change. Relationships between benthic invertebrate community condition and water chemistry are also evaluated.

The RCA is a study design approach that can be applied to any sampling methodology (as long as the methodology is the same at every site). Benthic invertebrate community sampling under the EEM is completed by Hess sampling, targeting habitat of the same depth, water velocity and substrate composition, which likely provides a tighter comparison among areas than kick-and-sweep sampling. Deviations from the CABIN protocol are described in the EEM reports submitted to Environment Canada. At each site, Hess samples are collected as three-grab composites, with each grab collected by completely washing the substrate within the Hess sampler (allowing dislodged organisms to be swept into the collection net). In turn, each of the three grabs that make up the composite sample is collected over a period of five to ten minutes of continuous disturbance and washing of the substrate within the Hess sampler.

A SOP on Benthic Sampling procedures can be found in Appendix 6.

## 6.3.4.1 Benthic Invertebrate Tissue

The objective of the benthic invertebrate tissue monitoring is to determine if the Minto Mine has influenced benthic invertebrate tissue quality of Minto Creek. Samples are collected from lower Minto Creek, lower Wolverine Creek (reference), and lower Big Creek (reference; Figure 6-1, Appendix 5) at five replicate stations. Benthic invertebrate tissue samples are collected by using the kick-and-sweep method (CABIN, 2012) or by hand until approximately 2.0 g of benthic invertebrate tissue is collected. Samples are collected from all five stations in each area (Figure 6-1, Appendix 5). Collected benthic invertebrate samples are frozen and then sent to a CALA accredited analytical laboratory for analysis of metal and metalloid concentrations (Table 6-4).

Benthic invertebrate tissue quality of Minto Creek is evaluated by statistical contrast of exposed (Minto Creek) and reference areas and by comparison to previous benthic invertebrate tissue quality data to evaluate temporal change. Samples from all five stations are analyzed separately. Relationships between benthic invertebrate tissue quality and water chemistry are also evaluated.

In 2016, weekly water quality sampling of lower Minto Creek and lower Big Creek will commence two months prior to benthic invertebrate tissue sample collection. This will aid in a comparison of Kd values that are averaged over the year versus those calculated in the two months prior.

## 6.4 Fish Monitoring Program

The objective of the fish monitoring program is to monitor, assess and characterize fish usage of Minto Creek and to determine if the Minto Mine influences the health of a sentinel fish species of Minto Creek. Based on previous findings of fish use of Minto Creek, fish monitoring includes two elements: 1) ongoing characterization of fish use of lower Minto Creek; and 2) a mobile laboratory-based evaluation of the effects of exposure of juvenile Chinook salmon (*Oncorhynchus tshawytshca*) to Minto Mine effluent.

Ongoing characterization of the use of lower Minto Creek by fish is undertaken in lower Minto Creek, with lower Big Creek serving as a reference (Figure 6-1, Appendix 5). Although fish monitoring is only required under EEM, the *in-situ* fish monitoring is typically conducted annually to characterize fish usage of Minto Creek, with fishing conducted on several occasions during the open water season (typically conducted between June and October). In Minto Creek, fishing effort is restricted to the area downstream of a natural barrier located approximately 1.5 km upstream of the creek mouth. Fishing for the evaluation of fish usage is implemented using minnow traps baited with Yukon River origin Chinook salmon roe and set in areas of known juvenile Chinook salmon habitat. This typically includes eddies, pools and calm water with overhead cover and/or woody debris. The minnow traps are left for 24 hours and any fish caught are identified, enumerated, measured (fork or total length, mm) and any abnormalities are noted. Trap location information is recorded and catch per unit effort (CPUE) is calculated and used to quantify use of Minto Creek. CPUE, fish size data and fish condition are evaluated by statistical contrast of exposed (Minto Creek) and the reference area and by comparison to previous data to evaluate temporal differences.

Previous studies of the usage of Minto Creek by fish has documented that the most consistent use of lower Minto Creek is by juvenile Chinook salmon, which typically use lower Minto Creek between June and October. Individual fish spend only short periods of time in the creek (typically less than two weeks) during out-migration along the Yukon River from upstream spawning areas and Chinook salmon do not spawn in Minto Creek (Access and Minnow, 2014). Several other fish species have been observed to use lower Minto Creek less frequently and at much lower abundance than juvenile Chinook, including slimy sculpin (*Cottus cognatus*), arctic grayling (*Thymallus arcticus*) and round whitefish (*Prosopium cylindraceum*; Access and Minnow, 2014).

Based on the current understanding of fish use of Minto Creek, the potential effects of Minto Mine effluent on survival and growth of juvenile Chinook salmon are evaluated every three years under EEM. Due to often limited fish captures in situ, a mobile laboratory exposure is set up to evaluate fish survival and growth using hatchery-sourced juvenile Chinook salmon. If Chinook salmon are not available for the study a surrogate for Chinook salmon will be required. Kokanee salmon have been identified as an appropriate surrogate for Chinook salmon and have been approved for use by Environment Canada. The mobile laboratory exposure system set up consists of three large tanks (approximately 4,000 liters) with 150 juvenile Chinook salmon per tank. Two Minto Mine effluent concentrations (1:3 and 1:6) and a Minto Creek control are evaluated. Growth and condition are monitored prior to exposure and in all exposures at two-week intervals to six weeks of exposure. At each monitoring, all fish are measured for length, weight and abnormalities.

Effluent-exposed juvenile chinook salmon are evaluated on the basis of endpoints of growth (lengthfrequency distribution), energy use (length and weight) and energy storage or condition (weight-atlength) by statistical contrast of Minto Creek results against those of the control group in accordance with technical guidance for non-lethal EEM fish populations surveys (Environment Canada, 2012) and by comparison to previous results to evaluate temporal differences. Relationships between juvenile Chinook salmon health endpoints and water chemistry are also evaluated.

## 6.4.1 Supporting Measurements

To support the chemical and biological monitoring components outlined in previous sections, water chemistry and other supporting measures are collected (Figure 6-1 and Figure 6-2; Appendix 5). At each monitoring location, GPS coordinates and water quality meter measurements (dissolved oxygen, pH, temperature and conductivity) are recorded, and water quality samples are collected (Appendix 5). To support sediment quality monitoring in the lower reaches, depth at all stations and penetration depth of all hand corer samples are recorded (Appendix 5). Photographs are taken of all core and petite ponar samples, as well as substrate type (Appendix 5). To support periphyton monitoring, the area scraped for chlorophyll  $\alpha$  and community samples is recorded. Photographs of the rocks collected for periphyton samples are also taken (Appendix 5).

To support benthic invertebrate community monitoring during both the WUL (annual basis) and EEM (every three years), depth and velocity at every Hess sampler location is recorded (Appendix 5). Photographs and a 100 pebble count (CABIN, 2012) are conducted at every station. At one station per area (except for upper Minto Creek during EEM where all three stations are sampled) a habitat assessment is also conducted (Appendix 5). To support in situ fish monitoring, the following additional supporting measures are collected at every station: weather, photographs and trap location with a description of the station (Appendix 5).

Quantitative supporting measurement data (e.g., water quality meter measurements, water depth, water velocity and water chemistry) are evaluated by statistical contrast of exposed (Minto Creek) and reference areas. They are also used to investigate potential causes of any observed biological effects by correlation analysis.

# 7 Terrestrial Environment Monitoring Program

The Terrestrial Environment Monitoring Program is designed to monitor terrestrial features of the Minto Mine and surrounding environment. The objective of the program is to monitor invasive plant species, wildlife and erosion and sedimentation occurring in and around the mine site. These programs are detailed in sections 7.1 through 7.3.

## 7.1 Invasive Plant Species Monitoring Program

Invasive species largely refer to non-native, foreign, or exotic species, although a few native species, if introduced into new and suitable environments, can become problematic (e.g. Foxtail barley). It is important to note that the term invasive species includes plant, animal, fungus, and bacterium. The main pathways by which invasive species may be introduced to the Minto Mine site include distribution through reclamation efforts, and introduction though vehicle traffic to the mine site. The Invasive Plant Species Monitoring Program includes invasive plant mitigation, monitoring and reporting.

## 7.1.1 Invasive Plants Mitigation

Invasive plant mitigation techniques at Minto include site access measures, appropriate plant selection, erosion control and soil salvage techniques.

## 7.1.1.1 Site access

The following site access mitigation measures aid in reducing the possibility of propagules spreading across Minto by means of vehicles and equipment:

- Wherever possible, vehicle use (including ATVs) will be restricted to roads and existing pathways so as to limit additional disturbance to ecosystems and plants;
- Wherever possible, vehicles entering site will be clean (e.g., no large, obvious clods of mud), so as to limit the spread of invasive plant propagules. This will be monitored as part of the walk around inspection done prior to site access.

## 7.1.1.2 Plant Selection

The following plant selection measures will reduce the possibility invasive plants are utilized in reclamation at Minto:

- Ensure plants for reclamation are not included in the list of Yukon invasive species.
- Ensure any straw used for erosion control or other projects around site is certified to be weed free or at a minimum is locally sourced.
- Use locally gathered seed whenever possible.

- Establish woody species early in reclamation. This will give woody species time to establish and grow above the height where they will be affected invasive plants (grasses and non-woody plants).
- Whenever possible, ensure seedlings brought to site were grown in sterile potting mixes (ex. potting soil and perlite) and not from regional sources.

## 7.1.1.3 Erosion Control

Exposed soil will be managed in such a manner so as to discourage the production of fugitive dust and colonization by invasive plant species. Techniques may include covers, dust suppressants, and temporary or permanent planting. Listed below are several erosion control techniques to discourage invasive plant colonization at Minto:

- Reduce the amount of seed that is sown on site. If seed is necessary it will be limited to weed free certified seed mix.
- Reduce the amount of areas that require fast growing grasses for erosion control by planning lower angle slopes.
- Plant local colonizing species on exposed slopes.

## 7.1.1.4 Soil Salvage

Properly segregated topsoil and woody overburden collected during any stripping activities will allow for a natural seed bank and reduce the need for imported seed mixes and fertilizers when reclamation is required. The following techniques will aid with soil salvage at Minto:

- Stripping activities should be monitored by an environmental employee to ensure that quality material is being stored separately.
- Suitable soils should be placed directly on reclamation slopes whenever possible to reduce rehandling and increase viability of natural seed reserves within the soil matrix.
- Salvaged soils storage should be planned with the Mine Technical department to ensure it is stored in such a manner that do not require temporary seeding vegetated in order to prevent erosion.

## 7.1.2 Invasive Plants Monitoring

Invasive plant monitoring at Minto includes detailed vegetation surveys in areas of reclamation and coarse vegetation surveys in areas where there are invasive species pathways.

Detailed vegetation surveys were established in September 2012 on the Main Waste Dump (MWD). The detailed vegetation surveys identify vegetative cover and species types (within the dry land seed mix) and should invasive species be detected, the following information will be included in the survey:

- Location;
- Species Name;
- Health and size of the plant;
- Photos (for verification of plant and location); and
- Percent coverage in the area.

Coarse vegetation surveys typically take place in areas where there are invasive species pathways such as roads with high visitor traffic, recently exposed areas and areas that have been recently reclaimed. The meander or roadside method may be utilized to inventory invasive plants in pathways with high visitor traffic. High priority species as determined by the Yukon Invasive Species Council (YISC) will be identified, and the distribution and location of the plant will be recorded. Incidental surveys may also take place as field staff are routinely collecting data for various programs within the EMSRP; should an invasive plant be located the field staff will record its distribution and location. Data from the coarse vegetation surveys is entered into an invasive plant tracking record.

High priority plant species in the Yukon, as defined by YISC, are summarized in Table 7-1. A full list of invasive species found in the Yukon by taxonomy is provided in Appendix 7.

Common Name	Latin Name
Bird vetch	Vicia cracca
Common tansy	Tanacetum vulgare
Creeping thistle	Cirsium arvense
Hawkweeds	Crepis tectorum
Leafy spurge	Euphorbia esula
Oxeye daisy	Leucanthemum vulgare
Perennial sow-thistle	Sonchus arvensis
Scentless chamomile	Tripleurospermum perforata
Spotted knapweed	Centaurea stoebe

# Table 7-1: Common and Scientific Names of High Priority Yukon Invasive Plant Species, as defined by YISC

## 7.1.3 Invasive Plants Reporting

Should any high priority invasive plant species listed by the YISC be encountered, Minto will report the findings to YISC through the YISC Spotters Network Program.

## 7.2 Wildlife Monitoring Program

The *Minto Mine Wildlife Protection Plan* establishes guidelines for minimizing wildlife disturbance at the Minto Mine site and along the development corridor to the site. The *Wildlife Protection Plan* establishes the guidelines for the monitoring program in order to yield information about wildlife use in the area. Monitoring program results will be used in closure planning activities and will help refine closure objectives related to ensuring unobstructed passage through the area by wildlife.

The activities under the Wildlife Monitoring Program are summarized in

Table 7-2, including the area monitored and the frequency of monitoring. Wildlife sightings around site are entered into a *Wildlife and Hazing Tracking Form* which is in a spreadsheet format (Table 7-4). Wildlife sightings from site personnel are collected either via a *Wildlife Sighting Log* form or through communication with the Environmental and Safety Departments. Any direct sighting by the Environmental Department are additionally entered into the *Wildlife and Hazing Tracking Form*.

An example *Wildlife Sighting Log* form is provided in Table 7-3. Wildlife Sighting Logs are posted at all main offices and around camp, and all staff are encouraged to record all wildlife observations. The logs are collected regularly and data entered into the Wildlife and Hazing Tracking Form spreadsheet, displayed in

Site personnel are encourage to immediately report all interactions with dangerous wildlife to the Environmental or Safety Department. Information gathered on dangerous wildlife includes hazing techniques applied, the animal response and previous hazing attempts (if known).

A review of the data is conducted annually in order to build a picture of wildlife use in the area, to inform wildlife protection activities and to evaluate any effects that the mining operation may be having on wildlife values identified in baseline studies. Further details of the wildlife protection measures are found in the *Minto Mine Wildlife Protection Plan*.

Area Monitored	Monitoring Activities	Frequency
Wildlife Monitoring	<ul> <li>Wildlife monitoring consists of maintaining a wildlife observation log onsite and reporting wildlife encounters as per the Wildlife Act.</li> <li>Environmental personnel on site will monitor project activities and modify operations to address wildlife concerns.</li> </ul>	Ongoing
Migratory Birds	<ul> <li>Monitoring to determine if waterfowl and shorebirds settle on impacted water bodies, such as the Main or Area 2 Pits.</li> <li>Environmental personnel on site will monitor project activities and modify operations to address wildlife concerns.</li> </ul>	Seasonal during migratory periods
Species at Risk/of Concern	<ul> <li>Any caribou observations will be reported to the Conservation Officer in Carmacks.</li> <li>Bank swallows have been observed to nest in residuum piles in the summer months, in which case these piles are cordoned off and left undisturbed until after the late summer migration, or resloped prior to nesting season to deter nesting.</li> </ul>	As necessary

Table 7-2: Wildlife Monitoring Activities

#### Table 7-3: Wildlife Sighting Log

# Wildlife Sighting Log

We are obliged to monitor wildlife in the mine area under the conditions of our Quartz Mining Licence. Please help the Environment Department do this by recording any wildlife you see on this form.

Date	Time	Species	Number	Location	Notes: (e.g. condition, behaviour, adult/young, weather conditions)	Name
	1					

## Table 7-4: Example Wildlife and Hazing Tracking Form

Date	Time	Type of Animal	Number of Animals	Location	Description: Size/Color/Markings and Additional Notes	Reported By (Name)	Was the animal hazed?	What hazing technique was used?	What was the animal's response?	Who performed the hazing?	Has this animal been hazed in 2015?	Reportable Incident (Yes/No)	Notes
6-Jan-15	14:30	Fox	1	Dyno Rd	Orange/ black	Helaina	no	N/a	N/a	N/a	n/a	No	Running away with rabbits foot in mouth
18-Jan-15	14:00	Fox	1	KM 1.5	Not too scared hazed down road	Ron	no	N/a	N/a	N/a	n/a	No	Not too scared hazed down road
23-Jan-15	16:00	Moose	2	Vent raise road	One cow and one calf	Dave	No	N/a	N/a	N/a	N/a	No	
9-Mar-15	5:00	Moose	1	In camp	Looking at me	Don	No	N/a	N/a	N/a	n/a	No	Looking at me
28-Mar- 15	19:30	Hare	1	Km 3.5 Access Road	Dead hare on Access Road. Observed by a runner on road. Reported to Conservation Officer.	Rob	No	N/a	N/a	N/a	N/a	Yes	
28-Mar- 15	19:00	Rabbit/Hare	1	3.5 Km	Dead hare on Access Road. Observed by a runner on road. Reported to Conservation Officer.	Rob	No	N/a	N/a	N/a	n/a	No	

# 7.3 Erosion and Sedimentation Monitoring Program

The *Minto Mine Sediment and Erosion Control Plan* (SECP), a requirement of the QML, details erosion and sediment monitoring strategies, sources and best management practices for control. The Erosion and Sedimentation Monitoring Program is derived from the SECP and monitoring activities are summarized in Table 7-5.

Initial erosion can be visually inspected by searching for light surface material (litter or soil) movement, while sedimentation resulting from erosion can be found by searching for deposition of soil particles at the bottom of slopes and depressions. Riling, gullying, pedestalling, unusual compaction, hoof shearing and trailing are also indicators of erosion problems.

Ditches will be examined during heavy runoff events and the outlets of culverts and pipes visually inspected regularly to ensure that roads and other permanent structures are not being compromised and sediment loads are not becoming excessive. Movement of the lighter and finer top soils before vegetation has taken root on reclamation plots will be monitored closely and mitigation efforts employed to prevent compromising the seed and soil. Further details of the erosion and sedimentation control methods and areas of concern at the Minto Mine are provided in the SECP.

Activity	Location	Frequency
Visual inspections	Bottoms of slopes and depressions of large structures.	As needed following heavy rain events, and during freshet.
	Road routes: ditches and outlets of culverts and pipes.	As needed following heavy rain events, and during freshet.
Water quality monitoring for total suspended solids (TSS) <sup>1.</sup>	Water quality monitoring stations W2, W50 and W17	Weekly and during heavy runoff periods.
Physical inspection of surface facilities by a Yukon registered Engineer <sup>2</sup>	Water Storage Pond Dam, Mill Water Pond, all waste rock and overburden dumps, all water diversion and conveyance structures and the dry stack tailings storage facility.	After the spring thaw period in May/June of each year.

Table 7-5: Erosion and Sediment N	Monitoring Schedule
-----------------------------------	---------------------

1. Water quality monitoring locations and frequency described in detail in section 2.1. 2. Physical Monitoring Program details are described in section 5. 2

# 7.4 Vegetation Metal Uptake Program

The main objective of the Vegetation Metal Uptake Program is to monitor and measure metal uptake in vegetation on the mine site and surrounding areas. The *Vegetation Metal Uptake Monitoring Plan* (Appendix 8, (Minto, 2015)) describes the program in detail and employs the following components for program implementation:

- Utilizes previously established or documented conditions, monitoring results or predictive efforts, where appropriate and possible;
- Establishes a network of plots for monitoring both soil and vegetation metal concentrations; and
- Allows for an ongoing evaluation of the extent and degree that metals from mining activity is affecting vegetation in the proximity of the project site.

The Vegetation Monitoring Uptake program consists of a monitoring network of site (exposure) or control stations (Figure 7-1). Progression of the mine plan and analysis of the monitoring results may result in the creation of additional monitoring locations. For example, progressive reclamation of waste dumps may allow for areas that have been revegetated to be included into the monitoring network. Site sampling stations are located in areas anticipated to accumulate the most dust based on meteorological data collected at site. Plant species selection is subject to change based on discussions with SFN which also drive the sample stations.

The selection of vegetation control plots also took in consideration the proximity of all active mine areas as well as the prevailing wind direction. The selection of vegetation species considered species that represent good indicators for evaluating airborne transport and metal uptake. Opportunities were made for SFN to provide input on vegetation species selection prior to initiating the first program.

The following procedures are performed at each monitoring network site:

- Selection of an appropriate microsite in the vicinity of the station identified on the map;
- Generation of a station ID and documentation of relevant ecological attributes of the station area;
- Soil sampling (sampling various soil horizons); and
- Vegetation sampling.

Soil and vegetation samples will be sent to an accredited laboratory for the following analysis: metals, pH, texture and cation exchange capacity. The initial study will take place in July or August any given year before seasonal desiccation of vegetative material occurs. Continued monitoring should occur every three years after initial study, to determine any changes in dust dispersal and vegetation metal uptake.



Figure 7-1: Vegetation Metal Uptake Program Monitoring Stations

# 8 Progressive Reclamation Effectiveness Monitoring Program

The Progressive Reclamation Effectiveness Monitoring Program is a requirement of the EMSRP, and is required to monitor the effectiveness of progressive reclamation and post closure reclamation at the Minto Mine. Progressive reclamation activities at Minto are detailed in the *Minto Mine Reclamation and Closure Plan* (RCP). The Progressive Reclamation Effectiveness Monitoring Program is used to support the progressive reclamation activities that occur during mine operation; while post-closure monitoring is described in the RCP. The objective of the Progressive Reclamation Effectiveness Monitoring Program is to identify and evaluate reclamation and remediation technologies that are considered both promising and feasible for incorporation into the evolving mine RCP.

Reclamation research at the Minto Mine has focused primarily on key closure methods proposed for the site including soil covers, vegetation, and semi-passive treatment. Monitoring areas included the Main Waste Dump (MWD) vegetation study plots in 2013-2014. Test pitting and soil modeling for cover material characterization was also completed in 2013-2014. The first four phases (i.e. information gathering, conceptual design, pilot scale, and demonstration scale) of developing a constructed wetland treatment system have also been implemented with the first three phases being completed in 2013-2014.

The processes for identifying optimal reclamation design is based on the BMPs discussed in guidance documents such as the *Mining Waste Treatment Technology Selection Website* (Interstate Technology Regulatory Council, 2010) and the *Yukon Revegetation Manual: Practical Approaches and Methods* (Mathues & Omtzigt, 2013). Further information on reclamation research can be found in the *Minto Mine Reclamation and Closure Plan.* 

# 9 Quality Assurance and Quality Control Programs

A primary objective of quality assurance and quality control (QA/QC) programs is to ensure that data collected, analyzed and evaluated through environmental monitoring programs at Minto is representative and of high quality and to provide confidence in the data collected for all environmental monitoring and sampling programs. QA/QC procedures at Minto have been designed after generally recognized QA/QC protocols. This section summarizes the use of duplicate, field and trip blanks, on-site laboratory and field equipment calibration, external and on-site laboratory QA/QC, on-site laboratory verification, and a description of QA/QC protocols for other site monitoring activities including meteorology, hydrology, and hydrogeology with respect to the Minto Mine. Results and interpretations of the QA/QC programs are detailed in the WUL Annual Report.

## 9.1 Quality Assurance

Quality assurance protocols help ensure that the programs as described in the EMSRP are quantifiable and able to produce quality data. Minto is continuously involved in consultation with professionals and technical experts regarding program design, standard operating procedures, and data review. Ongoing staff training and job observations of staff (new hires and experienced employees) performing monitoring activities ensure that data collection and results are consistent, representative and of high quality.

The steady improvement of quality assurance protocols involves developing more detailed and program specific verification processes and automated checks, as well as peer reviews and audits by external professionals on a regular basis. Effective quality assurance will identify potential problem areas and necessary corrections to procedures and data management, and facilitates evaluation and improvement of the monitoring program.

Examination and evaluation of field data and data entry is an integral part of quality assurance. While it is not possible to check all aspects of input data, calculations, and interpretations, checks can be performed on selected sets of data at appropriate intervals. A review of work procedures and data collection methods will identify potential sources of error.

Reported data is reviewed and evaluated by Minto staff on a monthly and annual basis. For example, the data associated with the Water Monitoring Program (Section 2) is reviewed by cross checking the Minto Water Quality Database with the sample tracking and log spreadsheet. The database is frequently audited by Minto personnel and a professional consultant on an annual basis. If inconsistences are found, further investigation is performed using field notes, Chain of Custody, and lab result files depending on the nature of the error.

# 9.2 Quality Control

Quality control protocols are the set of routine procedures and methods designed to achieve and maintain a recognized level of quality. Some of the most common quality-related problems introduced in surface water quality sampling include the mislabeling or switching of bottles, failure to add proper preservatives, improper storage conditions, and sample contamination from sampling equipment or other sources. Quality control samples are collected and analyzed to verify the integrity of water samples and detect errors introduced during sampling. Quality control samples represent 10% of the total number of samples collected and consist of a random combination of the types provided in Table 9-1. Field staff are responsible for documenting when and where quality control samples are prepared on the field forms and in the Minto Water Quality Database.

#### Table 9-1: Quality Control Sample Descriptions

Туре	Description and Sample Purpose
Trip Blank	A sealed container of deionized water sent from the laboratory used to detect any
(ТВ)	widespread contamination during transport and storage. The trip blank is transported with the sample bottles for the entire duration of the sampling event. Trip blanks indicate contamination within the bottle or from volatile compounds.
Field	A sample of deionized water that is prepared in the field using the same procedures as for
Blank (FB)	collecting the field sample. Preservative, if required, is added after the sample is collected. Field blanks measure contamination from bottles, collection methods, the sampling environment, and preservatives.
Duplicate (DUP)	Duplicate samples are independent samples collected from the same place and time to determine the precision of environment and laboratory heterogeneity. Duplicate samples measure the reproducibility of the sampling and analysis.
Field Spilt	Aliquots taken from the same sample container and assumed to be identical. Split samples
(FS)	can be sent to separate laboratories for analysis and the results can be used to determine inter-lab variability. Care must be taken to ensure that the samples are split
	homogeneously.

# 9.3 Environmental Monitoring Programs QA/QC

Hydrology, meteorology and hydrogeology program QA/QC is discussed in Sections 9.3.1 to 9.3.3.

## 9.3.1 Hydrology QA/QC

The primary objective of hydrology data collection under the WUL is to monitor the quantity of water moving around Minto Mine as well as the quantity moving down the Minto Creek watershed. Minto Mine currently uses a variety of techniques and instrumentation for the collection of hydrology data, including; continuous measurements using Solinst level loggers, continuous measurements using inline flow meters, measurements using a calibrated flume as well as volumetric measurements and manual measurements using a Hach FH950 Electromagnetic Velocity Meter.

For current meter measurements, errors in the measurement of width, depth, and velocity as well as the lack of care in choosing the number of vertical measurements and observations in a vertical measurement, all combine to reduce the overall accuracy of water quantity data. To a large extent, human errors can be avoided by careful attention to detail and by adhering to established and proven techniques and routines. Systematic errors can be reduced significantly by proper maintenance and calibration of instruments and equipment, and by adequate training. However, random errors will always occur. A significant reduction in these errors can be achieved if field staff performing the measurement can recognize the potential problem areas and can take the appropriate precautionary measures to avoid or minimize them. SOPs used as field guides have been prepared to minimize human error, and manual measurements are generally conducted at the same location to minimize variability. Typically, field staff perform quality control on 10% of the manual measurements by performing duplicate flow measurements during the same monitoring event.

Standardized management of data collected in the field is important in hydrological monitoring programs. Standard protocols and systems are in place to ensure ease of data processing and less likely prone to error. Processing of data can involve returning to the original field notes to cross check suspicious values or to analyze site conditions that might have been responsible for anomalies in the logger records. Therefore, supportive values and observations are well documented by field staff.

All water quantity data including field notes, photographs and datalogger download files are carefully handled, organized and stored to ensure the information can be located for future use.

## 9.3.2 Meteorology Monitoring Program QA/QC

Monitoring of meteorological parameters is done with a research-grade weather station, containing Campbell Scientific meteorology instrumentation, a data logger and a 10-m tower. The Campbell Scientific station is located approximately 100m northeast of the airstrip and has been operating since 2010. Data from the station has been collected regularly and is used for prediction and operational planning purposes.

QA/QC of data by Minto staff includes validation of equipment by comparing trends in the data sets for the meteorological station. Furthermore, a monthly review of the data takes place as a result of monthly

reporting activities. Along with the QA/QC performed by Minto staff, the compiled data is frequently sent to external consultants for further QA/QC to ensure the data is representative of the meteorological condition that occur at Minto Mine.

#### 9.3.3 Hydrogeology Monitoring Program QA/QC

QA/QC for groundwater well monitoring includes either field duplicate, trip blank or field blank samples that are collected at a frequency of one QA/QC sample per ten groundwater monitoring samples (10%).

#### 9.4 External Laboratory QA/QC

Every sample report received from an external lab is accompanied by a Quality Assurance Report, which includes a calculated percent recovery for all applicable parameters, as well as QC limits. The QC tests include: matrix spike (within 80-120% recovery), spiked blank (80-120% recovery), method blank value, and Relative Percent Difference for duplicates (less than 20%). Each report also details any deviations from procedure, including exceeding standard holding time. A QC batch number is assigned to each sample for traceability.

The external laboratory utilized for water monitoring programs such as the Surface Water Surveillance Program is accredited under the International Organization for Standardization ISO/IC 17025:2005 standard. This accreditation includes both the laboratory and the tests that are performed at the laboratory.

#### 9.5 On-site Laboratory QA/QC

In the on-site laboratory, metals are analyzed using an atomic absorption spectrometer; specifically a Varian 240 G is used. Copper, aluminum and cadmium are analyzed using a graphite tube atomizer. Selenium is analyzed using a Hydride vapour gas accessory.

Ammonia, nitrite and nitrates are analyzed using a Hach DR2800 spectrophotometer. Total solids are determined gravimetrically.

The parameter specific methods used to establish the above criteria are as follows:

- Ammonia Hach Method 8155 Nitrogen Ammonia Salicylate Method
- Nitrites Hach Method 8507 USEPA Diazotization Method.
- Nitrates Hach Method 8039 Nitrogen Nitrates, Cadmium Reduction Method
- TSS Method Derived from Standard Methods for Water and Wastewater Treatment
- Copper Graphite Furnace Atomic Absorption Spectrometer: Operation and Maintenance
- Aluminum Graphite Furnace Atomic Absorption Spectrometer: Operation and Maintenance
- Cadmium Graphite Furnace Atomic Absorption Spectrometer: Operation and Maintenance
- Selenium VGA-77 gas generator for Hydride Generation using Varian Atomic Absorption Spectrophotometers

The on-site lab calibrations are performed using the manufacturers' specifications. Laboratory atomic absorption spectrometry and spectrophotometer equipment require calibration, which is conducted by on-site lab personnel that are trained in the use of the equipment.

The on-site lab commenced testing samples in March 2012, and began establishing Standard Operating Procedures (SOPs) and a QA/QC program. The SOPs that form the basis of the on-site lab QA/QC program are:

- Lab QA/QC Guidelines SOP;
- AAS-GF Set-up and Operation SOP;
- Replacing and/or Aligning a Hallow Cathode or D2 Lamp SOP;
- Replacing a Graphite Tube and Aligning the graphite furnace SOP;
- Alignment of the PSD -120 SOP, Dilutions and Standards SOP;
- Preparation of Dissolved and Total Metals (Cu, Al, Cd) SOP; and
- Preparation of Dissolved and Total Selenium SOP, and Total Suspended Solids SOP.

All of the aforementioned SOPs are stored in the on-site lab for immediate reference. The SOPs are updated as required to maintain consistency with manufacturers' specifications.

#### 9.5.1 On-site Lab Verification

The intent of on-site lab verification is to demonstrate the ability of the Minto Mine on-site water quality laboratory to produce results from water analysis that are reasonably comparable to those results obtained at an accredited external lab, and verify that on-site results are reliably reported at or below WUL effluent quality standards for most metals. The verification of the on-site laboratory was initiated in March 2012 to demonstrate compatibility between the results obtained at the Minto on-site laboratory and accredited external labs. Two external, CALA or ISO/IEC 17025 certified laboratories were used: Maxxam Analytics and ALS Environmental. It is to be noted there is, as expected, variation in the results due to method and instrumentation differences. The detection limits reported by the external labs using Inductively Coupled Plasma-Mass Spectroscopy (ICP-MS) can be as much as an order of magnitude lower than an Atomic Absorption Spectroscopy-Graphite Furnace (AAS-GF).

Table 9-2 demonstrates the ability of Minto on-site laboratory to reasonably correlate with an external accredited lab (Maxxam Analytics) for metal analysis with the exception of cadmium. It is important to note that the poor correlation with cadmium is due to the difference in instrumentation (AAS-GF and ICP-MS). Unfortunately this correlation cannot be resolved to a greater degree, as the majority of the variance comes from the superior capability of an ICP-MS to discern trace amounts of cadmium.

# Table 9-2: Coefficient of Correlation between Minto Mine On-site Laboratory and Maxxam for Total andDissolved Metals

Metal	Coefficient of Correlation
Cu Dissolved	0.8
Cu Total	0.9
Al Dissolved	0.8
Al Total	0.6
Cd Dissolved	0.04
Cd total	0.2
Se dissolved	0.9
Se total	0.9

Nutrient and Total Suspended Solids (TSS) coefficients of correlation between on-site and external laboratories are provided in Table 9-3. Nitrate and TSS correlations are reasonable, indicating that the labs resolve these in a similar fashion. For Nitrite, the on-site laboratory and ALS have good correlation, while the correlation with Maxxam is poor, most likely because of a difference in the detection limits between the labs. Ammonia has poor correlation across all labs, this correlation may be due to differences in testing time and detection limits.

Lab Comparisons	Ammonia	Nitrate	Nitrite	TSS
Maxxam vs. On-site	0.32	0.81	0.37	0.92
Maxxam vs. ALS	0.22	1.00	0.89	0.99
On-site vs. ALS	0.15	0.75	0.99	0.98

Ongoing verification of the external and on-site laboratory results occurs on a monthly basis with monthly comparison of results detailed in the monthly WUL reports.

### 9.6 Field Instrumentation QA/QC

Field instrumentation are maintained according to manufacturers' specifications. Equipment that exhibits performance problems are not utilized to collect data; rather, the equipment is repaired according to the manufacturer's specifications. Certain field equipment, such as the YSI in-situ multi parameter meter and a Eutech (Oakton) PCTestr 35 handheld meter require calibration; calibration is conducted by field staff according to manufacturers' specifications and Minto SOPs. An example calibration log is presented in Figure 9-1.

 Date of Calibration:
 Technician:
 Unit:
 Cable:
 Battery Power:

Record the following calibration values (for full calibration of YSI please follow the order on the sheet below):

	Unit Temp	Thermometer Temp	Unit Temp Result +/- from Thermometer Temp	Unit Temp Result should not be more than +/- 0.5c from Thermometer Temp.
Thermometer				

	Pre-Cal	[Calibration Value]	After Calibration	Acceptable "after calibration" Ranges
Barometer kPA				Range of 2013 True BP values at Minto: 87.3 – 93.6 kPA. Average: 90.8.
Specific Conductivity us/cm		[1413]		Calibration value is always 1413 us/cm. Do NOT use Temp chart with standard
DO%				~ 89-93 DO%. ** To verify the after calibration value see DO% -Barometric pressure verification chart for DO% to confirm the value
Salinity (value only; found under DO%)				Salinity range should be 0-0.5 ppt. Do not proceed with DO calibration if salinity is out of this range.

	Pre-Cal	Calibrant.	[Calibration Value] **	After	pH mV value	mV Range	Acceptable mV
		Temperature	To enter a value see	Calibration			Value or Range
			pH -temperature				
			compensation chart				
pH 7							Value +/- 50 mv.
pH 10							Range -165 to -180
							mV from Buffer 7
							value177 ideal.
pH 4 (for 3 pt,							Range +165 to +180
calibration)							mV from Buffer 7
							Value. 177 ideal.

	Pre-Cal	Calibrant, Temperature	[Calibration Value] ** To enter a value see ORP-temperature compensation chart	After Calibration
ORP mV				

Record the following diagnostic numbers after calibration by viewing the GLP file: (UNDER THE FILE BUTTON)			
(~ 55 to 60 mV/pH; 59 is ideal)			
Range: 5.0 +/- 1.0 acceptable			
	(~ 55 to 60 mV/pH; 59 is ideal)		

Figure 9-1: In-situ Field Parameters Calibration Log

## **10 Data Evaluation and Reporting**

EMSRP data evaluation and reporting will be conducted in accordance with the WUL and QML.

The QML requires that the Licensee provide, as part of the annual report, "a summary of the programs undertaken for environmental monitoring and surveillance as outlined in the Environmental Monitoring, Surveillance and Reporting Plan and the Wildlife Protection Plan, including an analysis of these data and any action taken or adaptive management strategies implemented to monitor or address any changes in environmental performance".

Additionally, the WUL requires that the Licensee "shall collect and submit each month's required EMSRP data...to the board as part of the Monthly Report" and "as part of the Annual Report".

All data collected in the previous year is submitted to the Yukon Government, Energy, Mines and Resources Branch and to the Yukon Water Board as a single report by March 31<sup>st</sup> of the following year.

EMSRP reporting requirements are summarized in Table 10-1.

		Reporting Requirements		
Monitoring Program	External Reporting Requirements			
	Monthly Report	Annual Report	Other	
Water Monitoring Progra	m			
Surface Water Surveillance Program	Monthly Report	Annual Report		
Groundwater Monitoring Program		Annual Report		
Seepage Monitoring Program		Annual Report		
Geochemical Monitoring	Program			
Acid Base Accounting (ABA) Monitoring Program	Monthly Report	Annual Report		
Waste Rock Management Verification Program		Annual Report		
Meteorological Monitorin	ng Program			
Climate Monitoring Program	Monthly Report	Annual Report		
Snow Survey Program		Annual Report		

		Reporting Requirements		
Monitoring Program	External Reporting Requirements			
	Monthly Report	Annual Report	Other	
Physical Monitoring Program	Monthly Report	Annual Report	Semi-Annual Site-wide Geotechnical Inspection Report (Spring and Fall)	
Aquatic Environmental M	onitoring Program			
Metal Mine Effluent Regulations Monitoring Programs		Annual Report	MMER	
Sediment Quality and Toxicity Monitoring		Annual Report		
Periphyton and Benthic Invertebrate Tissue Monitoring		Annual Report	MMER	
Fish Monitoring Program		Annual Report	MMER	
Terrestrial Environment N	Aonitoring Program			
Invasive Plant Species Monitoring Program		Annual Report	YISC	
Wildlife Monitoring Program		Annual Report	Environment Yukon	
Erosion and Sedimentation Monitoring Program		Annual Report		
Vegetation Metal Uptake Program		Annual Report		
Progressive Reclamation Program	Effectiveness Monitoring	Annual Report		
Quality Assurance and Qu	ality Control Programs	Annual Report		

## **11 References**

- Access and Minnow. (2014). Aquatic Resources Baseline Report YESAB Project Proposal Phase V/VI. . Prepared for Minto Explorations Ltd. July 2014.
- ASTM. (2013). Standard Guide for Sampling Ground-Water Monitoring Wells. ASTM International.
- BC MOE. (1985). *Water Quality Criteria for Nutrients and Algae: Technical Appendix.* . Prepared by Richard Nordin, Water Quality Unit, Resource Quality Section, Water Management Branch. October 1985.
- CCME. (2011). *Protocols Manual for Water Quality Sampling in Canada*. Canadian Council of Ministers of the Environment. Ottawa: Canadian Council of Ministers of the Environment.
- CCME. (2014, January 15). Sediment Quality Guidelines for the Protection of Aquatic Life. Retrieved February 12, 2014, from Canadian Environmental Quality Guidelines Summary Table: http://stts.ccme.ca
- Clark, M. (2003). *British Columbia Field Sampling Manual.* Water, Air and Climate Change Branch Ministry of Water, Land and Air Protection. Victoria: Province of British Columbia.
- Duncan, D., & Bruynesteyn, A. (1979). Determination of acid production potential of waste materials. (p. 10). Metallurgical Society of AIME paper A-79-29.
- Environment Canada . (2011). *Metal Mining EEM Guidance Document. Chapter 4 Effects on Fish Habitat: Benthic Invertebrate Community Structure Survey.* Ottawa.
- Environment Canada. (1997). Biological Test Method: Test for Survival and Growth in Sediment Using the Larvae of Freshwater Midges (Chironomus tentans or Chironomus riparius). Environment Canada Environmental Technology Centre, Ottawa, Ontario. Environmental Protection Series. : Report EPS 1/RM/28. July 1998.
- Environment Canada. (2001). *Guidance Document for Flow Measurement of Metal Mining Effluent.* Ottawa: Minister of Public Works and Government Services Canada.
- Environment Canada. (2001). *Guidance Document for the Sampling and Analysis of Metal Mining Effluents.* Ottawa: Minister of Public Works and Government Services Canada.
- Environment Canada. (2007). Biological Test Method: Growth Inhibition Test Using a Freshwater Alga. Environment Canada Environmental Technology Centre, Ottawa, Ontario. . Environmental Protection Series. Report EPS 1/RM/25. Second Edition. March 2007.
- Environment Canada. (2007). Biological Test Method: Test for Measuring the Inhibition of Growth Using the Freshwater Macrophyte Lemna minor. Environment Canada Environmental Technology Centre, Ottawa, Ontario. . Environmental Protection Series. Report 1/RM/37. Second Edition. January.

- Environment Canada. (2007). *Biological Test Method: Test of Reproduction and Survival Using the Cladoceran Ceriodaphnia dubia.* . Environment Canada Environmental Technology Centre, Ottawa, Ontario. Environmental Protection Series. Report EPS 1/RM/21. Second Edition. February 2007.
- Environment Canada. (2011). Biological Test Method: Test of Larval Growth and Survival using Fathead Minnows. Environment Canada Science and Technology Branch, Ottawa, Ontario. . Environmental Protection Series. Report EPS 1/RM/22. February 2011.
- Environment Canada. (2011). *Field Manual: Wadeable Streams.* Canadian Aquatic Biomonitoring Network, Science and Technology Branch. Dartmouth: Environment Canada.
- Environment Canada. (2012). *Metal Mining Effects Monitoring (EEM) Technical Guidance Document*. Government of Canada.
- Environment Canada. (n.d.). *Biological Test Method: Test for Survival and Growth in Sediment and Water Using the Freshwater Amphipod Hyalella azteca.* . Environment Canada Science and Technology Branch, Ottawa, Ontario. Environmental Protection Series. Report EPS 1/RM/33. .
- Environment Canada. (n.d.). *Toxicity Tests Using Early Life Stages of Salmonid Fish (Rainbow Trout). Environment Canada Environmental Technology Centre, Ottawa, Ontario.* . Report EPS 1/RM/28. July 1998.: Environmental Protection Series.
- Government of Canada. (2015). *Metal Mining Effluent Regulations, Consolidation. SOR/2002-222.* Current to November 16th, 2015.
- Interstate Technology Regulatory Council. (2010, August). *Mining Waste Treatment Technology Selection*. Retrieved February 11, 2014, from http://www.itrcweb.org/miningwaste-guidance/
- Mathues, P., & Omtzigt, T. (2013). Yukon Revegetation Manual: Practical Approaches and Methods.RetrievedJanuary22,2014,fromhttp://www.yukoncollege.yk.ca/downloads/YEPbk\_reveg\_CH1.pdf
- MEND. (1991). Mine Environment Neutral Drainage Program: Acid Rock Drainage Prediction Manual, MEND Project 1.16.1 (b). Prepared by Coastech Research Inc., North Vancouver, B.C. March 1991.
- Metal Mine Effluent Regulations, SOR/2002-222 (06 06, 2002).
- Mills, C. (1997). An Assessment of the Results of Acid Base Accounting (ABA) and Mineralogical Test Work on Eight Samples from the Proposed Minto Project, Yukon Territory. Consulting Environmental & Mineral Process Engineer for the Selkirk First Nation, Pelly Crossing, Yukon Territory, Vancouver.
- Ministry of Environment. (1981). *Snow Survey Sampling Guide*. Province of British Columbia, Water Management Branch Surface Water Section, Victoria.

- Ministry of Environment. (2009). *Manual of British Columbia Hydrometric Standards.* Science and Information Branch. Victoria: Resources Information Standards Committee.
- Minto. (2014). Minto Mine Phase V/VI Expansion, Waste Rock and Overburden Management Plan.
- Minto. (2015). *Vegetation Metal Uptake Monitoring Plan.* Prepared by Access Consulting for Minto Explorations Ltd.

Yukon Government. (2002). Contaminated Sites Regulations O.I.C. 2002/171.

Yukon Government. (2013, August). *Plan Requirement Guidance for Quartz Mining Projects*. Retrieved from

http://www.yukonwaterboard.ca/forms/quartz/Plan%20Requirement%20Guideline%20for%20 Quartz%20Mining%20Projects%20-%20August%202013-kh.pdf

## Appendix 1: Minto Mine Surface Water Quality Monitoring Standard Operating Procedures



# MINTO MINE SURFACE WATER QUALITY MONITORING STANDARD OPERATING PROCEDURES

Prepared by: Minto Explorations Ltd October 2012

Last Revised, May 23, 2017

## TABLE OF CONTENTS

1.	Purpose	4
2.	Responsibilities	4
	Field Staff	4
	Supervisors	5
3.	Safety	5
4.	General Guidelines for Surface Water Quality Monitoring	5
5.	Surface Water Sampling Procedures	7
	Preparation	7
	Maintenance of Field Instruments	8
	Field Measurement of Water Quality Parameters	8
	Sample Collection	9
	Field Notes and Photographic Record	12
	Sample Custody and Shipment	12
	Data Management	13
6.	Quality Assurance and Quality Control	14
	Quality Control	14
	Quality Assurance	15
7.	Closure	16
8.	References	16

#### TABLE OF APPENDICES

Appendix 1: Current ALS Contact and Shipping Label

Appendix 2: Minto Environment Water Quality Field Form

Appendix 3: Sample Chain of Custody Form

### 1. Purpose

The standard operating procedures (SOP) in this document serve as a guideline for the collection of surface water quality samples from water bodies at Minto Mine (Minto) specified by Water Use Licence QZ96-006. The Minto Mine Water Quality Monitoring SOP follows methods and procedures described in *Protocols Manual for Water Quality Sampling in Canada* (CCME, 2011), *Guidance Document for the Sampling and Analysis of Metal Mining Effluents* (Environment Canada, 2001) and *Ambient Freshwater and Effluent Sampling Manual* (RISC, 2003). This document is intended for Minto Mine employees familiar with the location of water quality sites at Minto, and who are knowledgeable in surface water sampling methods. Along with on the job training, the purpose of this document is to ensure the Minto Mine Water Quality Monitoring Program is carried out consistently and that all surface water samples are representative of the environmental conditions at the time of sampling.

## 2. Responsibilities

The reliability and quality of data generated by the Water Quality Monitoring Program is dependent on the staff involved and attention given to the sampling procedures, quality control protocols, and field equipment. It is crucial that water quality samples be collected in a consistent manner with the appropriate equipment to generate the most accurate field measurements and analytical results. Erroneous results which do not represent the water body being sampled can lead to inaccurate conclusions about water quality and have the potential to influence management actions.

The following sections outline the typical allocation of responsibilities associated with the Water Quality Monitoring Program at Minto.

#### **Field Staff**

Field staff must have the appropriate knowledge to collect representative samples and protect samples from contamination and deterioration. A sampler is responsible for minimizing field error and collecting the best sample possible. This includes consistency in sampling procedure, correct use of sampling equipment, accurate labelling, and completion of detailed field notes.

Field staff are responsible for coordinating all sampling events in accordance with the requirements of the current WUL, including sampling locations, sampling frequency, and parameter requirements. Staff performing sampling and monitoring duties shall ensure that all site and sample specific details are clearly documented, and that all quality assurance and quality control (QA/QC) protocols are being followed.

Field staff must be experienced in the operation and safety requirements for all field instruments, sampling gear, equipment and reagents used for sampling. They are responsible for maintaining equipment and maintaining

stock and inventory of sampling supplies.

Field staff are also responsible for submitting all samples to the appropriate laboratory for analysis in a timely manner, and performing data entry related to the Water Quality Monitoring Program.

#### **Supervisors**

Supervisors are responsible for ensuring field staff understand the requirements of the WUL and that all WUL requirements and internal QA/QC protocols are being met and documented. Supervisors are responsible for ensuring sample and data collection and management procedures are being carried out consistently and identifying variance from standard procedures. This includes ensuring digital copies of all field data and laboratory results are saved with the correct file names to the appropriate location on the server.

The first step in ensuring proper sampling techniques is to provide staff with training for the sampling conditions they encounter. Supervisors are responsible for providing appropriate levels of training to all field staff and ensuring that all samplers are proficient to carry out their responsibilities or are adequately supervised.

It is the responsibility of supervisors to compare water quality data to the applicable standards and to previously collected data to review trends, outliers, etc.

Supervisors must also periodically review sampling procedures and the content of this SOP to ensure the best methods are being used and that adequate QA/QC is being incorporated into the program.

#### 3. Safety

Safety is the most important component of any field program. All staff must be aware of all potential safety hazards and personal protective equipment (PPE) requirements for any task they are completing. At no time should field staff feel unsafe and all questions or concerns about safety must be brought to the attention of a supervisor.

It is crucial that monitoring activities are completed in a safe manner. This includes having first aid equipment, communication equipment, and wearing proper footwear and gloves for the job. Field staff and supervisors should review all appropriate Job Hazard Analyses and Safe Work Procedures to ensure that the safety related elements of all tasks related to sampling are understood.

Water quality sampling and related tasks are to be carried out by at least two people at the following sites: W1, W2, W4, W5, MC1, W6, W7, W10, W32, W33, W37, W38, W39, W40, W41, W46, W50, LDP, C4, C10 and the five Minto North sites.

Water quality sampling and related tasks can be carried out by an employee working alone at the following sites: W3, W8, W8A, W12, W13, W13A, W14, W15, W16A, W17, W30, W35, W42, W43, WTP, WC.

Seasonal conditions, bear activity and other factors may cause single-person sites to be temporarily re-classified as two-person sites, and vice versa, but employees may not deviate from the classifications listed above without

the authorization of their supervisor.

## 4. General Guidelines for Surface Water Quality Monitoring

Water samples, field measurements, and observation of site conditions are collected from the same area for every sampling event whenever possible to achieve representative results over time.

Standard field forms are used to document all the required details for each sampling event, including thorough descriptions of unusual conditions and variations to the sample site or procedure. This data is stored in the Minto Water Quality Database.

The following procedures, practices, and considerations will be followed by all staff involved in the Water Quality Monitoring Program:

- All field staff will have the appropriate training and experience with field equipment, sampling procedures and objectives prior to performing monitoring duties or be accompanied by experienced staff.
- Organize a sufficient supply of bottles, labels, preservatives and filters to complete the sampling ahead of time. Sufficient quantities of these items should be stocked at the mine at all times.
- Sample containers are supplied by the analytical laboratory pre-cleaned and capped. Hands should be clean prior to sampling and clean gloves worn. Metal jewelry should not be worn on hands or wrists and smoking is not permitted while sampling.
- Do not use a preservative after the expiry date and always store preservatives where they will not freeze or overheat. Return expired preservatives to the laboratory for proper disposal.
- Do not take a sample or wade into a stream if conditions are unsafe. Ensure safe footing and solid points if contact when sampling from shore.
- Rinsing of bottles should be done slightly downstream from the actual sample location to prevent contaminants from entering the sample bottle.
- Sampling ponded water should be avoided as it will not provide accurate representation of water quality. Avoid collecting sediment and surface films if present.
- When wading to sample, always collect the sample while facing upstream to ensure that contaminants that may be on the sampler do not flow into the container. Care must be taken to avoid stirring up any sediment.
- During sample collection, the inner portion of sample bottles and caps must not be touched with anything other than sample water.
- Filter and/or add preservatives immediately or as soon as possible after sample collection.
- Gloves, syringes and filters will be kept in clean, sealed plastic bags.

- If a specific parameter cannot be completed for the site (e.g. the pH probe is not working) a note must be made on the field data form explaining why it could not be taken.
- As much as possible at a mine site, sample containers should be kept in a clean environment. Bottles must always be capped. Vehicle cleanliness is an important factor in minimizing the risk of contamination.
- All samples should be kept upright, and as close as possible to 4°C until they are delivered to the laboratory. They must not be allowed to freeze unless freezing is part of the preservation protocol.
- Ship samples to the external laboratory as soon as reasonably possible. Samples should be analyzed within the time limits specified by the analytical laboratory.

## 5. Surface Water Sampling Procedures

#### Preparation

Prior to departure for sampling, staff will ensure that all field equipment is checked for functionality and cleanliness and that sample bottles are clean and unopened. All equipment, calibration standards, preservatives, sampling gear and sample bottles will be organized and stored in a clean environment and transported in clean, dry containers. Field instruments should be tested to ensure batteries are charged and all parts are accounted for.

Sample bottles, preservatives, syringes, filters and coolers are currently supplied by ALS Laboratories. Current contact information and shipping label for ALS Laboratories is provided in Appendix 1.

Preparation for water quality sampling must also include provision for quality control samples. The number of quality control samples taken must correspond to a minimum of 10% of the total number of samples taken for all sampling events.

The following is a list of equipment and sampling supplies regularly used to complete surface water quality monitoring:

- Sample bottles and labels
- Field notebook and/or field forms
- Water quality meter
- Nitrile gloves
- Syringes and filters
- Sample preservatives
- Cooler and sufficient ice packs
- Deionized water
- Cooler labels and laboratory Chain Of Custody (COC)
- Chisel, axe and/or ice auger (when sampling under ice)
- Spare parts and batteries

General field gear typically includes:

- PPE
- Radio
- Rubber boots or waders
- Camera
- Pencils, pens, permanent marker
- Sample site map, GPS
- Flagging tape
- Multi tool
- First aid kit
- Appropriate clothing
- Water and food

#### **Maintenance of Field Instruments**

All instruments used for performing field measurements are stored and calibrated in accordance with manufacturer's specifications. Proper maintenance of field instruments is very important as instruments must be in good working condition to produce accurate readings. Field staff are trained how to calibrate and use all water quality field instruments prior to going in the field.

Minto primarily uses an YSI Professional Plus handheld multi-parameter meter (YSI) for monitoring water quality field parameters. Performance of the meter is tracked and verified through daily checks and regular calibrations. Calibration checks are recorded to identify problems and to review in the event of equipment malfunction.

Alternatively, a Eutech (Oakton) PCTestr 35 handheld meter is used for monitoring sites W13 and W14. The meter measures temperature, pH, and conductivity only and is checked prior to use and calibrated per the manufacturer's specifications.

Routine maintenance on all field instruments is performed according to the manufacturer with a record of all repairs and maintenance stored on site.

#### **Field Measurement of Water Quality Parameters**

Water quality field parameters are recorded with every water sample including water temperature, pH, conductivity, dissolved oxygen (DO), and oxidation reduction potential (ORP). Water quality meters are used per the instructions provided by the manufacturer for greatest efficiency. The following procedures and considerations are followed by trained Minto staff:

- Field measurements are always made in situ (in the water body) or using a sub-sample taken in a separate container which is discarded once the measurements are recorded. Sub-samples are not used for further chemical analyses.
- Instrumentation must display stable in-situ parameters before field staff record parameters. For example, field staff will allow the YSI to stabilize in-situ for 10-15 minutes ensuring that dissolved oxygen readings are stable.
- Dissolved oxygen measurements are always taken in-situ rather than from a sample container.
- Field parameters are measured just below the water surface (0.1 m depth).
- Water quality data is screened on site during sample collection and suspicious readings are re-measured to prevent the recording of false information. Any indication of malfunctioning equipment is recorded in the notes for that station.

#### **Sample Collection**

Surface water samples should be collected mid-stream whenever possible to reduce potential contamination from foreign material, sediments, and/or other effects from stream banks, back eddies, seepage areas, etc. When the stream is small, the current is too strong, water too deep, or ice is too thin, samples should be collected from the stream bank reaching as far out into the stream as safely possible. When field staff can safely wade into a stream, the sampling location should be approached from downstream. Samples are always collected upstream of the sampler.

The following surface water sampling procedures are followed by trained Minto staff:

- Locate the station using a station map or GPS coordinates then select an area representative of the stream to collect the sample.
- Clearly label all sample bottles with station name, date, time (24-hour clock), and analysis code (provided in Table 1).
- Put on clean nitrile gloves prior to collecting the sample.
- Handle sample bottles and caps appropriately to avoid contact with internal surfaces.
- Plunge the bottle under the water with the mouth facing upstream away from the sampler's hand.
- All bottles will be triple-rinsed.
- Ensure that samples requiring filtering are rinsed with filtered water only.
- Collect the water sample until the bottle is full and remove it from the water. Pour some water out to allow for addition of preservative, if required.
- Use new syringes and filters for every station.
- Filter at the sampling location whenever possible and otherwise from a sub-sample taken in a separate container in a clean environment as soon as possible after sample collection.
- Add preservatives to the required samples as soon as possible after sample collection and filtering.
- Replace caps immediately and tightly to prevent sample loss. Invert bottles to mix preserved samples.

• Place samples in a cooler with sufficient ice packs.

The following tables list the current requirements for water quality samples sent to ALS Laboratories and the Minto On Site Laboratory (Minto Lab).

Analysis Name	Analysis Code	Parameters (not inclusive)	Bottle (plastic)	Filter	Preservative
Physical Parameters	RAW	TSS, TDS, pH, EC, hardness, alkalinity	1 L	Not required	Not required
Nutrients/Anions	RAW	SO <sub>4</sub> , Cl, Fl, NO <sub>2</sub> , NO <sub>3</sub>	500 mL	Not required	Not required
Nutrients/Anions	NH4, TP	P, NH <sub>3</sub>	120 mL	Not Required	1 mL Sulphuric Acid (H2SO4)
Total Metals	тм	Al, As, Cd, Cr, Cu, Fe, Hg, Pb, Mn, Mo, Ni, Se, U, Zn, Na, K, Ca, Mg, S	120 mL	Not required	1 mL Nitric Acid (HNO3)
Dissolved metals	DM	Al, As, Cd, Cr, Cu, Fe, Hg, Pb, Mn, Mo, Ni, Se, U, Zn, Na, K, Ca, Mg, S	120 mL	Required (0.45 μm filter)	1 mL Nitric Acid (HNO3)
Dissolved Organic Carbon	DOC	DOC	120 mL	Required (0.45 μm filter)	1 mL Sulphuric Acid (H2SO4)
Total Organic Carbon	тос	тос	120 mL	Not required	1 mL Sulphuric Acid (H2SO4)
Cyanide	CN	CN	120 mL	Not Required	1 mL Sodium Hydroxide (NaOH)
Radium	Ra 226	Ra 226	1 L	Not required	4 mL Nitric Acid (HNO3)

#### Table 1: Sample Requirements for Samples Analyzed by ALS Laboratories

Analysis Name	Analysis Code	Parameters	Bottle (plastic)	Filter	Preservative
Physical Parameters/ Nutrients	RAW	TSS, NO <sub>2</sub> , NO <sub>3,</sub> NH <sub>4</sub>	1L	Not required	Not required
Total Metals	тм	Al, Cd, Cu, Se	120 mL	Not required	1 mL Nitric Acid (HNO3)
Dissolved metals	DM	DM Al, Cd, Cu, Se		Required (0.45 μm filter)	1 mL Nitric Acid (HNO3)

#### Table 2: Sample Requirements for Samples Analyzed by Minto Lab.

#### **Under Snow or Ice Sampling**

During winter months, water quality monitoring stations will freeze over and water quality samples will need to be collected from under snow and/or ice. Only field staff specifically trained in ice safety will follow these procedures:

- Store and transport chisels, axes and augers in clean environments to limit contamination.
- When sampling on ice always work with a partner and always proceed with caution. If the ice is unsafe or you are unsure stop work immediately.
- Ice thickness must be tested with a drill with and auger bit, axe or chisel prior to walking onto a frozen water body and every few steps afterwards. A survival suit should be worn when ice thickness is being determined. Special care must be taken at outflow and inflow areas as conditions are constantly changing.
- Clear snow and loose ice away from the sampling location and drill through the ice with an ice auger, either motorized or a hand auger. The area around the drill hole should be kept clean and free from potential contamination such as gas, dirt from the drill or work boots, etc.
- Once the hole is drilled, all the ice chips and slush should be removed from the hole using a slotted spoon, etc. Allow several minutes for the water to flow freely under the ice, allowing potential contaminants to clear before taking a sample.

#### **Field Notes and Photographic Record**

In addition to recording water quality field parameters and the samples collected at each site, trained field staff must document all relevant environmental conditions observed at the time of sampling and any unusual occurrences. Deviations from standard protocols whether deliberate or accidental (e.g. samples taken from a different location due to safety or access considerations, procedures used that differ from those outlined in this

SOP) must be recorded in the field notes.

Standard field forms are used as much as possible to ensure all the required information; water samples and field parameters are collected. A current copy of the Minto Water Quality Field Form is provided in Appendix 2. If a field notebook is used, as a minimum the field notes must include the following information:

- Station name, date, time, and names of field staff present;
- Weather conditions and observations on the physical conditions at the sampling location;
- GPS coordinates for new sites or when the sampling location has changed (more specific to winter sampling); and
- Details of any other site specific information relevant to the sampling event.

Field notes must always be clear, concise, and include the station name and date. All field notes should be completed on site. Finally, it is good practice to refrain from erasing mistakes when recording field notes. Crossing out the error and rerecording the data is preferred. Field notes are entered into the Minto Water Quality Database upon return from the field and all field notes and field forms are stored on site.

Photographs can be taken during any sampling event to document current conditions at each station. At a minimum, photos must be taken to show changes in physical conditions at the sampling location. Photos from one sampling event will typically include one upstream and one downstream facing shot. Aerial photos should also be taken when the opportunity is available. Photographs are an important tool to assist with data interpretation. Photos are stored in digital format and must be accurately labeled by field staff upon return from the field.

#### **Sample Custody and Shipment**

Water quality samples are always handled to prevent damage and potential sample loss, thereby reducing the risk of contamination. Samples are transported around the mine site in sealed coolers with sufficient ice packs until they are placed in a sample fridge or delivered to the Minto Lab. Samples are stored upright in clean refrigerators equipped with thermometers. Samples are maintained as close to 4°C as possible from the time of collection until they are delivered to a laboratory.

After surface water quality samples have been transported back to the office, field staff are responsible for inspecting the samples to ensure they are properly preserved, labeled, and sealed. If the samples are to be analyzed on site, they should be delivered to the Minto Lab as soon as possible.

Samples that require external analysis must be shipped to the appropriate laboratory with a completed chain of custody (COC) form. An example of a COC form is provided in Appendix 3. This form is used to request sample analysis and track sample custody. Filling out a COC should be done with field forms and samples on hand to confirm that all the sample containers for each station are accounted for and labeled correctly.

All samples must be submitted to the appropriate laboratory for analysis based on the maximum sample hold time. Each parameter has a specific hold time that ensures the results generated are accurate. However, due to the remoteness of Minto Mine the maximum hold times for some samples will not be met. For this reason, it is essential that samples be shipped to the laboratory as soon as possible. It may be necessary to ship samples on the same day as they are collected to preserve the accuracy of the sample analysis. It is the responsibility of field staff to ensure the hold times are met where possible.

All samples must be well sealed and packed with paper, bubble wrap, etc. to prevent spills or breakage. Pack each cooler with sufficient ice packs to maintain the samples at 4°C. Samples collected during the winter will be cooler and will not require the same amount of packaging and ice packs as samples collected in the summer. Samples must not be permitted to freeze. If samples are being shipped in temperatures significantly below freezing, collapsible jugs of warm water may need to be added to the packaging.

Enclose a printed copy of the COC form in a sealed plastic bag or envelope and place it inside one of the coolers with the sample shipment. Label all coolers or shipping containers with the address of the laboratory and the sender and attach it with enough clear tape to protect the label. An example of a laboratory shipping label is provided in Appendix 1.

#### **Data Management**

All water quality data including field notes, photographs, completed COC forms and laboratory results are carefully handled, organized and stored to ensure the information can be located for future use. The information collected during water quality sampling events is critical to the interpretation of the data, in some cases even several months or years after the sampling event has taken place.

The following surface data management procedures are followed by trained Minto staff:

- After completing a COC form, an electronic copy is saved with the appropriate file name to the designated location on the server.
- When samples are received at the lab, an automated confirmation email is sent to Minto environment staff. The lab job number is entered into the Minto Water Quality Database.
- When lab results are received by email they are reviewed by supervising staff at the earliest opportunity. Supervisors are responsible for importing the data into the Minto Water Quality Database regularly.
- If reviewing new results in comparison to past trends suggests that results are suspect, or if the results
  exceed the applicable standards for a specific parameter, an investigation will be initiated. The lab should
  be requested to review their QA/QC for that batch and re-run the sample, or analyze waters from
  another sample bottle for the suspect parameter(s).
- Unless it is obvious that the anomalous result that is over discharge criteria is false, new samples should be taken and sent immediately.

## 6. Quality Assurance and Quality Control

The Minto Quality Assurance and Quality Control plan has been created to provide confidence in the data collected for all environmental monitoring and sampling programs. QA/QC is an integral component to quality surface water quality sampling. General QA/QC procedures that apply to the Water Quality Monitoring Program are described in this section.

## **Quality Control**

Quality control protocols are the set of routine procedures and methods designed to achieve and maintain a recognized level of quality. Therefore, the collection of reliable surface water quality field data at Minto is accomplished by following the procedures described in this document. Quality assurance includes the procedures that keep track of those procedures and provide a check on the quality of the data produced.

Some of the most common quality-related problems introduced in surface water quality sampling include the mislabelling or switching of bottles, failure to add proper preservatives, improper storage conditions, and sample contamination from sampling equipment or other sources.

Quality control samples are collected and analyzed to verify the integrity of water samples, detect errors introduced during sampling. Quality control samples represent 10% of the total number of samples collected and consist of a random combination of the types provided in Table 3. Field staff are responsible for documenting where quality control samples are prepared on the field forms and in the Minto Water Quality Database.

Туре	Description and Sample Purpose
Trip Blank (TB)	A sealed container of deionized water sent from the laboratory used to detect any widespread contamination during transport and storage. The trip blank is transported with the sample bottles for the entire duration of the sampling event. Trip blanks indicate contamination within the bottle or from volatile compounds.
Field Blank (FB)	A sample of deionized water that is prepared in the field using the same procedures for collecting the field sample. Preservative is added after the sample is collected. Field blanks measure contamination from bottles, collection methods, the sampling environment, and preservatives.
Duplicate (DUP)	Duplicate samples are independent samples collected from the same place and time to determine the precision of environment and laboratory heterogeneity. Duplicate samples measure the reproducibility of the sampling and analysis.
Field Split (FS)	Aliquots taken from the same sample container and assumed to be identical. Split samples can be sent to separate laboratories for analysis and the results can be used to determine inter-lab variability. Care must be taken to ensure that the samples are split homogeneously.

#### **Table 3: Quality Control Sample Descriptions**

#### **Quality Assurance**

Quality assurance protocols help ensure that the Minto Water Quality Monitoring Program is quantifiable and able to produce quality data. Minto Mine is continuously involved in consultation with professionals and technical experts regarding program design, standard operating procedures, and data review. Ongoing staff training and inspections of staff (especially new hires) performing monitoring activities ensure data collection and results are consistent, representative and high quality.

The steady improvement of quality assurance protocols involves developing more detailed and program specific verification processes and automated checks, as well as peer reviews and audits by external professionals on a regular basis. Effective quality assurance will identify potential problem areas and necessary corrections to procedures and data management, and facilitates evaluation and improvement of the monitoring program.

#### **Quality Assurance on Data**

Examination and evaluation of field data and data entry is an integral part of quality control. While it is not possible to check all aspects of input data, calculations, and interpretations, checks can be performed on selected sets of data at appropriate intervals. A review of work procedures and data collection methods will identify potential sources of error.

Reported water quality data is reviewed, and evaluated by Minto Mine staff on a monthly, quarterly and annual basis. The water quality database is audited by Minto Mine and a professional consultant on an annual basis. As mentioned previously the Minto water quality database is checked monthly and is completed by cross checking the database with the sample tracking and log spreadsheet. The sample tracking log and spreadsheet are reviewed against field notes on a weekly basis; additionally, all samples and Chains of Command that are sent out to the external laboratory are checked by two staff. If inconsistences are found, further investigation is performed using field notes, COC, and lab result files depending on the nature of the error.

#### 7. Closure

Not all the situations encountered by field staff have been included in this document (e.g. water column/depth profile sampling) as they are not part of routine sampling events. A JHA should be conducted prior to completing any new or irregular task to identify what work will take place, list all the potential hazards that could be encountered during the work, and the measures necessary to avoid or mitigate the hazards.


## 8. References

Resources Information Standards Committee (RISC). 2003. Ambient Freshwater and Effluent Sampling Manual.

Environment Canada. 2001. Guidance Document for the Sampling and Analysis of Metal Mining Effluents.

Canadian Council of Ministers of the Environment (CCME). 2011. Protocols Manual for Water Quality Sampling in Canada.

Appendix 1: Current ALS Contact and Shipping Label

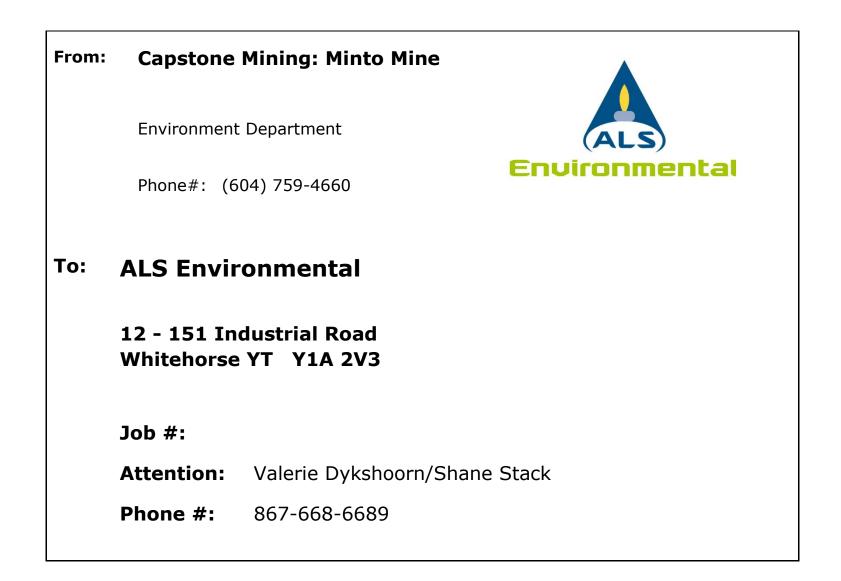

Appendix 2: Minto Environment Water Quality Field Form

Sample	Site:		Date:		Sampler(s):						
Sky:			Temp:		Precip:		Wind:				
Lab Ana	lysis?		QA/QC taken?	Y		Ν					
E		I	DUP		ТВ		FB				
Photos?		Y	Ν	YSI Callibrati	on?	Y		N			
RAW RAW NUT 1 1 L ml ml		NUT 120 ml	TM 120 ml	DM 120 ml	DOC 120 ml	TOC 120 ml	Ra 226 1L	Bioassay <i>various</i>			
Temp C		DO %	DO mg/L	SPC µs/cm	EC μs/cm	рН	ORP mv	Turb NTU			
Flow Recorde	d?		Staff Gauge (n	n):	Flume RIGH	Г (ft):	Flume LEFT (L/S):				
Y		Ν									
Notes (s	ite cond	itions or variat	ions from norma	al, i.e. ice cove	r, sediment, flo	ws, etc.)					
Data en	tered:			Data reviewed:							

#### Minto Water Quality Field Form

Appendix 3: Sample Chain of Custody For ALS



#### Chain of Custody (COC) / Analytical Request Form

Affix ALS barcode label here (lab use only) COC Number: 2017-

Page of

Canada Toll Free: 1 800 668 9878

Report To Company:	Contact and company nar	ne below will app	oar on the final report		Report Format																
Company:			ear on the final report		Select Service Level Below - Please confirm all E&P TATs with your AM - surcharges will apply																
	Minto Explorations Ltd.			Select Report Format: PDF EXCEL EDD (DIGITAL)						Regular [R] Standard TAT if received by 3 pm - business days - no surcharges apply											
Contact:	Minto Environment - Coordii	nator		Quality Control (QC) Report with Report         YES         NO           Compare Results to Criteria on Report - provide details below if box checked         Select Distribution:         EMAIL         MAIL         FAX						4 day [P4]											
Phone:	1-604-759-4659									A day [P4]     Business day [E1]       3 day [P3]     Same Day, Weekend or       2 day [P2]     Statutory holiday [E0]							r				
i i	Company address below will ap	pear on the final	report							day (P	2]			EME		Statu	tory h	olida	y [E0]		
Street:	2100-510 West Georgia St.			Email 1 or Fax	minto_environmer	nt@mintomine.c	om		Date ar	nd Time	Require	<mark>ed for a</mark>	II E&P '	TATs:				dd-m	mm-yy	/ hh:m	nm
City/Province:	Vancouver, British Columbia	a		Email 2				For test	s that ca	n not be	performe	ed accord	ling to t	he servi	ce level	selecte	d, you v	vill be co	ontacted		
Postal Code:	V6B 0M3			Email 3										Analy	sis R	eques	st				
Invoice To	Same as Report To	YES	NO		Invoice Di	stribution			India	cate Filt	ered (F)	, Preser	ved (P)	or Filte	red an	d Prese	erved (I	P) bel	low		
	Copy of Invoice with Report	YES	NO	Select Invoice D	Distribution: EMA	AIL MAIL	FAX				Р	F/P	Р	F/P	Р	F/P					
Company:	Minto Explorations Ltd.			Email 1 or Fax	ap@mintomine.co	om						rved		(þ							
Contact:	Ruth Cayetano			Email 2								preserve		erve							ស
	Project Infor	mation		Oil	and Gas Require	d Fields (client	use)	suc				and pr		preserved)							linei
ALS Account #	/ Quote #:			AFE/Cost Center:		PO#		Anic				d ar		+		(DOC)					onta
Job #:				Major/Minor Code:		Routing Code:		ity /	Solids (TSS)	(S)	less	ltere		Itere		Q u					ŭ
PO / AFE:				Requisitioner:				kalin	ids (	E	ardn	Л )(fi	ess	] (Fil	onia	Carbon					Der C
LSD:				Location:					Soli	olids	Э, Н	, (DN	Hardness	ry [1	mm⁴	ic Č					Number of Containers
ALS Lab Work Order # (lab use only)			ALS Contact: Shane Stack Sampler:				pH / Conductivity / Alkalinity / Anions	otal Suspended	Disolved Solids (TDS)	<sup>-</sup> otal Metals ( TM), Hardness	Dissolved Metals (DM )(filtered	Total Mercury, H	d Mercury [1] (Filtered	Fotal Nutrients (Ammonia)	d Organic					Z	
ALS Sample #	Sample	Identification	and/or Coordinates	-	Date	Time	Ocean la Trans	Ğ	l Su	I Di	I Me	olve	I Me	Dissolved	NU	Dissolved					
(lab use only)	(This de	scription will	appear on the report)		(dd-mmm-yy)	(hh:mm)	Sample Type	Hq/	Tota	Total	Tota	Diss	Tota	Diss	Tota	Diss					
1							Water	R	R	R	R	R	R	R	R	R					7
1																					
															├──	$\vdash$					
															<u> </u>						
1																					
															├──	$\vdash$					
													-		<b> </b>	$\square$					
1																7	T	T	T		
						1		1										$\neg$			
┟─────┛			Special Instructions / S	nacify Critoria to a	dd on ronort by alia	king on the dram	down list bolow				SAMP	PLECO			AS R	ECEP	/ED (	ab us	e only	v)	
Drinking	Water (DW) Samples <sup>1</sup> (clie	nt use)	opecial instructions / S	Specify Criteria to add on report by clicking on the drop-down list below (electronic COC only)				Froze	en		O	0(				vatior					0
Are samples take	en from a Regulated DW Syste	em?		, , ,					acks	ο	~	ubes	0						~	No	0
YES	S NO								ng Initi	_	0		0		. , 5.						
Are samples for human drinking water use?									INIITIAL COOLER TEMPERATURES ℃ FINAL COOLER TEMPER					IPERA1	TURES °C						
The samples for i																					
Are samples for r	s no															ļ					

Released by:	Date:	Time:	Received by:	Date:	Time:	Received by:	Date:	Time:

REFER TO BACK PAGE FOR ALS LOCATIONS AND SAMPLING INFORMATION WHITE - LABORATORY COPY YELLOW - CLIENT COPY

Failure to complete all portions of this form may delay analysis. Please fill in this form LEGIBLY. By the use of this form the user acknowledges and agrees with the Terms and Conditions as specified on the back page of the white - report copy.

1. If any water samples are taken from a Regulated Drinking Water (DW) System, please submit using an Authorized DW COC form.

## **Appendix 2: Minto Mine Surface Water Hydrology Standard Operating Procedures**



# MINTO MINE SURFACE WATER HYDROLOGY STANDARD OPERATING PROCEDURES

Prepared by:

**Minto Explorations Ltd** 

Last Revised, April 8th, 2017

### TABLE OF CONTENTS

1.	Purpose	4
2.	Responsibilities	4
I	Field Staff	4
;	Supervisors	5
3.	Hydrometric Station Installation	5
4.	Field Instruments	6
5.	Safety	6
6.	Field Notes and Photographic Record	6
7.	Water Quantity Data Collection Methods	7
;	Staff Gauges	7
I	Discharge Measurement using a Current Meter	8
I	Rated Structure	11
,	Volumetric Measurements	11
8.	Data Processing	11
I	Discharge Calculations	11
(	Continuous Water Level and Inline Pipe Flow Meter Data	13
,	Volumetric Measurements	13
9.	Quality Assurance and Quality Control	14
(	Quality Control	14
(	Quality Assurance	14
10.	. References	15

### TABLE OF APPENDICES

### Appendix 1: Minto Environment Hydrology Field Form

### 1. Purpose

The standard operating procedures (SOP) in this document serve as a guideline for the collection of water quantity (flow, discharge) data from water bodies at Minto Mine (Minto) specified by Water Use Licence QZ96-006. Water quantity data is critical for a variety of assessment and planning purposes at Minto and is used to interpret water quality data, prepare site water balances, create operating plans, etc. The Minto Mine Hydrology SOP follows methods and procedures described in Guidance Document for Flow Measurement of Metal Mining Effluents (Environment Canada, 2001) and Manual of British Columbia Hydrometric Standards (RISC, 2009). This document is intended for Minto Mine employees familiar with the location of hydrology stations and the data collection methods outlined in this document. Along with on the job training, this SOP will to ensure that surface water hydrology data at Minto Mine is collected consistently and the data produced is reliable and representative.

### 2. Responsibilities

The quality of flow measurements and water quantity data collected at Minto Mine is dependent on the staff involved and the attention given to field procedures, field equipment, and quality control protocols. It is crucial that flow measurements be carried out in a consistent manner with the appropriate equipment to generate the most accurate results.

The following is a typical allocation of responsibilities associated with the collection of surface water hydrology data at Minto:

### **Field Staff**

Field staff must have the appropriate knowledge and training to take precise flow measurements and collect representative data while minimizing field error as much as possible. This includes following all procedures correctly and consistently, correct use of field equipment, and completion of detailed field notes.

Field staff are responsible for coordinating all station visits in accordance with the requirements of the current WUL, including sampling locations, sampling frequency, etc. Staff performing station visits shall ensure that all site conditions and other required information are clearly documented, and that all quality assurance and quality control (QA/QC) protocols are being followed.

Field staff must be experienced in the operation and maintenance of all field instruments and the equipment used for measuring water quantity data. They are responsible for maintaining equipment and identifying equipment malfunction.

Field staff are also responsible for performing data entry related to surface water hydrology on site.

### **Supervisors**

Supervisors are responsible for ensuring field staff understand the requirements of the WUL and that all procedures and protocols are being followed and documented. Supervisors are responsible for ensuring data collection and data management procedures are being carried out consistently and identifying variance from standard procedures.

Supervisors are responsible for providing appropriate levels of training to all field staff and ensuring that all field staff are proficient to carry out their responsibilities or are adequately supervised. This is especially important when field staff are processing data and completing field activities such as station installs and surveying.

It is the responsibility of supervisors to compare water quantity data collected throughout the year and review trends, outliers, etc. This is often completed with input from external professionals.

Supervisors must also periodically review data collection procedures including the content of this SOP to ensure the best methods are being used and that adequate QA/QC is being incorporated into the program.

### 3. Hydrometric Station Installation

There are many factors to consider when selecting and installing a hydrometric station in an open channel. Hydrometric stations at Minto typically consist of a pressure sensor and data logger installed in a perforated PVC tube. This instrumentation is accompanied by a staff gauge. All components are attached to a wooden frame and anchored to shore. Minto currently consults with external professionals regarding the establishment of new stations, however the following guidelines will be considered by trained Minto staff when selecting and installing hydrometric stations:

- Site can be accessed safely by field staff through the full range of stage;
- Site is located where the stream cross-section is stable, typically in a pool or run, avoiding turbulent riffle or cascade sections;
- The staff gauge and pressure sensor can record accurate water levels through the full range of stage and discharge can be accurately measured at all stages using acceptable flow measurement methods;
- All station components are structurally sound and will not move in any direction;
- Install staff gauges so they are protected from damage by floating debris and ice and are not affected by drawdown or pileup of water. It is typically easiest to read the staff gauge with the face parallel to the current;

- Ideally the depth and velocity of the stream should be uniform with good cross-sections for flow measurements using a flow meter (e.g. single channel, no undercut banks, minimal obstructions, no backwater eddies); and
- No tributaries exist between the hydrometric station and wading cross-sections.

### 4. Field Instruments

All instruments used for collecting water quantity data are used and maintained per the manufacturer's specifications. Prior to departure for sampling, staff will ensure that all field equipment is checked for functionality.

Minto currently uses a Hach FH950 Electromagnetic Velocity Meter (current meter) with a top-setting wading rod to perform manual discharge measurements whenever possible. Electromagnetic current meters are factory calibrated and require little maintenance. The Hach FH950 current meter performs a diagnostic self-test each time it is powered on and instructions for checking zero velocity settings are provided in the user manual. Records of all checks and maintenance are stored on site.

Continuous water level readings and barometric pressure are recorded using Solinst data loggers for open channels and inline flow meters for pipe flows. These instruments are received factory tested and calibrated, and are installed, programmed and maintained per the manufacturer. All information provided with the flow measurement equipment is kept and stored on site.

### 5. Safety

Wading is the most common method for taking flow measurements at Minto and can also be one of the most dangerous. W35 is the only site where manual flows are taken and where it is permissible to work alone, if the need arises. However, it is always preferable that two people conduct manual flow measurements. Waders with wading belts, safety lines and life vests are available for all staff. Always explore the streambed for large obstacles or holes while wading carefully into the stream. Stream substrates are often slippery. If it is safe to wade the stream, then the measurement can begin. Always assess and mitigate safety risks.

When the stream is too high and/or too swift for wading, then either an alternative method should be used or the measurement should not be taken. If conditions do not seem safe or you are unsure, do not attempt to wade the stream. If it is possible to take a measurement from shore, always ensure safe footing and solid points of contact.

### 6. Field Notes and Photographic Record

Detailed documentation of conditions and observations during station visits is necessary to ensure the quality and accuracy of the data collected. Field staff are responsible for thoroughly documenting site conditions including staff stage readings, stream characteristics up and downstream of the flow measurement site, weather conditions, deviation from standard procedures, and any other significant details about the visit. Standard field forms are used to ensure all the required information is collected. A current copy of the Minto Mine Hydrology Field Form is provided in Appendix 1.

All field notes should be completed at the station immediately following the observations. Field notes must be clear, concise, and include the station name, date and time. It is good practice to refrain from erasing mistakes when recording field notes. Crossing out the error and rerecording the data is preferred. Field notes are entered into the Minto Water Quantity Database upon return from the field and all field notes and field forms are stored on site.

Data logger files downloaded from the pressure sensors should be transferred immediately from the field laptop or Solinst handheld and saved with the correct file names to the appropriate location on the server.

Photographs should be taken to document current conditions at each station. At a minimum, photos must be taken to show changes in physical conditions around the station. Photos from one station visit will typically include one upstream and one downstream facing shot. Aerial photos should also be taken when the opportunity is available. Photographs are stored in digital format and must be accurately labelled by field staff upon return from the field.

### 7. Water Quantity Data Collection Methods

An explanation of the water quantity data collection methods carried out at Minto Mine and detailed procedures for each method are described in this section.

### Staff Gauges

Staff gauges are used to record the stage (water level) of a water body. All discharge measurements and continuous water level readings are referenced to the staff gauge; therefore, it is extremely important to read the staff gauge carefully and correctly each visit. Taking a photograph of the water level on the staff gauge is a useful reference in the field for ensuring accurate readings. Staff gauge readings should be taken before and after flow measurements as water levels can change in a small amount of time. Always record stage to three decimal places and document the exact time the reading was taken.

Depending on the orientation of the staff gauge, high flow conditions may sometimes result in water stacking up on the gauge. Readings should be taken at the downstream side of the gauge where the water is calmer.

It is also possible to have no surface flow when the station is visited. These conditions are very important to developing accurate discharge records. Zero flow conditions must be thoroughly documented and photographed. It is also possible to read a water level on a staff gauge when there is no visible flow. This must also be thoroughly documented if encountered.

### Surveying and Tracking Staff Gauge Drift

Due to ice movement and natural freeze-thaw cycles, staff gauges are subject to move or drift over time. If a staff gauge moves the reference elevation to which all other measurements and records at that site are compared to changes. Always document conditions that may suggest the staff gauge moved in any direction. Photos and any estimates of amount and direction of drift are very useful when correcting data records and planning repairs.

Annual surveying of staff gauge elevation (typically in the spring) tracks changes in staff gauge location and allows for correction of water level records if needed. Detailed procedures for level surveys are not provided in this SOP; however, the following elevation points must be collected:

- Elevation of 0.000m on the staff gauge (should be relative to an arbitrary elevation assigned to a benchmark in the area, typically a spike in the base of a large nearby tree);
- Elevations of at least two benchmarks; and
- Elevation of the water surface at the gauge;

Bench marks are permanent reference points with known elevations. They are established at each station in a stable location close enough to the gauge to allow for efficient surveying, anchored where they are not likely to move or be damaged. The ability of the benchmark to maintain its position in the local environment is essential. At Minto, benchmarks are typically a spike or lag bolt in a mature tree.

### **Discharge Measurement using a Current Meter**

Minto uses the mid-section method for measuring flows using a current meter. This is a standard discharge measurement technique where the depth and velocity are measured at several verticals along a cross-section. Velocity measurements at a percentage of the stream depth are assumed to represent the average velocity through the vertical water column. Accurate current metering is critical to the accuracy of the discharge measurement.

### Preparation

Upon arrival at the site, field staff will conduct an overall station inspection. Observing and documenting the overall channel conditions will help identify conditions that may affect the measurement and the stagedischarge relationship. Assessing channel conditions is also important in deciding whether or not it is safe to complete the measurement. This includes the presence of aquatic plants and floating debris, any obstructions in the stream, and signs of channel bank erosion and deposition in vicinity of the station.

Field staff are responsible for selecting the best cross-section to carry out discharge measurements during each station visit. The location of the cross-section often varies with changes in water levels or channel conditions.

The best sections for low, medium, and high flow measurements should be established and used as much as possible.

Make a preliminary crossing before stringing the tagline. Try to obtain an overall impression of the depths and velocities while wading. Select an appropriate cross-section where the bed and banks of the watercourse are straight and uniform and the channel bed is free from vegetation, immovable rocks, and other obstructions. Avoid muddy and sandy bottoms, backwater eddies, obstacles, etc. as much as possible.

Improve the cross-section by removing boulders and debris from the section and the area immediately above it. Remove significant vegetation from the area upstream and downstream from the section. On smaller watercourses, it may be possible to construct small dikes to cut off sections of shallow flows and dead water. Once complete, allow sufficient time for conditions to stabilize before proceeding with the measurement. Improvements should not affect the staff gauge reading. Do not make changes to the cross-section during the discharge measurement.

### Performing the measurement

Proceed with the measurement as follows:

- 1. Note the date and time and record the staff gauge reading. This step is essential for plotting the results of the discharge measurement.
- 2. Secure the tagline (measuring tape) on either shore and string it across channel perpendicular to the direction of flow. Determine the overall width of the metering section. Assess the approximate spacing of the verticals, per the channel width and flow pattern.
- 3. Record the distance along the tagline of the left or right bank. Left and right bank are determined facing downstream. If there is a steep drop at the edge of the stream, the first "vertical" depth and velocity observation should be taken as close to the edge as possible.
- 4. Begin the measurement at the first vertical along the tagline. Record the distance of the reading along the tagline then measure and record the water depth at each location using the wading rod. The water depth is the point where the water surface intersects the rod. Observations should be made to the nearest centimeter. This is used to calculate the total cross-sectional area.
- 5. Where water depth in the vertical is <1.0 m, observations are made at 0.6 depth from the water surface. To position the current meter sensor correctly, adjust the sliding rod to line up the scale on the rod to the value of the observed depth. Detailed instructions on how to adjust the rod are provided by the manufacturer.
- 6. Where water depth in the vertical is >1.0 m, the velocity is measured at both 0.2 and 0.8 depth from the water surface and the mean velocity is calculated. To set the current meter on 0.2 depth position, double

the value of the observed depth and adjust the sliding rod to line up the scale to read this value. For 0.8 depth position the scale to read half of the observed depth.

Note: The 0.2-0.8 method is not entirely satisfactory if the channel bed is very rough, irregular, or covered with aquatic growth. These conditions will often produce erratic results for the observation at the 0.8 depth. In some situations, more reliable results will be obtained by computing the average velocity based on the 0.2 and 0.8 depths and averaging the computed value with the velocity from the 0.6 depth. This is known as the three-point method.

- 7. Allow sufficient time for the current meter to adjust to water conditions. Observe velocities for a minimum of forty seconds. The adjustment time will be a relatively short at high velocities and significantly longer at low velocities.
- 8. Continue the measurements across the stream until you reach the opposite bank and record the distance on the tagline. After taking the discharge measurement record the second staff gauge reading and the time.
- 9. After the measurement, download data logger readings, record real time data from the Solinst data logger, and service the instrument by checking the battery voltage and inspecting all of the cables and connections. During every visit to a hydrometric station, a complete inspection of the data logger and all related components should be conducted. Any sign of malfunction or deterioration of the station components must be recorded and repaired as soon as possible.

To obtain accurate measurements by wading, field staff must pay attention to detail and technique. There are many things to consider and numerous opportunities for error. The following guidelines will help obtain reliable results:

### Number and Spacing of Verticals

All discharge measurements should include 20 verticals with no less than 10 observations of both depth and velocity for most cross-sections. The distance between verticals must be at least 5 cm when using the Hach FH950 current meter (equal to or greater than the width of the current meter).

The spacing of verticals along the metering section is not usually uniform. Where the water is shallow and/or slow moving, the spacing will be greater than where the water is deep and swift. Spacing depends largely on the several factors including overall width of the stream, unevenness of the channel bed, and variation in velocity across the channel.

### Position of Field Staff

Field staff should stand to the side and downstream of the current meter to prevent any interference or effect on velocity readings. In very small channels the presence of a person in the water may significantly affect the flow measurement. In this case a plank can be placed across the stream for field staff to stand on.

### Position of the current meter

Hold the wading rod in a vertical position and the current meter parallel to the direction of flow while measuring velocity.

### Uneven Channel Bed

Measuring depths in a channel bed that is extremely soft or scattered with boulders requires extra attention. Be careful not to allow the bottom of the wading rod to sink into soft channel bed material. If the channel bed is very rough, take time to adjust the width of verticals so the observed depths so reflect the tops of the boulders and the depths between them.

### **Rated Structure**

Minto currently has a prefabricated flume combined with a pressure sensor constructed in a four season shelter at W3. Water levels are read off an embedded staff gauge on the flume during each visit.

For optimal performance, the flume floor and walls should be kept clean and free of sediment and algae growth and upstream of the structure should be kept free of sediment accumulation and debris.

### **Volumetric Measurements**

Volumetric measurements are taken at the outlets of elevated pipes and culverts, and periodically at select stations when appropriate. This method involves collecting water in a container of known volume and recording the time it takes to fill in seconds. There must be a minimum of three trials to produce an average time. Volumetric containers should be calibrated and stopwatches should be water resistant.

### 8. Data Processing

Hydrology data is compiled by Minto Mine staff on a monthly and yearly basis, including discharge calculations and water level record corrections. Processing data into stage discharge curves, hydrographs, and other discharge records is presently completed or largely supported by a third party (Access Consulting Group) and is not included in this SOP.

### **Discharge Calculations**

Discharge is defined as the volume of water flowing through a given cross-section of a stream over a given period. Discharge is typically expressed in L/s or m3/s. For any stream location, there is a correlation between water level and discharge called the stage-discharge relationship. Once this is established, discharge can be estimated from recorded water levels and staff gauge readings to create a continuous discharge record. To develop this relationship, manual discharge measurements are obtained at the hydrometric station over the

maximum range of stage possible. These corresponding points are graphed, then a stage-discharge curve can be drawn that best represents these points.

All field data from station visits is entered into the Minto Water Quantity Database and processed into discharge values using a template and standard formulas in Excel. Care must be taken to ensure the formulas are not modified during data entry.

### **Current Meter Measurements**

The mid-section method allows for mean discharge (Q) to be calculated by multiplying the mean stream velocity (V) and the cross-sectional area (A); thus, Q=VA. In this method, the stream is divided into a number of panels. The flow in each panel is calculated by multiplying the mean velocity measured at each vertical by the corresponding width measured along the surface tape or cord. This width should be equal to the sum of half the distance between adjacent verticals. The velocity in the two half widths next to the banks can be estimated. For a detailed description of the mid-section method of computing discharge measurements, please refer to the Manual of British Columbia Hydrometric Standards (RISC, 2009).

Table 1 illustrates an example of a completed discharge calculation for a current meter measurement.

### Table 1: Discharge Calculation

Site:	MC1	Start Time:		Staff Gauge:	0.249
Date:	8-Aug-12	End Time:	16:50	Staff Gauge:	0.249
Observ	vations	Calcula	itions	Samplers:	CB/PE
Tape Distance (m)	Depth (m)	Width (m)	Area (m^2)	Velocity (m/sec)	Discharge (m^3/s)
0.46	0	LB			
0.60	0.06	0.12	0.01	0.062	0.000
0.70	0.10	0.10	0.01	0.150	0.002
0.80	0.14	0.10	0.01	0.131	0.002
0.90	0.11	0.10	0.01	0.186	0.002
1.00	0.10	0.10	0.01	0.216	0.002
1.10	0.12	0.10	0.01	0.282	0.003
1.20	0.08	0.10	0.01	0.278	0.002
1.30	0.14	0.10	0.01	0.271	0.004
1.40	0.15	0.10	0.02	0.203	0.003
1.50	0.14	0.10	0.01	0.141	0.002
1.60	0.15	0.10	0.02	0.262	0.004
1.70	0.13	0.10	0.01	0.226	0.003
1.80	0.13	0.10	0.01	0.182	0.002
1.90	0.08	0.10	0.01	0.050	0.000
2.00	0.00	RB			
		Total Discharg	ge (m³/s)		0.0320

### **Continuous Water Level and Inline Pipe Flow Meter Data**

Continuous water level readings from pressure sensors and inline flow meters are downloaded and compensated as needed using the manufacturer's software. At this time, instructions for compensating this data are not included in this SOP.

All continuous water level readings from pressure sensors require reference to the water level during station visits. Therefore, staff gauge readings must be accurate and always documented including the time of the observation. Basically, water level data is compensated by calculating the difference between the pressure sensor water depth and staff gauge reading for each point in time and the average of all these differences can be applied to the entire data record as a single offset adjustment.

### **Volumetric Measurements**

To calculate discharge from a volumetric measurement the following formula is used:

Discharge = Volume of container (litres) / Average time to fill (seconds)

### Data Entry, Management and Processing

Data Entry in the tracking sheet is well detailed in the following SOP:

..\Hydrology Tracking Sheet Data Input SOP\Hydrology Tracking Sheet Data Input SOP .pdf

The tracking sheet includes data entry for:

- Raw Solinst Data
- Discharge Calculation made with the current meter
- Flow Measurements

The tracking sheet will automatically output the figures we need for appropriate reports.

- 1. The stage curve (also known as rating curve) is the relation between discharge ( $m^3/s$  total discharge) on the y-axis and the stage (m, staff gauge) on the x-axis. We use the graph equation ( $Q = a \cdot x^b$ ) to calculate a calculated flow and measure the discharge volumes ( $m^3$ ).
- 2. In the "graphs" tab there are 3 graphs:
  - a. Stage and Temperature (y-axis, primary and secondary axis respectively) versus time (expressed in months)
  - b. A flow Hydrograph : Flow in m<sup>3</sup>/s in this case the measure flow (y-axis) versus time (x-axis)

c. Finally the third graph is a representation of our error and corrections between the Solinst Raw data Water Level (WL), the initially corrected WL and the 9 point average corrected WL.

### 9. Quality Assurance and Quality Control

The Minto Quality Assurance and Quality Control plan has been created to provide confidence in the data collected for all environmental monitoring and sampling programs. QA/QC is an integral component to quality surface water hydrology data.

### **Quality Control**

Quality control protocols are the set of routine procedures and methods designed to achieve and maintain a recognized level of quality. Therefore, the collection of reliable surface water hydrology data at Minto is accomplished by following the procedures described in this document.

For current meter measurements, errors in the measurement of width, depth, and velocity as well as the lack of care in choosing the number of verticals and observations in a vertical, all combine to reduce the overall accuracy of water quantity data. To a large extent, human errors can be avoided by careful attention to detail and by adhering to established and proven techniques and routines. Systematic errors can be reduced significantly by proper maintenance and calibration of instruments and equipment, and by adequate training. However, random errors will always occur. A significant reduction in these errors can be achieved if field staff performing the measurement can recognize the potential problem areas and can take the appropriate precautionary measures to avoid or minimize them. For a detailed description of common factors that lead to inaccuracies in current meter discharge measurements, please refer to the Manual of British Columbia Hydrometric Standards (RISC, 2009).

### **Quality Assurance**

Quality assurance includes the procedures that provide a check on the quality of the data produced. Minto Mine is continuously involved in consultation with professionals and technical experts regarding program design, standard operating procedures, and data review. Ongoing staff training and inspections of staff (especially new hires) performing data collection activities help to ensure the results are consistent, representative and high quality.

Standardized management of data collected in the field is important in hydrological monitoring programs. Standard protocols and systems make the task of data processing easier and less likely prone to error. Processing of data often involves returning to the original field notes to cross check suspicious values or to analyze site conditions that might have been responsible for anomalies in the logger records. Therefore, it is easiest to evaluate the quality of water quantity data successfully when supportive values and observations have been well documented. The steady improvement of quality assurance protocols involves developing more detailed and program specific verification processes and automated checks, as well as peer reviews and audits by external professionals on a regular basis. Effective quality assurance will identify potential problem areas and necessary corrections to procedures and data management, and facilitates evaluation and improvement of the monitoring program.

### **Quality Assurance on Data**

Examination and evaluation of field data and data entry is an integral part of quality control. All data should be reviewed to determine if it is comparable to past recordings. While it is not possible to check all aspects of input data, calculations, and interpretations, checks can be performed on selected sets of data at appropriate intervals. A review of work procedures and data collection methods will identify potential sources of error.

All water quantity data including field notes, photographs and datalogger download files are carefully handled, organized and stored to ensure the information can be located for future use. Corrections or adjustments to abnormal or inaccurate data logger records rely on the availability of complete documentation.

### **10.** References

Guidance Document for Flow Measurement of Metal Mining Effluents, Environment Canada, 2001

Manual of British Columbia Hydrometric Standards, Resources Information Standards Committee (RISC), 2009

Standard Operating Protocol Surface Water Hydrology Data Collection and Management, Access Consulting Group, 2010.

Appendix 1: Minto Environment Mine Hydrology Field Form

Minto Hydrology Field Form

Site:	Date:		Initials:	
Start Time:		Sta	art Staff Gauge:	
End Time:		En	d Staff Gauge:	
Datalogger download: Y / N		Ph	otos Taken: Y /	Ν
Notes ( <b>precipitation</b> , changes to site o	conditions, datalogger	info,	, etc):	
Left & right banks chosen looking downs	stream			
Left Bank Measurement:			Left Bank Depth:	
Right Bank Measurement:			Right Bank Depth:	
Section	Tape Distance (m)		Depth (m)	Velocity (m/s)
1				
2				
3				
4				
5				
6				
7				
8				
9				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				

# Appendix 3: Minto Mine Groundwater Monitoring Plan



OPERATED BY MINTO EXPLORATIONS LTD.

# MINTO MINE Groundwater Monitoring PLAN VERSION 2018-01

Prepared for: Minto Mine

Prepared by: Minto Explorations Limited, with contributions from SRK Consulting

February 2018

### Minto Mine Groundwater Monitoring Plan First Issue: March 2013 Revision History

Revision         Issue Date         Description and Revisions Made		Description and Revisions Made
Number		
2013-01	March 2013	First Issue for WUL/QML applications
2015-01 December 2015 Update required for additional well		Update required for additional wells for licence
2016-01	February 2016	Updated based on comments from reviewers
2016-02	July 2016	Updated based on YWB request for additional information
2018-01	February 2018	Updated with new wells and monitoring schedule

## **Table of Contents**

1	Int	troduct	ion	5
2	Gro	oundw	ater-related Monitoring	7
	2.1	1.1	Groundwater Wells	7
	2.1	1.2	Vibrating Wire Piezometers	8
	2.1	1.3	Ground Temperature Monitoring	9
	2.1	1.4	Waste Rock Pile Lysimeters	0
3	Gro	oundw	ater Monitoring Plan1	1
	3.1	Mon	itoring Objectives	1
	3.2	Mon	itoring Requirements1	1
	3.3	Sam	pling Protocol1	1
	3.4	Sam	pling Frequency1	1
3.5 Water Level Monitoring		er Level Monitoring1	2	
	3.6	Anal	ytical Suite for Groundwater Samples1	3
	3.7	Qual	lity Control and Quality Assurance1	3
	3.8	Repo	orting1	3
4	Env	vironm	ental Tracer Study14	4
5	Re	ference	es1	5

# List of Tables

Table 1: WUL QZ14-031 Groundwater Conditions, Status and Information References	6
Table 2: Summary of Existing, Planned and Inoperable Groundwater Wells, Minto Mine	7
Table 3: Summary of Existing, Planned and Inoperable Vibrating Wire Piezometers, Minto Mine	8
Table 4: Summary of Existing Ground Temperature Cables, Minto Mine	9
Table 5: Lysimeter Installations and Monitoring Frequency	.10
Table 6: Operational Groundwater Monitoring Requirements	.12

# **List of Figures**

Figure 1: Monitoring Well Locations	16
-------------------------------------	----

### 1 Introduction

This document describes an updated Groundwater Monitoring Plan in support of Minto Explorations Ltd. application for amendment of Water Use Licence QZ14-031 (WUL) received August 5, 2015 and the (Minto) Environmental Monitoring, Surveillance and Reporting Plan (EMSRP) developed in support of that license. This plan *Groundwater Monitoring Plan (2018-01)* replaces *Groundwater Monitoring Plan (2018-02)*.

Groundwater Monitoring Plan (2016-02) was required by the WUL to fulfill certain conditions. Table 1 summarizes these conditions and where they are addressed.

### Table 1: WUL QZ14-031 Groundwater Conditions, Status and Information References

Condition	Status	Reference
90) The Licensee shall update the Groundwater Mon	nitoring Program to include the	following additional components:
90) The Licensee shall update the Groundwater Monitoring Program to include the following additional components:		
90. a) multi-level monitoring wells up-gradient and down-gradient of mine activities;	Installed	2017 Monitoring Well Installation Report (SRK 2017)
90. b) at a minimum, one lysimeter in each waste rock pile	Installed	Lysimeter Installation Report, Minto Mine (SRK 2018)
90. c) at a minimum, one multi-level groundwater well hydrogeologically downgradient of each waste rock pile	Installed	2017 Monitoring Well Installation Report (SRK 2017)
90. d) a multi-level monitoring well located at the most downstream extent of the Licensees claims in the Minto Creek catchment	Installed	2017 Monitoring Well Installation Report (SRK 2017)
90. e) a multi-level monitoring well hydrogeologically down-gradient of the Minto North Pit	Installed	2017 Monitoring Well Installation Report (SRK 2017)
90. f) an aquifer characterization at all new wells in the form of constant discharge tests and measurements collected to ascertain the vertical flow direction of groundwater	Installed	2017 Monitoring Well Installation Report (SRK 2017)
90. g) evaluation of longitudinal flow paths using non-toxic tracer testing and use these results to refine the numerical groundwater model;	Tracer Study Completed; no refinements to numerical model warranted.	Minto Groundwater Characterization and Hydrogeologic Conceptual Model Update Report (SRK 2018a)
90. h) at each new well location specified in d) and e) of this clause, aggressive leaching tests, such as toxicity characteristic leaching procedure on the different lithological materials that are intercepted during well drilling to ascertain the background composition of the geology in the areas; and	Completed	2017 Monitoring Well Installation Report (SRK 2017)
<i>90. i) increased sampling frequency as determined by a qualified hydrogeologist.</i>	Completed	This report
91) The Licensee shall monitor groundwater levels to refine the estimates of the long-term phreatic levels in the tailings management facilities.	Completed	Minto Mine, Physical Monitoring Plan

This updated Groundwater Monitoring Plan (GMP) provides details of the current monitoring system and monitoring schedule designed to meet the requirements of the WUL.

### 2 Groundwater-related Monitoring

### 2.1.1 Groundwater Wells

A variety of groundwater wells have been installed at the Minto Mine site over the life of the project for different purposes.

Table 2 summarizes well information. Locations are shown on Figure 1.

### Table 2: Summary of Existing, Planned and Inoperable Groundwater Wells, Minto Mine

Groundwater Well Name	Location	Status
P94-20	Main Water Dam area	Destroyed
Р93-Е	Main Pit area	Destroyed during mining
MW09-01	Main Waste Dump area	Operational
MW09-02	DSTSF Area	Destroyed
MW09-03	Downgradient of Minto North Pit	Operational
MW09-04	Main Pit area	Destroyed
MW11-01A	Downgradient of Main Pit	Buried during Mill Water Pond decommissioning (monitoring function fulfilled by MW12-07)
MW11-02	NE of Ridgetop North Pit	Operational (sometimes frozen)
MW11-03	SE of Ridgetop North Pit	Operational (sometimes frozen)
MW11-04A	S of Ridgetop South Pit	Operational
MW12-DP1	West of Southwest Waste Dump	Operational
MW12-DP2	West of Southwest Waste Dump	Operational
MW12-DP3	West of Southwest Waste Dump	Operational
MW12-DP4	Downgradient of MVF/DSTSF	Destroyed
MW13-DP5	Downgradient of MVF/DSTSF	Destroyed
MW12-05	Downgradient of WSP and all mine activities	Operational
MW12-06	Downgradient of MVF/DSTSF	Operational
MW12-07	Downgradient of Main Pit	Operational
MW17-08	Up-gradient of Southwest Waste Dump and all other mine activities	Operational
MW17-09	Down-gradient of Southwest Waste Dump	Operational
MW17-10	Down-gradient of Main Waste Dump	Operational
MW17-11	Down-gradient of Minto North Pit	Operational
MW17-12	Down gradient of WSP and all mine activities.	Operational
Unnamed auxiliary well near mill	Mill area	Operational
Unnamed camp water well	Camp area	Operational
08SWC270	Southwest Waste Dump area	Destroyed
08SWC271	Southwest Waste Dump area	Destroyed
08SWC272	Southwest Waste Dump area	Destroyed (Buried by waste rock)
08SWC273	Southwest Waste Dump area	Destroyed
08SWC274	Southwest Waste Dump area	Destroyed
08SWC275	Southwest Waste Dump area	Destroyed
08SWC277	Southwest Waste Dump area	Destroyed
08SWC278	Southwest Waste Dump area	Destroyed
08SWC280	Southwest Waste Dump area	Destroyed (Buried by waste rock)
MW17-DP01	Main Pit water levels	Operational

MW17-DP02	Main Pit water levels	Operational
MW17-DP03	Main Pit water levels	Operational with water level datalogger

### 2.1.2 Vibrating Wire Piezometers

Vibrating wire piezometers have been installed during geotechnical investigations at the Minto Mine, as referenced in the Physical Monitoring Plan (see reference list). The Physical Monitoring Plan should be referred to for the current list of instrumentation. The piezometric data are used to augment the understanding of the phreatic surface across the mine site.

These instruments provide measurements of both piezometric pressure and temperature, the latter used to increase the accuracy of the calculated pressure measurements, when temperatures are above 0°C. The instruments will also continue to provide temperature data when temperatures are below 0°C and the transducer is frozen.

**Error! Reference source not found.** provides summary information about the existing vibrating wire piezometers.

Vibrating Wire Piezometer Name	Location	Status
DSP-1	DSTSF area	Operational
DSP-2	DSTSF area	Operational
DSP-3	DSTSF area	Operational
DSP-4	DSTSF area	Operational
15-DSP-7	DSTSF area	To be installed
15-DSP-8	DSTSF area	To be installed
15-DSP-9	DSTSF area	To be installed
15-DSP-10	DSTSF area	To be installed
SDP-1	Southwest Dump area	Destroyed
SDP-2	Southwest Dump area	Operational
SDP-3	Southwest Dump area	Operational
SDP-4	Southwest Dump area	Operational

Table 3: Summary of Existing	. Planned and Inoperable	Vibrating Wire Piezometers	. Minto Mine
	, i lainica ana inoperable		,

Note: installations at the Main Water Dam are excluded from this table

The previous groundwater monitoring plan (2016-02) indicated that additional VWP strings would be installed in the Main Pit and Area 2 Pit to provide pore pressure and thermal data as the pits are backfilled with tailings, to fulfill condition 91 (Table 1). Drivepoint piezometers were installed instead of VWPs. Three drivepoint installations were completed into beach tailings of the Main Pit and are included with other drivepoints in

Table 2 (previous page). Tailings in the Area 2 pit were fully submerged so no drivepoints were completed there; pit water levels are surveyed.

### 2.1.3 Ground Temperature Monitoring

Several thermistor strings (ground temperature cables) have been installed during geotechnical investigations at Minto Mine. These instruments provide measurements of temperature at various depths below ground at each location, but do not provide any piezometric data. However, the thermal data is an important aspect of the hydrogeological assessment of the site as it provides a better understanding of permafrost distribution, so is an integral part of the hydrogeological modelling program.

Table 4 provides summary information about the existing thermistor cables. As with the VWP installation, the Physical Monitoring Plan will document any updates to this list of instrumentation.

Ground Temperature Cable Name	Location	Status
DST-1	DSTSF area	Destroyed
DST-2	DSTSF area	Destroyed
DST-3	DSTSF area	Operational
DST-4	DSTSF area	Operational
DST-5	DSTSF area	Destroyed
DST-6	DSTSF area	Operational
DST-7	DSTSF area	Destroyed
DST-8	DSTSF area	Destroyed
DST-9	DSTSF area	Destroyed
DST-12	DSTSF area	Operational
96-G08	DSTSF area	Destroyed
MWPT-1	Mill Water Pond area	Destroyed
MWPT-2	Mill Water Pond area	Destroyed
SDT-1	Southwest Dump area	Operational
SDT-2	Southwest Dump area	Operational
SDT-3	Southwest Dump area	Operational
SDT-4	Southwest Dump area	Operational
08SWC271	Southwest Dump area	Destroyed
08SWC274	Southwest Dump area	Destroyed
08SWC275	Southwest Dump area	Destroyed
08SWC277	Southwest Dump area	Destroyed
08SWC278	Southwest Dump area	Destroyed
08SWC280	Southwest Dump area	Buried under Southwest Dump

#### Table 4: Summary of Existing Ground Temperature Cables, Minto Mine

Note: installations at the Water Storage Dam are excluded from this table

### 2.1.4 Waste Rock Pile Lysimeters

Four lysimeters were installed within waste rock piles in 2017. Lysimeters will be monitored as part of the Groundwater Monitoring Plan. Table 5 lists locations and monitoring frequencies. Installation details are available in *Lysimeter Installation Report, Minto Mine (SRK, 2018b)* 

Location	Status	Instrument Type	Location	Monitoring Frequency	Download Frequency
Lys17-01	Active	Lysimeter, Ground Temperature Probe	Main Waste Dump	Every 6 hours	Monthly
Lys17-02	Active	Lysimeter	Southwest Dump	Every 6 hours	Monthly
Lys17-03	Not installed	n/a	Main Pit Dump	n/a	n/a
Lys17-04	Active	Lysimeter, Ground Temperature Probe	Mill Valley Fill Extension	Every 6 hours	Monthly
Lys17-05	Active	Lysimeter, Ground Temperature Probe	Dry Stack Tailings Storage Facility	Every 6 hours	Monthly

Table 5.1	simotor	Installations	and Mo	nitoring	Frequency
Table 5. Ly	simeter	Instanations	anu wo	nitoring	rrequency

### 3 Groundwater Monitoring Plan

### 3.1 Monitoring Objectives

As stipulated in the WUL, this groundwater monitoring plan is to provide for monitoring up-gradient and down-gradient of all mine activities.

### 3.2 Monitoring Requirements

Table 6 summarizes the operational monitoring requirements. It should be noted that monitoring points (i.e., zones in the Westbay wells separated by packers) were selected based on logging observations.

Core logging included:

- \* Photograph of the run;
- \* Total core recovery;
- \* Rock quality designation;
- \* Identification of major structures;
- \* Identification and characterisation of joint conditions;
- \* Microdefect intensity;
- \* Alteration, if present; and
- \* Estimated intact rock strength.

Once the logging was completed for each drill hole, Westbay MP well designs were drafted and completed to target specific ground conditions. If a major structure was encountered, a zone was placed around it. Otherwise, the zones were designed to isolate particular lithological targets (either overburden, weathered bedrock or fresh bedrock) where ground conditions permitted. Since it was not possible to identify precise locations of preferential flow (e.g. a specific fracture), longer zone intervals were used to capture as much groundwater as possible within a specified lithological target.

Every Westbay zone includes a measurement port, but certain Westbay monitoring zones also include a "pumping port" that allows for water to be removed from the zone at higher rates than from a standard measurement port. Each of the zones with pumping ports was developed until field parameters stabilized and these zones are now used for on-going monitoring.

### 3.3 Sampling Protocol

Groundwater samples will be collected according to the procedures summarized in ASTM D4448-01- Standard Guide for Sampling Ground-Water Monitoring Wells (ASTM 2007).

### 3.4 Sampling Frequency

Table 6 lists sampling frequency for each monitoring zone. SRK has recommends seasonal monitoring as sufficient unless otherwise directed as part of the Adaptive Management Plan. This frequency rate should provide appropriate coverage for any fluctuations due to seasonal changes in infiltration/recharge to the groundwater system and potential lag times between recharge source areas and monitoring wells.

### 3.5 Water Level Monitoring

Water level monitoring is included in Table 6.

Table 6: Operational Groundwater Mo	Ionitoring Requirements
-------------------------------------	-------------------------

Mine Project Component	Monitoring Well ID	Westbay Zone Depth or description	Quality	Level	Rationale
Up-gradient	MW17-08	Zone 1 (44.7 mbgs)	В	В	Background well; higher frequency not warranted
of Mine		Zone 2 (34.1 mbgs)	В	В	Background well; higher frequency not warranted
Activities		Zone 3 (23.4 mbgs)	В	В	Background well; higher frequency not warranted
		Zone 4 (8.2 mbgs)	В	В	Background well; higher frequency not warranted
Southwest	MW12-DP1	NA	Stop mo		Dry or frozen - little record
Waste Dump	MW12-DP2	NA	Stop mo	nitoring	Dry or frozen - little record
	MW12-DP3	NA	Stop mo	nitoring	Dry or frozen - little record
	MW17-09	Zone 1 (57.2 mbgs)	S	S	Seasonal variability sufficient
Main Waste	MW09-01	Zone 1 (44 mbgs)	Stop mo	-	Repeatedly dry; replaced by MW17-10
Dump		Zone 2 (34 mbgs)	Stop mo	-	Repeatedly dry; replaced by MW17-10
		Zone 3 (26 mbgs)	Stop mo	nitoring	Repeatedly dry; replaced by MW17-10
	MW17-10	Zone 1 (85.5 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (75 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (61 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (53.5 mbgs)	A	S	Likely to be dry often – freshet monitoring only
Dry Stack	MW12-06	Zone 1 (142 mbgs)	S	S	Seasonal variability sufficient
Tailings		Zone 2 (123 mbgs)	S	S	Seasonal variability sufficient
Storage		Zone 3 (93 mbgs)		S	Currently not sampled with no immediate need to
Facility and					change
Mill Valley Fill		Zone 4 (66 mbgs)	S	S	Seasonal variability sufficient
Expansion		Zone 5 (35 mbgs)		S	Currently not sampled with no immediate need to
					change
		Zone 6 (18 mbgs)	S	S	Seasonal variability sufficient
Main Pit	MW12-07	Zone 1 (115 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (88 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (66 mbgs)		S	Currently not sampled with no immediate need to change
Minto North	MW09-03	Zone 1 (38 mbgs)	S	S	Seasonal variability sufficient
Pit		Zone 2 (24 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (11 mbgs)		S	Currently not sampled with no immediate need to change
	MW17-11	Zone 1 (96.9 mbgs)	S	S	Seasonal variability sufficient
		Zone 2 (75.5 mbgs)		S	Currently not sampled with no immediate need to change
		Zone 3 (58.8 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (40.5 mbgs)	S	S	Seasonal variability sufficient
		Zone 5 (16.1 mbgs)		S	Dry
Water Storage	MW12-05	Zone 1 (132 mbgs)	S	S	Seasonal variability sufficient
Pond		Zone 2 (110 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (94 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (69 mbgs)	S	S	Seasonal variability sufficient
		Zone 5 (52 mbgs)	S	S	Seasonal variability sufficient
		Zone 6 (26 mbgs)		S	Currently not sampled with no immediate need to change
		Zone 7 (15 mbgs)	S	S	Seasonal variability sufficient

Mine Project Component	Monitoring Well ID	Westbay Zone Depth or description	Quality	Level	Rationale
Water Storage	MW17-12	Zone 1 (143.4 mbgs)	S	S	Seasonal variability sufficient
pond		Zone 2 (129.6 mbgs)	S	S	Seasonal variability sufficient
		Zone 3 (111.4 mbgs)	S	S	Seasonal variability sufficient
		Zone 4 (91.5 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 5 (80.9 mbgs)	S	S	Seasonal variability sufficient
		Zone 6 (70.2 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 7 (50.4 mbgs)	S	S	Review after one year and decrease frequency if stable
		Zone 8 (35.2 mbgs)	S	S	Seasonal variability sufficient

### Abbreviations

A	Annual
В	Bi-annual (Freshet, Sept/Oct)
S	Seasonal (Freshet, Sept/Oct, Feb/Mar)

### 3.6 Analytical Suite for Groundwater Samples

Groundwater samples will be collected and analyzed for the parameters described below. These analytical suites are defined as follows:

- Physical Parameters, Conductivity, Total Dissolved Solids, Alkalinity, Sulphate, ICP Scan Dissolved Metals.
- Nutrients: Ammonia-N, Nitrate-N, Nitrite-N and Phosphorous.
- In-situ Field Parameters: pH, Conductivity and Temperature.

Groundwater samples will be submitted to an accredited laboratory for analysis.

### 3.7 Quality Control and Quality Assurance

Quality control samples will be collected and analyzed to verify the integrity of groundwater samples. Quality control samples for the Groundwater Monitoring Program will represent 10% of the total number of samples collected and may include trip blanks, field blanks, duplicates or field splits. Quality assurance is achieved in the Groundwater Monitoring Program through regular review of groundwater data. Additionally, in support of the Groundwater Monitoring Program a standard operating protocol (SOP) for groundwater monitoring is utilized to conduct the groundwater monitoring. The SOP ensures consistency with groundwater monitoring techniques and is updated on an as required basis should modifications be necessary.

### 3.8 Reporting

Results of the groundwater monitoring program will be included as part of the routine reporting for the WUL.

### 4 Environmental Tracer Study

Results of the environmental tracer study are discussed in SRK 2018a. Extension of the environmental tracer study is being considered and discussed with Yukon Government. On-going work will be reported as a study outside of the Groundwater Monitoring Plan.

### 5 References

Water Use License QZ14-013. Yukon Water Board. August 5, 2015.

- Minto Explorations Ltd. 2014. Capstone Minto Mine Physical Monitoring Plan. Date accessed: November 2015.
- SRK. 2013. 2012 Minto Mine Groundwater Monitoring Well Installation Report. Prepared for Minto Explorations Ltd. February, 2013.

SRK. 2017. 2017 Monitoring Well Installation Report. Prepared for Minto Explorations Ltd. November 2017.

SRK. 2018a. Minto Groundwater Characterization and Hydrogeologic Conceptual Model Update Report. Prepared for Minto Explorations Ltd. January 2018.

SRK. 2018b. Lysimeter Installation Report, Minto Mine. Prepared for Minto Explorations Ltd. February 2018.

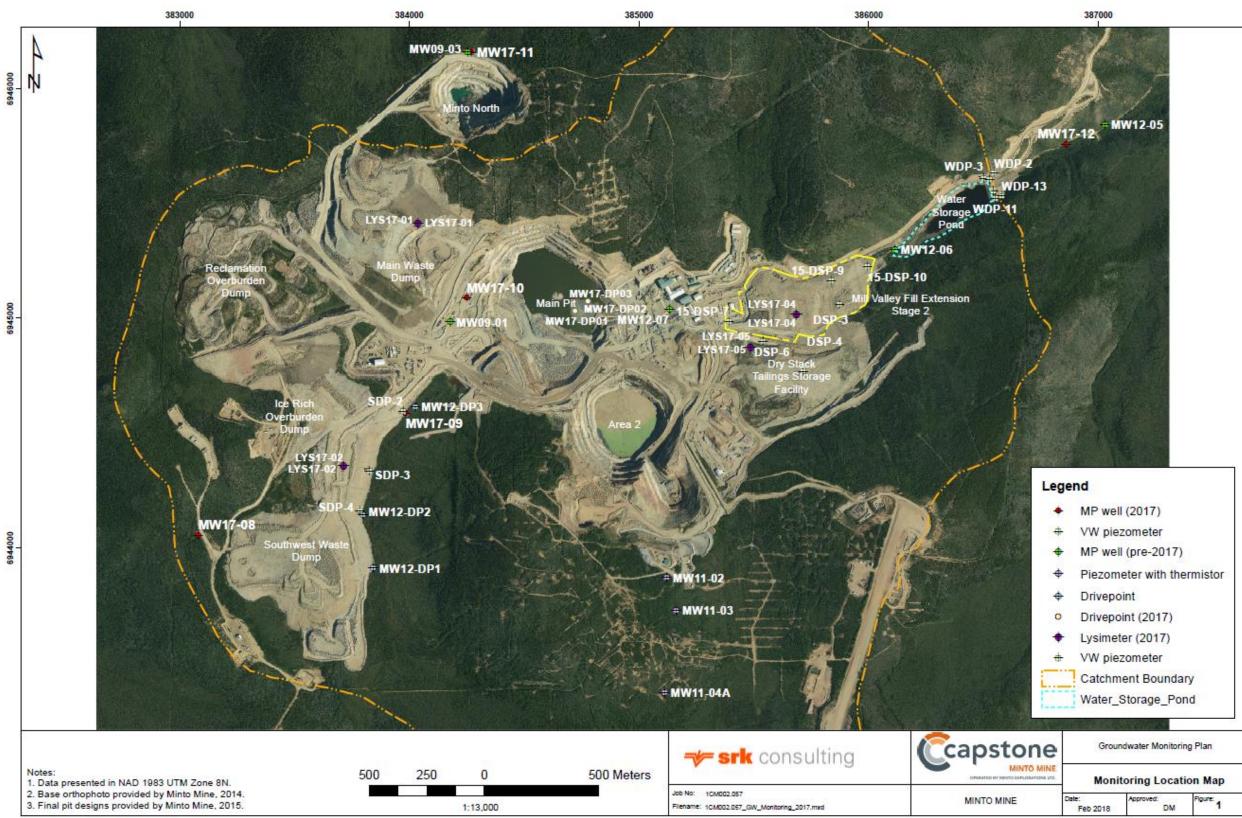


Figure 1: Monitoring Well Locations

	Approved:	Figure:	100
018	DM	1	1440

# Appendix 4: Minto Mine Physical Monitoring Plan



# Revision 2017-1 Physical Monitoring Plan Minto Mine, YT

Prepared by: Minto Explorations Ltd. Minto Mine December 2017

# Minto Mine Physical Monitoring Plan

### First Issue: June 2014

### **REVISION INFORMATION**

Rev. Number	Issue Date	Description & Revisions Made
-	June, 2014	First issue
2015-1	November, 2015	Annual update of existing instrumentation and monitoring frequencies. Instruments Added: A215, A216, A217, A218, A2RAMP01, A2RAMP02, A2RAMP03, A2RAMP04, DSSH-26, DSSH-27, M82, M83, M84, M85, M86, M87, SWD06 Instruments Removed: DSI-14, DSI-21, DSSH-21, DSSH-22, DSSH-23, DSSH-25, WSP2
2016-1	December, 2016	Annual update of existing instrumentation and monitoring frequencies. Instruments Added: DSP-07, DSP-08, DSP-10, DSI-22, DSI-23, DSSH-28, DSSH-29, DSSH-30, DSSH-31, MV1, MV2, SWD-07, SWD-08, SWD-09 Instruments Replaced: DSSH-06, DSSH-10, DSSH-15, DSSH-18, DSSH-19, DSSH-20 Instruments Removed: A2RAMP01, A2RAMP02, A2RAMP03, A2RAMP04, SWD-02, SWD-02A, SWD-04A, SWD-05A, DSP-09
2017-1	November, 2017	Annual update of existing instrumentation and monitoring frequencies. Instruments Added: DSI-24, DSSH-32, M88, M89, M91, M92, M93, M94, SWD10, SWD11 Instruments Replaced: DSSH-17, DSSH-27, M82, M76, M86 Instruments Removed: DSI-23, DSSH-20, DSSH-29, M73, M75, M87

Updated by:

Dale Heffernan, EIT

Geotechnical Engineer-in-Training

Reviewed by:

Kevin Cymbalisty, P.Eng.

Mine Manager

# **Table of Contents**

1	Introduction	1
2	Mine Structures	2
3	Design and Monitoring References	5
4	Roles and Responsbilities	10
5	Inspections	11
6	Instrumentation	14
	Inclinometers	14
	Survey Hubs	15
	Thermistors	17
	Vibrating Wire Piezometers	18
7	Instrumentation Procedures and Documentation	19
8	Quality Assurance/Quality Control	20
9	Reporting	20

## List of Tables

Table 1: Description of Mine Structures at Minto	2
Table 2: Design Documents and Monitoring/Inspection Guidance Documents	5
Table 3: Roles and Responsibilities	10
Table 4: Inspections	11
Table 5: Inclinometers	14
Table 6: Survey Hubs	15
Table 7: Thermistors	17
Table 8: Vibrating Wire Piezometers	18
Table 9: Reporting	20

## **List of Appendices**

Appendix A: Instrumentation Map Appendix B: Data Collection and Input Manuals

## 1 Introduction

The following document describes the instrumentation and monitoring program currently in place at Minto to monitor the stability of mining structures including waste rock, tailings, and water storage facilities. The program consists of two main components: instrumentation to measure ground conditions and deformation, and regular geotechnical inspections. The following sections summarize inspection and data collection frequencies, instrument installation details and locations, and data collection procedures.

Mining and monitoring activities at Minto included in this plan are licensed under the following:

- Type A Water Licence QZ14-031, August, 2015
- Type B Water Licence MS15-094, July 2016
- Quartz Mining Licence QML-0001, December, 2014

Existing mine structures at Minto are shown in Figure 1-1, and described in the following section.



Figure 1-1: Minto site plan (August 2017)

# 2 Mine Structures

Mine structures currently being monitored at Minto as well as future structures included in the Phase V/VI plan are listed in Table 1.

Structure	Description	Instrumentation
Area 2 Pit and Area 2 Pit Tailings Management Facility (A2PTMF)	The Area 2 Pit was completed in 2015 to the extents licensed under Phase IV (Stages 1 and 2); the pit was extended to the south as part of Phase V/VI (Stage 3 and Stage 3 Expansion), scheduled to be complete in 2018. Tailings deposition into Area 2 Stage 2 pit (A2S2) began in March, 2015 and the pit is now maintained as a tailings management facility. Dumping of NP:AP<3 waste rock (SAT), intended to be below the final water	<ul> <li>Survey hubs</li> <li>GroundProbe radar (during active mining)</li> </ul>
Area 2 Underground	table at closure, has commenced into the pit. The Area 2 underground began development in 2016 and is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production mining is currently taking place using a longhole stoping method and is expected to be completed in 2018.	None
Area 118 Pit	Mining of the Area 118 Pit was carried out in 2014. As part of Area 2 Stage 3 pit mining, overburden is being dispatched to the Area 118 pit, referred to as the Area 118 Backfill Dump.	Survey hubs
Area 118 Backfill Dump	The Area 118 Backfill Dump is included in the Phase V/VI licence and commenced in 2017. Construction will continue for the duration of the Area 2 Stage 3 Pit. The dump will fill in the Area 118 Pit.	None
Area 118 Underground	The Area 118 underground began development in 2013 and was completed in 2016. It is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production mining took place using a longhole stoping method.	None
Big Creek Bridge	Bridge on the Minto access road crossing Big Creek, located at Km 19. Licenced under Type B water licence MS15-094.	None
Barge Landings	Barge landings on the Minto access road at the Yukon river. Licensed under Type B water license MS15-094.	None
Camp	The camp consists of several connected bunkhouse buildings (Sherwood, Minto, Selkirk), a kitchen building, and several separate buildings including the gym and Site Services offices.	None
Copper Keel and Wildfire Underground	The Copper Keel and Wildfire underground are in the phase V/VI mining plan and have not commenced yet.	N/A
Dry Stack Tailings Storage Facility (DSTSF)	Construction of the DSTSF with filtered tailings placement was carried out from 2007 to November 2011. As part of progressive reclamation activities in 2012-2013, the DSTSF was covered with a layer of overburden approximately one to four meters thick. The DSTSF began showing deformation in 2009, interpreted as primarily horizontal sliding towards the north/northeast on an ice-rich layer in the underlying overburden, several meters above bedrock. The movement has continued since then but at a decreasing rate in response to construction of both the Mill Valley Fill waste rock buttress and the Mill Valley Fill Extension 2 waste rock buttress.	<ul> <li>Survey hubs</li> <li>Thermistors</li> <li>Inclinometers</li> <li>Piezometers</li> </ul>

Structure	Description	Instrumentation
Ice Rich Overburden Dump (IROD)	Originally constructed as a free-standing rockfill structure to contain ice-rich overburden. The IROD is no longer active and is now entirely surrounded by the Southwest Waste Dump rockfill. The area has been reclaimed with the Southwest Waste Dump in 2017.	None
Main Pit (Area 1 Pit) and Main Pit Tailings Management Facility (MPTMF)	<ul> <li>Mining in the Main Pit was completed in 2011. Instability in the south wall of the pit occurred in 2009 during mining of Stage 3 of the pit, and subsequently a larger failure occurred in 2011 after completion of Stage 5. Continued sloughing and creep movement of the south wall led to the design and construction of a waste rock buttress, known as the South Wall Buttress, completed in 2013.</li> <li>Slurry tailings deposition into the pit began in 2012 and the pit is now maintained as a tailings management facility.</li> <li>Dumping of NP:AP&lt;3 waste rock (SAT) below the final water table at closure, is not currently active but remains an alternate dispatch location to the Area 2 Pit Tailings Management Facility.</li> </ul>	<ul><li>Survey hubs</li><li>Inclinometer</li></ul>
Main Pit Dump	The Main Pit Dump is included in the Phase V/VI licence. Construction commenced in 2017. The dump is located on the southwest side of the Main Pit.	• Survey hubs
Main Waste Dump (MWD)	The Main Waste Dump stores waste rock released during the mining of the first three stages of the Main Pit. The dump is no longer active.	Inclinometer
Main Waste Dump Expansion (MWDE)	This dump is an extension of the MWD that stores waste rock released from the Minto North Pit. The dump is no longer active. Reclamation re-sloping began in 2016.	None
Main Waste Dump Wrap (MWDW)	This dump is a reclamation feature to shallow the slopes of the Main Waste Dump for reclamation purposes.	None
Mill Site	The mill site consists of the mill building, crusher and crusher stockpile pad.	None
Mill Valley Fill Extension (MFVE)	A waste rock buttress to the north of the DSTSF, constructed from January 2012 to March 2013 to prevent or decrease movement of the DSTSF.	Survey hubs
Mill Valley Fill Extension 2 (MVFE2)	An extension of the MVFE waste rock buttress to the northeast, constructed from November 2015 to August 2016 to further decrease movement of the DSTSF.	<ul><li>Piezometers</li><li>Survey hubs</li><li>Inclinometers</li></ul>
Mill Valley Fill Extension 2 Collection Sump	A replacement sump for the Minto Creek Detention Structure (MCDS), constructed in 2016. It detains surface water considered impacted from upstream sub-catchment areas and directs it to the MPTMF or water treatment plant.	None
Minto Access Road	Road from the Yukon River barge crossing to the mine site. Licenced under Type B water licence MS15-094.	None
Minto East Underground	Ramping to the Minto East underground began development in 2017 and is accessed by a portal and decline south of the Area 2 and Area 118 Pits. Production will use a longhole stoping method and is expected to start in 2018.	None

Structure	Description	Instrumentation
Minto North Pit	Mining of the North Pit was completed in September 2016. The pit is currently inactive and the access is barricaded.	None
Ore Stockpiles	There are two primary ore stockpiles on site – North and South stockpile. These are located south of the crusher and east of the Area 2 pit.	None
Reclamation Overburden Dump (ROD)	Received the bulk of the overburden released as part of Phase IV and earlier mining of the Main Pit. The material in the ROD is available for use in reclamation of the mine at closure.	None
Ridgetop Pit (Ridgetop North Pit, Ridgetop South Pit)	The Ridgetop Pits are included in the Phase V/VI licence and has not commenced yet. Mining is planned to start in 2018.	GroundProbe radar (during mining)
Ridgetop Waste Dump	The Ridgetop Waste Dump is included in the Phase V/VI licence and has not commenced yet. Dumping is planned to start in 2018.	N/A
South Diversion Ditch	This structure was decommissioned in 2017 to allow for Area 2 Stage 3 Expansion mining activities.	None
South Wall Buttress (SWB)	Waste rock buttress constructed against the Main Pit south wall from 2009-2011 as a result of instability in the south wall of the pit.	• Survey hubs
Southwest Waste Dump (SWD)	The Southwest Waste Dump (SWD) stores waste rock released during phase IV mining. Dumping at the SWD is now complete and reclamation re-sloping began in 2015. Re-sloping is expected to be completed in 2018.	<ul> <li>Survey hubs</li> <li>Inclinometers</li> <li>Thermistors</li> <li>Piezometers</li> </ul>
Tailings Diversion Ditch (TDD)	A diversion ditch located south of the DSTSF to divert unimpacted water around the tailings facility. The intake structure was extended in 2017 to allow for the decommissioning of the South Diversion Ditch with A2S3 Expansion mining.	None
Water Storage Pond Dam (WSP)	The Water Storage Pond and Dam are located east of the mine along Minto Creek. The dam was constructed in 2006 as a clay-core water retention dam for collecting precipitation and surface water runoff at the site. Maximum depth of water at the face of the dam is approximately 15 m.	<ul><li>Survey hubs</li><li>Thermistors</li><li>Piezometers</li></ul>

## 3 Design and Monitoring References

Table 2 lists the design reports for each structure and the monitoring/inspection guidance reports used to develop the inspection (Section 5) and instrumentation (Section 6) programs for each structure.

Structure	Design Reports	Monitoring/Inspection Guidance Reports
	Prefeasibility Geotechnical Evaluation, Phase IV, Minto Mine. SRK, December 2009.	<i>Operation, Maintenance, and Surveillance Manual -</i> <i>Area 2 Pit Tailings Management Facility</i> Revision 2015- 2. Minto, December 2015.
Aug 2 211 1	<i>Review of Minto Area 2 West Wall Stability</i> . SRK, September 11, 2012.	Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Area 2 Pit and Area 2 Pit Tailings Management	Review of Minto Area 2 West Wall Stability-April 2013. SRK, April 18, 2013.	nevision 2010 01. Winko, Widy, 2010.
Facility (A2PTMF)	Review of Minto Area 2 West Wall Stability-September 2013. SRK, September 30, 2013.	
	Main Dam – Area 2 Pit Stability Assessment. SRK Consulting Project: 1CM002.003.0701, February, 2015.	
Area 2 Stage 3 Pit	Pit Slope Stability Evaluation, Minto Mine, Area 2 Pit – Stage 3. SRK Consulting Project: 219500.190, August 2015.	Minto Mine Ground Control Plan – Open Pit Operations. Minto, 2016.
and Area 2 Stage 3 Expansion	Geotechnical Review of Saddle Between Area 2 Stage 2 and Area 2 Stage 4 Open Pits. JDS Energy & Mining Inc., August 24, 2017.	
	Area 2 Mining Stability Assessment Summary. Golder Associates, June, 2016.	Minto Mine Ground Control Plan – Underground Operations. Minto, 2016.
Area 2	<i>Area 2 Mining Stability Assessment Summary.</i> Golder Associates, December, 2016.	Inspection of Physical Stability of Underground Workings at Minto Mine, Yukon. Golder Associates, August 2017.
Underground		Minto Mine Geotechnical Mapping Program Memo Review. Golder Associates, September 2017.
		Independent Review of Blasting Impacting Between Minto Surface and Underground Operations. Golder Associates, September 2017.
	Prefeasibility Geotechnical Evaluation, Phase IV, Minto Mine. SRK, December 2009.	-
Area 118 Pit	Review of Final Area 118 Pit Design. SRK Consulting, Project: 219500.070. January, 2015.	
Area 118 Backfill Dump	Phase V/IV Ridgetop South and Area 118 Backfill Dumps Physical Stability Assessment. SRK, October 2013.	-

Structure	Design Reports	Monitoring/Inspection Guidance Reports
	Minto 118-Zone – FLAC3D Analysis of the Longhole Base Case Option. Itasca, August 2014.	Minto Mine Ground Control Plan – Underground Operations. Minto, 2016.
	Geotechnical Characterization of Existing and Proposed Longhole Open Stope Mining Areas. Golder Associates File: 1528754-002-R-Rev0-3000. July 30, 2015.	<i>Ground Control Management Plan Review.</i> Golder Associates, File 1528754-007-TM-Rev0-1000. September 2015.
Area 118 Underground	Longhole Open Stope Stability Addendum – Revised Mining Heights. Golder Associates, File 1528754-006- TM-Rev0-3000, November 2015.	
	Area 118 Plunge Mining Stability Assessment Summary. Golder Associates, File: 1528754-008-PP- Rev0-5000, December 2015	
Big Creek Bridge	-	-
Camp	-	-
Dry Stack Tailings Storage Facility	Geotechnical Design Report, Dry Stack Tailings Storage Facility, Minto Mine, Yukon. EBA File: 1200173. January 2007.	<i>Operation, Maintenance, and Surveillance Manual, Dry Stack Tailings Storage Facility, Minto Mine, YT.</i> Revision 2014-1 Minto, November 2014.
(DSTSF)		Minto Mine Operations Adaptive Management Plan. Revision 2016-01. Minto, May, 2016.
Ice Rich	Geotechnical Design Ice-Rich Overburden Dump, Minto Mine, Minto, YT. EBA file: 1200173. January 2006.	Geotechnical Design Ice-Rich Overburden Dump, Minto Mine, Minto, YT. EBA file: 1200173. January 2006. EBA, 2007.
Overburden Dump (IROD)	Ice-Rich Overburden Dump Containment Berm Inspection Report, Minto Mine Site, Minto Yukon. EBA File: 1200173.001. June 19, 2007.	Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Main Pit (Area 1 Pit) and Main Pit	<i>Pit Slope Evaluation for Area 1 Open Pit.</i> SRK Consulting, Project: 2CM022.03, July 2007.	<i>Operation, Maintenance, and Surveillance Manual - Main Pit Tailings Management Facility</i> . Revision 2015-2 Minto, December, 2015.
Tailings Management Facility (MPTMF)	SAT Dump on Tailings. SRK Consulting Project: 1CM002.043, March 2016.	Minto Mine Operations Adaptive Management Plan Revision 2017-01. Minto, January, 2017.
	Phase V/VI Main Pit Dump Physical Stability Assessment. SRK Consulting Project: 1CM002.003.0701, November, 2013.	-
Main Pit Dump	Update to the Main Pit Dump Physical Stability Assessment. SRK Consulting Project: 1CM002.003.0701. February, 2015.	
	Main Pit Dump (Revision 5.6) Stability Analysis. SRK Consulting, Project 1CM002-053, July, 2017.	

Structure	Design Reports	Monitoring/Inspection Guidance Reports
Main Waste Dump (MWD)	Geotechnical Evaluation Proposed Main Waste Dump Minto Mine, Minto, YT. EBA. April, 1998.	Geotechnical Evaluation Proposed Main Waste Dump Minto Mine, Minto, YT. EBA. April, 1998. Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Main Waste Dump Expansion (MWDE)	Minto Mine Phase V/VI Expansion Waste Rock and Overburden Management Plan. Minto. June, 2014. Phase V/VI Main Waste Dump Expansion – Physical Stability Assessment. SRK Consulting Project: 1CM002.012.012, November, 2013	Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Main Waste Dump Wrap (MWDW)	Main Waste Dump Stability Analysis. SRK Consulting Project: 1CM002-049, April, 2017.	-
Mill Site	-	-
Mill Valley Fill Extension (MFVE)	Waste Rock and Overburden Management Plan, Phase IV Development, Minto Mine YT. EBA File: W14101068.015. September 9, 2011. Upstream Water Management for the Mill Valley Fill Expansion and Dry Stack Tailings Storage Facility. EBA File: W14101168.013. September 14, 2011.	Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Mill Valley Fill Extension 2 (MVFE2)	<ul> <li>Mill Valley Fill Extension Stage 2 Preliminary Design Report. SRK Consulting Project: 1CM002.015.</li> <li>March, 2014</li> <li>Minto Mine Phase V/VI Expansion Waste Rock and Overburden Management Plan. Minto. June, 2014.</li> <li>Mill Valley Fill Extension Stage 2 Final Design Report. SRK Consulting Project: 1CM002.040. September, 2015.</li> <li>Mill Valley Fill Extension Stage 2 Record of Construction. Minto. November, 2016.</li> </ul>	<ul> <li>Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.</li> <li>Mill Valley Fill Extension Stage 2 – Expected Performance and Evaluation Criteria. SRK Consulting Project: 1CM002.050, November, 2016.</li> <li>Mill Valley Fill Extension Stage 2 Inclinometer Installations Field Report. SRK Consulting Project: 1CM002.052. June 2017.</li> </ul>
Mill Valley Fill Extension 2 Collection Sump	Design for the MVFE Stage 2 Collection Sump. SRK Consulting Project: 1CM002.020. June, 2015. Mill Valley Fill Extension Stage 2 Colleciton Sump Record of Construction. Minto. April, 2016.	-
Minto Access Road	-	-
Minto East, Copper Keel, Wildfire Underground	Minto Phase VI Underground Geotech Evaluation, SRK Consulting Project: 2UC031.005, February, 2012. Geotechnical Characterization of Existing and Proposed Longhole Open Stope Mining Areas, Golder Associates, Reference No. 1528754-002-R-Rev0-3000, July, 2015. Minto Mine Underground Reserve Update Geotechnical Input, Golder Associates, Reference No. 1528754-003- R-Rev0-3000, July, 2015.	-

Structure	Design Reports	Monitoring/Inspection Guidance Reports
	Minto East – Revised Longhole Open Stope Stability. Golder Associates, File: 1528754-009-TM-Rev0-6000, January, 2016.	
	Wildfire Proposed Underground Mine Area – Geotechnical Characterization and Long Hole Open Stope Stability Assessment. Golder Associates, September, 2016.	
	Minto East Raise Geotechnical Investigation and Hydrogeological Testing Program Study. Golder Associates, October, 2017.	
	Minto Phase VI Preliminary Feasibility Study Technical Report. SRK, January 2012.	Minto Open Pit Ground Control Plan_Rev0. Minto, 2016.
	Review of Minto North Wall Stability. SRK, May, 2016.	
Minto North Pit	Site Visit and Review of North Pit – South Wall. BGC Engineering, July, 2016.	
	Minto North South Wall Wedge Analysis. SRK, August, 2016.	
Ore Stockpiles	-	-
Reclamation	Geotechnical Design Proposed Reclamation Overburden Dump, Minto Mine, Yukon. EBA File: W14101068.004. February 2008.	Reclamation Overburden Dump Expansion Geotechnical Design Report. EBA File: W14101068.0040. June 29, 2010.
Overburden Dump (ROD)	Reclamation Overburden Dump Expansion Geotechnical Design Report. EBA File: W14101068.0040. June 29, 2010.	Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Ridgetop Pit	<i>Pre-Feasibility Geotechnical Evaluation Phase IV Minto Mine,</i> SRK Consulting Project: 2CM022.006, December, 2009.	-
(Ridgetop North Pit, Ridgetop South Pit)	Ridgetop North Pit TMF Stability Assessment, SRK Consulting Project: 1CM002.003.710, February, 2015.	
Ridgetop Waste Dump	Phase V/VI Ridgetop Waste Dump Physical Stability Assessment. SRK Consulting Project: 1CM002.012.0.12, November, 2013.	-
South Diversion Ditch (SDD)	Phase 1 – Preliminary Engineering, Stormwater Diversion Ditches Minto Mine, YT, EBA File: W14101068.013	-
South Wall Buttress	Area 1 South Wall Buttress Design Report, Minto Mine, Yukon. EBA File: W141010668.012, July 2011.	-

Structure	Design Reports	Monitoring/Inspection Guidance Reports
Southwest Waste Dump (SWD)	Geotechnical Design Proposed Southwest Waste Dump, Minto Mine, Yukon. EBA File: W14101068.005. September 2008.	Geotechnical Design Proposed Southwest Waste Dump, Minto Mine, Yukon. EBA File: W14101068.005. September 2008. Minto Mine Operations Adaptive Management Plan Revision 2016-01. Minto, May, 2016.
Tailings Diverion Ditch (TDD)	Preliminary Design of the Tailings Diversion Ditch Upgrade, SRK Consulting Project: 1CM002.012.006, November, 2013. Area 2 Stage 3 Pit Expansion – Intake Strucutre and Overflow Spillway – Final Design, SRK Consulting Project: 1CM002.056, May 2017.	-
Water Storage Pond Dam (WSP)	Geotechnical Design Tailings/Water Dam, Minto Project, Yukon. EBA File: 0201-95-11509. Dec. 1995. As-built Construction Report, Water Retention Dam, Minto Mine, Minto, YT. EBA File: 1200173.001. April 2008.	Operation, Maintenance and Surveillance Manual, Water Retention Dam, Minto Mine, Minto, YT. EBA File: W14103414-01. August 2014.

# 4 Roles and Responsbilities

Table 3 lists the roles and responsibilites for physical monitoring on the site.

### Table 3: Roles and Responsibilities

Role	Responsibilities
Mine Technician Assistants	<ul> <li>Collect instrumentation data at specified frequencies</li> <li>Input data into monitoring spreadsheets/databases</li> <li>Internal reporting of monitoring data</li> <li>Maintain equipment</li> </ul>
Geotechnical Engineers/EITs	<ul> <li>QA/QC of data collection</li> <li>Ensure compliance with license requirements</li> <li>Monthly and annual Water Licence reporting</li> <li>Visual inspections at specified frequencies</li> <li>Communicate with consultants as required</li> <li>Review and update Physical Monitoring Plan</li> </ul>
Environmental Officers	<ul> <li>Compile monthly and annual Water Licence reports</li> <li>Visual inspections of water diversion/collection structures</li> </ul>
Chief Engineer	<ul> <li>Review monthly and annual Water Licence reports</li> <li>Ensure compliance with licence requirements</li> </ul>

# 5 Inspections

Table 4 lists the regular, required inspections.

#### **Table 4: Inspections**

Structure	Frequency	Description			
Area 2 Pit and Area 2 Pit Tailings Management Facility (A2PTMF)	Quarterly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as per OMS Manual.			
Area 2 Stage 3 Pit and Area 2 Stage 3 Pit Expansion	Weekly (during active mining)	Weekly visual inspection by Geotechnical Engineer/EIT during active pit mining. Documented in weekly wall inspection report and two-week operating plan documents.			
Area 2 Underground	Quarterly	Visual inspection by Geotechnical Engineer/EIT as per Underground Ground Control Plan.			
Area 118 Pit	N/A	No longer accessible.			
Area 118 Backfill Dump	Minimum every 4 hours during active dumping	Visual inspection by the supervisor or other competent person (typically the Pelly Shifter or Minto Operations Supervisor) as per O.I.C. 2006/178 Clause 15.44.			
Area 118 Underground	N/A	No longer accessible.			
Big Creek Bridge	Annually	Visual inspection by a Professional Engineer as per MS15-094.			
Camp	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.			
Copper Keel, Wildfire Underground	N/A	N/A – structure does not exist yet.			
Dry Stack Tailings Storage Facility (DSTSF)	Monthly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as per OMS Manual.			
Ice Rich Overburden Dump (IROD)	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.			
Main Pit (Area 1 Pit) and Main Pit Tailings Management Facility (MPTMF)	Quarterly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as per OMS Manual.			

Structure	Frequency	Description
Main Pit Dump	Minimum every 4 hours during active dumping	Visual inspection by the supervisor or other competent person (typically the Pelly Shifter or Minto Operations Supervisor) as per O.I.C. 2006/178 Clause 15.44.
Main Waste Dump (MWD)	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Main Waste Dump Expansion (MWDE)	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Main Waste Dump Wrap (MWDW)	Minimum every 4 hours during active dumping	Visual inspection by the supervisor or other competent person (typically the Pelly Shifter or Minto Operations Supervisor) as per O.I.C. 2006/178 Clause 15.44.
Mill Site	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Mill Valley Fill Extension (MFVE)	Monthly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as part of DSTSF monthly inspection.
Mill Valley Fill Extension 2 (MVFE2)	Monthly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as part of DSTSF monthly inspection.
Mill Valley Fill Extension 2 Collection Sump	Monthly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as part of DSTSF monthly inspection.
Minto Access Road	Annually	Visual inspection by a Professional Engineer as per MS15-094.
Minto East Underground	Quarterly	Structure does not exist yet. Once development commences, a visual inspection by Geotechnical Engineer/EIT as per Underground Ground Control Plan.
Minto North Pit	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Ore Stockpiles	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Reclamation Overburden Dump (ROD)	Semi-Annually – May/June post thaw, and	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.

Structure	Frequency	Description
	September pre freeze-up	
Ridgetop Pit (Ridgetop North Pit, Ridgetop South Pit)	Weekly (during active mining)	Weekly visual inspection by Geotechnical Engineer/EIT during active pit mining. Documented in weekly wall inspection report and two-week operating plan documents.
Ridgetop Waste Dump	Minimum every 4 hours during active dumping	Visual inspection by the supervisor or other competent person (typically the Pelly Shifter or Minto Operations Supervisor) as per O.I.C. 2006/178 Clause 15.44.
South Wall Buttress (SWB)	Quarterly	Visual inspection by Geotechnical Engineer/EIT and review of monitoring data as part of the MPTMF quarterly inspection.
Southwest Waste Dump (SWD)	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Tailings Diversion Ditch (TDD)	Semi-Annually – May/June post thaw, and September pre freeze-up	Included in site-wide geotechnical inspection - Inspection and data review by Professional Engineer as per QZ14-031 (Clause 100) and QML-0001 (Clause 13.2). Q2 inspection must be completed by an independent engineer by June 30 each year.
Water Storage Pond Dam (WSP)	Monthly	Visual inspection by Geotechnical Engineer/EIT as per OMS Manual.

## 6 Instrumentation

A map of site wide active instrumentation is shown in Appendix A. Installation information and data collection schedules are contained in the following sections. Instruments with a strikethrough shown were destroyed in 2017 or are no longer operational.

### Inclinometers

Inclinometers are used to measure lateral, differential ground movement in a borehole. Inclinometer stations consist of grouted, slotted PVC pipe into which the inclinometer probe is lowered and deflection is measured at 0.5m intervals. The current probe used on site is an RST digital MEMS inclinometer system.

Area	ID	Northing (m)	Easting (m)	Elevation (m)	A0 Azimuth	Hole Depth (m)	Date Installed	Reading Frequency
Area 2 Pit	A2I-1	6944164.73	385298.95	822.46	302	55.5	2013-04- 26	Quarterly
Dry Stack Tailings Storage Facility and Mill Valley Fill Extension 2	DSI-22	6945229	386043.4	723.471	034	14	2016-12- 12	Bi-weekly
<del>Dry Stack Tailings</del> <del>Storage Facility and Mill Valley Fill Extension 2</del>	<del>DSI-23</del>	<del>6945119</del>	<del>385886.8</del>	<del>765.679</del>	<del>070</del>	<del>49</del>	<del>2016-12-</del> <del>17</del>	NA
Dry Stack Tailings Storage Facility and Mill Valley Fill Extension 2	DSI-24	6944971	385951.4	774.416	005	108	2017-02- 01	Bi-weekly
Main Pit (Area 1 Pit) and Main Pit Tailings Management Facility (MPTMF)	MDI -2	6945013.08	384217.20	858.67	93	50.5	2010-02- 10	Quarterly
Southwest Waste Dump	SDI-3	6944591.11	383966.00	847.42	90	46.5	2010-02- 11	Quarterly

#### Table 5: Inclinometers

### **Survey Hubs**

Survey hubs are used to monitor surface movement of structures and are comprised of steel posts cemented into waste rock or bedrock and equipped with a threaded base to which a high precision RTK-corrected GPS instrument is attached. The GPS currently used on site is a Trimble R8.

#### Table 6: Survey Hubs

Area	ID	Northing (m)	Easting (m)	Elevation (m)	Date Installed	Frequency
Area 2 Pit	A210	6944268.42	384934.69	861.28	2011-07-01	Monthly
Area 2 Pit	A215	6944649.45	385155.49	808.72	2015-09-17	Monthly
Area 2 Pit	A216	6944749.21	385046.39	805.78	2015-09-17	Monthly
Area 2 Pit	A217	6944756.78	384852.52	806.68	2015-09-17	Monthly
Area 2 Pit	A218	6944707.23	384783.21	806.83	2015-09-17	Monthly
Area 2 Pit	A219	6944081.774	385158.519	846.042	2017-09-15	Monthly
Dry Stack Tailings Storage Facility	ASH05	6944280.52	385830.65	850.16	2011-03-07	Monthly
Dry Stack Tailings Storage Facility	ASH06	6944331.73	385623.79	824.17	2011-03-07	Monthly
Dry Stack Tailings Storage Facility	DSSH-24	6944757.90	385712.10	792.07	2014-02-28	Weekly
Dry Stack Tailings Storage Facility	DSSH-26	6944601.28	385490.96	796.35	2015-07-28	Weekly
Dry Stack Tailings Storage Facility	DSSH-27	6944757.178	385883.856	792.366	2017-06-25	Weekly
Dry Stack Tailings Storage Facility	DSSH-06	6944971.372	385553.396	783.866	2016-08-21	Weekly
Dry Stack Tailings Storage Facility	DSSH-10	6944992.584	385806.037	769.004	2016-08-21	Weekly
Dry Stack Tailings Storage Facility	DSSH-12	6944947.303	385707.165	778.364	2016-08-16	Weekly
Dry Stack Tailings Storage Facility	DSSH-14	6944920.27	385606.55	782.88	2012-04-21	Weekly
Dry Stack Tailings Storage Facility	DSSH-15	6944944.092	385490.104	784.82	2016-08-16	Weekly
Dry Stack Tailings Storage Facility	DSSH-18	6945070.727	385513.039	782.379	2016-08-16	Weekly
Dry Stack Tailings Storage Facility	DSSH-19	6945109.679	385575.406	781.303	2016-08-16	Weekly
Dry Stack Tailings Storage Facility	<del>DSSH 20</del>	<del>6945072.083</del>	<del>385754.334</del>	<del>775.779</del>	<del>2016 08 21</del>	Weekly
Dry Stack Tailings Storage Facility	DSSH-28	6945045.016	385930.244	768.015	2017-06-25	Weekly
Dry Stack Tailings Storage Facility	DSSH-29	<del>6945162.176</del>	385833.535	<del>766.045</del>	<del>2016-08-21</del>	Weekly
Dry Stack Tailings Storage Facility	DSSH-30	6944883.247	385890.044	789.008	2016-08-21	Weekly
Dry Stack Tailings Storage Facility	DSSH-31	6945030.732	386040.736	776.254	2016-11-01	Weekly
Dry Stack Tailings Storage Facility	DSSH-32	6944984.803	385895.604	772.638	2017-09-10	Weekly
Dry Stack Tailings Storage Facility	MV1	6945249.731	386021.140	727.554	2016-04-04	Weekly
Dry Stack Tailings Storage Facility	MV2	6945216.537	385979.321	740.349	2016-04-04	Weekly

Area	ID	Northing	Easting (m)	Elevation	Date	Frequency
		(m)		(m)	Installed	
South Wall Buttress	M76	6944609.57	384538.801	836.161	2011-05-23	Monthly
South Wall Buttress	M79	6944846.97	384208.90	847.66	2011-09-04	Monthly
South Wall Buttress	M80	6944931.70	384256.33	842.06	2011-09-04	Monthly
Main Pit	M81	6944971.63	384890.13	806.83	2012-05-08	Monthly
South Wall Buttress	M82	6944891	384526.4	807.338	2017-04-05	Bi-weekly
South Wall Buttress	M83	6944947.98	384475.79	809.06	2015-01-08	Bi-weekly
South Wall Buttress	M84	6945021.46	384445.11	807.37	2015-01-08	Bi-weekly
South Wall Buttress	M85	6944846.60	384315.66	826.08	2015-07-27	Monthly
South Wall Buttress	M86	6944636	384408.4	838.959	2017-09-12	Monthly
South Wall Buttress	M88	6944873.313	384376.559	837.776	2017-09-04	Monthly
South Wall Buttress	M89	6944688.487	384284.45	843.026	2017-09-04	Monthly
South Wall Buttress	M91	6944830.118	384397.843	849.617	2017-09-04	Monthly
South Wall Buttress	M92	6944785.25	384707.139	800.568	2017-09-14	Monthly
South Wall Buttress	M93	6944779.161	384620.593	801.16	2017-09-14	Monthly
South Wall Buttress	M94	6944827.05	384583.178	800.551	2017-09-14	Monthly
Southwest Waste Dump	SWD01	6944760.85	384077.86	859.07	2011-03-07	Monthly
Southwest Waste Dump	SWD05A	6943939.94	383837.70	869.16	2011-03-07	Monthly
Southwest Waste Dump	SWD06	6944762.06	384189.37	836.42	2015-07-27	Monthly
Southwest Waste Dump	SWD07	6944743.49	384111.649	840.00	2016-11-21	Monthly
Southwest Waste Dump	SWD08	6944560.14	383883.182	867.25	2016-11-21	Monthly
Southwest Waste Dump	SWD09	6944163.106	383790.749	861.532	2016-11-21	Monthly
Southwest Waste Dump	SWD10	6943943.374	383838.099	868.236	2017-07-10	Monthly
Southwest Waste Dump	SWD11	6944511.715	383916.357	849.792	2017-07-10	Monthly
Water Storage Pond Dam	WSP1	6945613.04	386480.98	723.31	2011-06-09	Monthly
Water Storage Pond Dam	WSP3	6945551.85	386548.62	719.73	2011-06-09	Monthly
Water Storage Pond Dam	WSP4	6945531.56	386555.22	719.93	2011-06-09	Monthly
Water Storage Pond Dam	WSP5	6945504.74	386560.23	721.02	2011-06-09	Monthly

## Thermistors

Thermistor strings are used to measure ground temperature profiles in boreholes, and in particular permafrost conditions at Minto. Thermistor strings consist of multiple temperature sensor nodes distributed along a single multi-conductor cable, installed within or attached to the outside of grouted PVC pipe. EBA and RST thermistor strings have been installed on site. EBA thermistors are read using a basic ohmmeter and RST thermistors are read using a RST TH2016B readout unit.

#### Table 7: Thermistors

Area	ID	Northing (m)	Easting (m)	Elevation (m)	Thermistor String No.	Nodes	Hole Depth (m)	Date Installed	Reading Frequency
Area 2 Pit	A2T-1	6944162.01	385305.61	822.39	3491	16	63.4	2013-04-21	Quarterly
Dry Stack Tailings Storage Facility	DST-10	6944584.06	385489.49	797.13	3492	16	63.4	2013-04-17	Quarterly
Dry Stack Tailings Storage Facility	DST-11	6944899.64	385538.89	787.66	3494	16	86.9	2013-04-05	Quarterly
Dry Stack Tailings Storage Facility	DST-13	6945014.60	386271.29	777.01	3495	16	101.5	2013-04-02	Quarterly
Dry Stack Tailings Storage Facility	DST-14	6944769.09	385713.42	791.47	3497	16	66.5	2013-04-12	Quarterly
Dry Stack Tailings Storage Facility	DST-15	6945033.78	385958.17	764.51	3493	16	64.0	2013-03-25	Quarterly
Water Storage Pond	WDT-1	6945523.08	386550.83	720.03	2072	16	42.49	2007-11-16	Monthly
Water Storage Pond	WDT-2	6945532.89	386574.77	713.66	2073	6	44.50	2007-11-07	Monthly
Water Storage Pond	WDT-3	6945544.10	386544.43	719.78	2074	16	49.42	2007-11-11	Monthly
Water Storage Pond	WDT-4	6945534.98	386547.90	719.85	2075	16	49.42	2007-11-10	Monthly
Water Storage Pond	WDT-5	6945504.57	386557.50	721.03	2076	16	35.13	2007-11-13	Monthly
Water Storage Pond	WDT-6	6945505.55	386556.32	721.03	2077	16	33.72	2007-11-13	Monthly
Water Storage Pond	WDT-7	6945504.65	386556.39	721.08	2078	16	33.92	2007-11-13	Monthly

Water Storage Pond	WDT-8	6945532.89	386574.77	713.66	2079	16	34.14	2007-11-07	Monthly
Southwest Waste Dump	SDT-1	6944766.71	384779.13	836.36	2220	16	59.1	2010-02-04	Quarterly
Southwest Waste Dump	SDT-2	6944595.06	383971.30	847.11	2221	16	14.6	2010-01-31	Quarterly
Southwest Waste Dump	SDT-3	6944333.87	383824.67	860.17	2222	16	15.8	2010-01-28	Quarterly
Southwest Waste Dump	SDT-4	6944163.62	383783.54	860.99	2223	16	13.1	2010-01-30	Quarterly

## Vibrating Wire Piezometers

Vibrating wire piezometer strings are used to measure piezometric pressure profiles in boreholes. They consist of multiple vibrating wire sensors installed on PVC pipe in grouted boreholes. RST vibrating wire piezometers are installed on site and data is collected with an RST VW2106 readout unit.

#### **Table 8: Vibrating Wire Piezometers**

Area	ID	Northing (m)	Easting (m)	Elevati on (m)	Sensor	No.	Sensor Elevati on (m)	Date Installed	Reading Frequenc Y								
Dry Stack Tailings Storage	DSP-5	6944769	385713	385713 791.47	DSP-5A	VW24851	765.47	2013-04-16	Monthly								
Facility					DSP-5B	VW24853	761.47										
Dry Stack Tailings Storage	DSP-6	6944900	385539	787.66	DSP-6A	VW24850	769.56	2013-04-05	Monthly								
Facility					DSP-6B	VW24852	765.56										
				DSP-7-1	VW34657	771.404	2015-12-09	Bi-weekly									
					ļ							1		DSP-7-2	VW34658	763.404	2015-12-09
Dry Stack Tailings Storage		385390	780.404	DSP-7-3	VW34659	756.404	2015-12-09	Bi-weekly									
Facility					DSP-7-4	VW34660	753.404	2015-12-09	Bi-weekly								
												DSP-7-5	VW34661	751.404	2015-12-09	Bi-weekly	
					DSP-7-6	VW34662	747.404	2015-12-09	Bi-weekly								
					DSP-8-1	VW34663	750.548	2015-12-10	Bi-weekly								
					DSP-8-2	VW34664	745.548	2015-12-10	Bi-weekly								
Dry Stack Tailings Storage	DSP-8	6945058	385872	755.548	DSP-8-3	VW34665	740.548	2015-12-10	Bi-weekly								
Facility	20. 0			2 733.340	DSP-8-4	VW34666	735.458	2015-12-10	Bi-weekly								
									DSP-8-5	VW34667	730.458	2015-12-10	Bi-weekly				
					DSP-8-6	VW34668	720.458	2015-12-10	Bi-weekly								

				1		1			
Dry Stack Tailings Storage Facility	DSP-10	6945223	385944	724.509	DSP-10	VW34617	717.209	2015-11-27	Weekly
Southwest	SDP-2	6944595.06	383971.30	843.41	SDP-2A	VW12912	843.414	2010-01-31	Monthly
Waste Dump					SDP-2B	VW12911	842.714		•
Southwest	SDP-3	6944333.87	383824.67	854.27	SDP-3A	VW12906	854.266	2010-01-28	Monthly
Waste Dump					SDP-3B	VW12907	853.566		•
Southwest	SDP-4	6944163.62	383783.54	858.49	SDP-4A	VW12908	858.494	2010-01-30	Monthly
Waste Dump					SDP-4B	VW12909	857.794		•
Water Storage Pond	WDP-2	6945632	386545	701.67	WDP-2	VW7212	701.67	2007-11-04	Monthly
Water Storage Pond	WDP-3A	6945618	386498	712.62	WDP-3A	VW7557	712.62	2007-11-28	Monthly
Water Storage Pond	WDP-3	6945609	386500	712.60	WDP-3	VW7202	712.60	2007-11-12	Monthly
Water Storage Pond	WDP-4	6945609	386500	702.60	WD -4	VW7210	702.60	2007-11-14	Monthly
Water Storage Pond	WDP-5	6945605	386526	712.35	WDP-5	VW7204	712.35	2007-11-20	Monthly
Water Storage Pond	WDP-6	6945605	386526	701.50	WDP-6	VW7214	701.50	2007-11-20	Monthly
Water Storage Pond	WDP-7	6945605	386526	689.20	WDP-7	VW7208	689.20	2007-11-20	Monthly
Water Storage Pond	WDP-8	6945554	386542	693.10	WDP-8	VW7200	693.10	2007-11-18	Monthly
Water Storage Pond	WDP-9	6945554	386542	687.93	WDP-9	VW7206	687.93	2007-11-18	Monthly
Water Storage Pond	WDP-10	6945554	386542	676.17	WDP-10	VW7211	676.17	2007-11-18	Monthly
Water Storage Pond	WDP-11	6945523	386551	712.96	WDP-11	VW7201	712.96	2007-11-16	Monthly
Water Storage Pond	WDP-12	6945523	386551	694.64	WDP-12	VW7209	694.64	2007-11-16	Monthly
Water Storage Pond	WDP-13	6945533	386578	684.55	WDP-13	VW7205	684.55	2007-11-07	Monthly

# 7 Instrumentation Procedures and Documentation

Data collection manuals for all monitoring devices are included in Appendix B.

After collection, data is input into a series of spreadsheets and databases used for storing, tracking and interpreting instrumentation data. Instructions for data input are contained in the instrumentation manuals in Appendix B.

## 8 Quality Assurance/Quality Control

Planned job obsrevations (PJO's) are routinely performed and documented on Mine Technician Assistants to verify data collection is consistent with the designed procedures.

Data collection equipment is returned to the manufacturers as per their recommended calibration schedules, typically annually.

All data is reviewed and summarized by the Geotechnical Engineer/EIT monthly as part of the Water Licence reporting.

## 9 Reporting

Regular processing and review of monitoring data is completed and presented in the following documents.

#### Table 9: Reporting

Report	Frequency	Submission
Pit Wall Inspection Reports	Weekly	Submitted internally each week
Minto Mine Type A Water Licence QZ14-031 Monthly Report (Clause 4.4)	Monthly	Submitted to Yukon Water Board maximum 30 days following each month
DSTSF Inspection Reports	Monthly	Filed internally within one week of the inspection
Water Storage Pond Dam Inspection Reports	Monthly	Filed internally within one week of the inspection
Area 2 and Main Pit Tailings Storage Facility Inspection Reports	Quarterly	Filed internally within one month of the inspection
Semi-Annual Site-wide Geotechnical Inspection Report	After spring melt (May/June) and before freeze-up (September)	Submitted to Yukon Water Board within 60 days of inspection.
Minto Mine Type A Water Licence QZ14-031 Annual Report (Clause 4.5)	Annually	Submitted to Yukon Water Board by March 31 each year
Minto Mine Type B Water Licence MS15-094 Annual Inspection Report (Clause 34)	Annually	Submitted to Yukon Water Board with the Annual Report

# **Appendix A: Instrumentation Map**

# **Appendix B: Data Collection and Input Manuals**

## **Inclinometer Measurements**

Please refer to RST MEMS Digital Inclinometer System Instruction Manual for complete instruction.

#### System Overview:



Figure 1 - System Overview

- 1. Soft Shell Case
- 2. Digital Inclinometer Probe (w/ protective end cap)
- 3. Reel Battery Charger
- 4. 70mm/2.75" OD Cable Grip
- 5. 85mm/3.34" OD Cable Grip
- 6. Ultra-Rugged Field PC
- 7. 12V DC car adapter for Reel Battery Charger or Ultra-Rugged Field PC
- 8. Spare Reel Battery
- 9. Silicone Lubricant (for use on connectors)
- 10. USB Cable for Ultra-Rugged Field PC
- 11. AC Adapter (110-240V) for Reel Battery Charger
- 12. AC Adapter (110-240V) for Ultra-Rugged Field PC
- 13. Cable Reel with Wireless Communication System and protective end cap
- 14. Reel Carrying Case

- 1. Make sure the battery for the reel and the Field PC are charged.
- 2. Lift up protective box with two hands and put it on side as a work bench.



3. Remove cap from inclinometer casing and look for A<sub>0</sub> marking (black mark).



- Remove excess water inside the probe and the cable connector.
   Probe is very sensitive and susceptible to vibration. DO NOT BANG THE PROBE. Use a paper towel to wipe it.
- 5. Apply silicon lubricant to probe and cable connector when needed.



6. Connect the inclinometer cable to the probe by aligning the keyways and threading the connector onto the probe. Turn the threaded ring, but not the cable.



7. Turn on the power of the reel. A green light indicates that the power is on. This energizes the accelerometers and makes them less susceptible to shock.



8. Check the depth of the hole. Turn on Field PC and select the hole you are going to measure.



9. Always start with **UPPER** Wheel in the A<sub>0</sub> direction.



10. Lower the probe gently and carefully. When it gets close to the bottom lower it very gently to avoid bouncing the probe off the bottom of the hole. The cable has aluminum sleeve marks which are spaced at 0.5m and it has a red measure mark with label every 5m.



- 11. Lower the probe gently to ensure the bottom of the hole is encountered. (Slightly passed the designated depth). Double check your correct depth by pulling out reel to the next 5m mark and counting back each 0.5m for each increment.
- 12. Place the cable grip on top of the casing and hang the cable by the aluminum crimps.




13. Connect the Field PC to the reel. Use the pen attached to the field PC and press "Connections".



14. Once connected, hit "Readings".




15. At each depth allow the A and B readings as well as the noise level become stabilized before you accept the readings. Ideally noise level should be at or below 30  $\mu$ V.

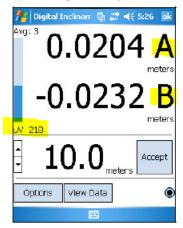

16. Wear gloves as the Envirobind inside the inclinometer casing can be sticky and irritable. Pull up gently to the next marker and let the aluminum crimp to sit on the metal grip. Wait for the readings and noise level to stabilize and then hit *"Accept"*.



- 17. If you accidentally pull the probe too far (more than an inch), lower the probe back down to the previous bead then pull up to the bead you want to measure. This will ensure that the readings remain consistent.
- 18. At each 5m mark, check that you are at the right location. If you miss or overpass a reading, go back to the previous 5m depth. For examples, if something goes wrong at 41.5m, go back to 45m and drop the cable to 45.5m. Then gently pull up to 45m and hit *"Accept"* again. There are arrow keys on the Field PC which allow you to adjust your depth.

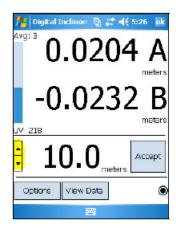

19. Once the last reading (0.5m) is taken, gently take out the probe and turn it 180° so that the **Lower** wheel



is now in the A<sub>0</sub> direction.

20. Go back gently to the bottom of hole and take the second set of readings.

- 21. During the measurement of the second set of readings, checksum data will appear in a smaller font below the current readings. Checksum should be reasonably small and consistent. Ideally it should be somewhere between -0.0035m to +0.0045m.
- 22. If the checksum is large ( > 0.01m) and inconsistent, check the following:
  - Is the probe at the right depth?
  - Is the probe in the correct direction?
  - Lower the probe to the previous depth and retake the reading again.

It is possible that checksum is high due to differential pressure in the ground. In that case continue measurement and keep monitoring checksum.

23. Once readings are completed, take out the probe and wipe away the Envirobind gently. Put the caps back onto the probe and connector.



# Data Input

Note: Windows Mobile Device Center must be installed on the computer in order to collect the readout unit to the computer.



- 1. Connect the USB cable from the readout unit to the computer and turn the power on.
- 2. Open DMM for Windows



- File Open Project Database
   The database for all inclinometer data is stored here:
   X:\Mine Technical\03 Monitoring\! Inclinometers\Master Database
- 4. File Import Import RPP file

Navigate to the mobile device and select the .rpp file for the appropriate monitoring station and date. The data will then import and save in the database automatically.

## **Thermistor Readings**

Two different types of thermistors are currently installed on site – RST and EBA thermistors.

To read RST thermistors:

- 1. Connect adapter cord to the TH2016B Readout Box.
- 2. Record the resistivity (Ohms) for each thermistor node on paper or store the data in the readout box with the following steps:
  - a. Scroll with the Up/Down arrows to the *Memory* screen and press enter (arrow key)



b. Scroll with the Up/Down arrows to the *Store Data* screen and press enter



c. Scroll with the Up/Down arrows to the station being monitored and press enter to store the reading



d. The data is now stored and the readbox can be turned off by pressing the escape button (ESC) three times to get back to the main menu and scrolling to Power Off.



#### To read EBA thermistors:

- 1. Connect the EBA 16 Point Ground Temperature Dial into the thermistor cable.
- 2. Connect the multi-meter to the EBA 16 Point Ground Temperature Dial.
- 3. Record on paper the resistance in Ohm's ( $\Omega$ ) for each point.

# Data Downloading


- 1. Connect USB cord from computer to the readout box.
- 2. Open the software Multi Readout Host.



- 3. Turn on the power on the readout box.
- 4. The software will recognize the readout unit and prompt to download data. Choose "Yes" to download the data from the readout unit.

Multi Readout Host	83
Would you like to download TH2016 data?	
Yes No	

5. Once data is downloaded you will have the option to save all data as .csv file. Choose "Yes" and the data will be stored in My Documents in a folder named "TH2016data".



6. The software can be used to setup new locations or view data but no further steps are required.

rsf)	🗧 🔜 🎲 ) 🕫						_ = ×
37	Home						🍘 🗸 Style
Paste	Cut Status Bar Copy elect All oard View	Reconnect Logging Optic Readout Optic		Download Up Data si	ites Records	Add Export Delete Data Coation CSV Selected Folder trument	
Confi	ig file TH 🗙						
Del #	Location	Sensor #	Thermistor Type	Rea	ading # II		<u>é</u> .
1	13-DST-12	16	3K		0 31		=
2	13-DST-10	16	3K		3 6		-
3	WDT4	16	3K		1 18		
4	WDT1	16	3K		1 19		
5	WDT2	16	3K		1 20		
6	WDT3	16	3K		1 21		
7	WDT5	16	ЗK		1 22		
٠							
ort 🙆	Status 🧿					TH2016 🔡 Connected	Cancel .

## Data Input

Spreadsheets for piezometer data input and tracking are stored here:

X:\Mine Technical\03 - Monitoring\! Piezo and GTC

1. Open the spreadsheet for the area monitored

nize ▼ Burn New folder					
02 - Reporting     03 - Monitoring     12 Jata Input Information     14 Hubs and Prisms     14Line Information	•	Name   Data downloads  Ground Temp and Piezo 2013 info  Ground Temp Cables 2008  I old	Date modified 2013-09-27 10:51 2013-11-20 7:20 AM 2013-09-28 4:49 PM 2013-11-16 3:11 PM	Type File folder File folder File folder File folder	Size
Instrumentation Maps  I Piezo and GTC  I Minstrumentation Monitoring  Archive GroundProbe Radar  Misc  Pit Photo Monitoring		(1) 2013 - Minto Master SWD Instrumentation Spreadsheet ④ GTC + Piezometer Instrumentation - Area 2 Pit ④ GTC + Piezometer Instrumentation - DSTSF ⑤ Minto Master MWP Instrumentation Spreadsheet ⑥ Minto Master WSPD Instrumentation Spreadsheet ⑧ Minto Pit Geotech Monitoring 2009	2013-11-17 6:45 AM 2013-09-27 9:25 AM 2013-11-21 9:33 AM 2013-11-16 5:53 PM 2013-11-17 8:41 AM 2010-05-27 5:19 PM	Microsoft Excel 97 Microsoft Excel 97	1,650 Ki 413 Ki 2,894 Ki 1,017 Ki 3,842 Ki 107 Ki
<ul> <li>Pit Wall Monitoring Logs</li> <li>WSP, W12, W13 Water Elevations</li> <li>04 - Long Term Planning</li> <li>05 - Mine Planning</li> <li>06 - UG Mine Planning</li> <li>07 - Drill &amp; Blast</li> <li>08 - Project Management</li> <li>09 - Administration &amp; Safety</li> <li>11 - How Tos</li> <li>13 - Photos</li> <li>14 - Geatechnical</li> </ul>	H				

### 2. Open the tab "GTC Readings"



3. In a new column enter the date and copy the resistivity data (Ohms) from the paper records, or from the .csv file saved in either "TH2016data" or "VW2016data" saved in My Documents.

8												
9 10	WDT-3											
11	Date BeadNo:	15-Sep-11	5-0ct-11	24-Nov-11	28-Feb-12	27-Mar-12	11-Apr-12	18-Apr-12	14-May-12	****	14-Jul-12	
12	1	9.71	10.24	12.55	13.73	14.00	14.11	14.15	14.17	11.30	9.77	
13	2	10.55	10.86	12.59	13.68	13.87	13.95	13.98	14.04	12.57	10.84	
14	3	11.03	11.11	12.53	13.71	13.90	13.98	14.01	14.08	13.66	11.99	
15	4	11.38	11.26	12.36	13.61	13.80	13.89	13.93	14.02	13.89	12.58	
16	5	11.99	11.71	12.39	13.55	13.75	13.84	13.87	13.97	13.97	13.16	
17	6	12.49	12.16	12.50	13.50	13.69	13.78	13.81	13.91	13.96	13.49	
18	7	13.05	12.70	12.69	13.49	13.67	13.75	13.79	13.89	13.97	13.78	
19	8	13.38	13.10	12.88	13.45	13.61	13.69	13.72	13.82	13.90	13.87	
20	9	13.57	13.40	13.15	13.50	13.63	13.69	13.71	13.80	13.86	13.89	
21	10	13.67	13.61	13.42	13.58	13.66	13.70	13.73	13.79	13.84	13.89	
22	11	13.66	13.66	13.55	13.58	13.63	13.66	13.67	13.72	13.76	13.81	
23	12	13.68	13.70	13.66	13.63	13.66	13.68	13.68	13.72	13.75	13.79	
24	13	13.74	13.77	13.77	13.71	13.71	13.72	13.72	13.74	13.77	13.80	
25	14	13.87	13.89	13.90	13.83	13.82	13.83	13.83	13.85	13.87	13.90	
26	15	13.95	13.96	13.94	13.88	13.87	13.88	13.88	13.90	13.92	13.95	
27	16	13.99	13.99	13.92	13.87	13.88	13.88	13.89	13.91	13.94	13.97	
28												

📧 🕂 🕨 🕅 UNDEX 🖌 Site Plan 🖌 Install Info 🖌 Piezo Readings 🖌 Piezo Calcs 🦯 Piezo Graphs 🔤 GTC Readings 🖉 GTC Calcs 🖉 GTC Graphs 🖉 GTC Graphs 🖉 GTC Graphs

### Vibrating Wire Piezometer Readings

- 1. Connect adapter cord to the VW2106 Readout Box.
- 2. Connect the coloured wires to the correct wire clips on the extension cable. Make sure the wires do not touch each other.
- 3. Record the **DATE** and **TIME** as barometric pressure will be needed to calibrate the water level.
- 4. Record the measurement (between 7000B to 9000B) and the temperature (°C) for each piezometer. The piezometer ID should be labeled on the wire (eg. P5a and P5b).



- 5. Alternatively the data can be stored in the readout box:
  - a. Scroll with the Up/Down arrows to the *Memory* screen and press enter (arrow key)



b. Scroll with the Up/Down arrows to the Store Data screen and press enter



c. Scroll with the Up/Down arrows to the station being monitored and press enter to store the reading



d. The data is now stored and the readout box can be turned off by pressing the escape button (ESC) three times to get back to the main menu and scrolling to Power Off.



# Data Downloading


- 7. Connect USB cord from computer to the readout box.
- 8. Open the software Multi Readout Host.



- 9. Turn on the power on the readout box.
- 10. The software will recognize the readout unit and prompt to download data. Choose "Yes" to download the data from the readout unit.

Multi Readout Host	
Would you like to download VW2106 data?	
Yes No	

11. Once data is downloaded you will have the option to save all data as .csv file. Choose "Yes" and the data will be stored in My Documents in a folder named "VW2016data".



12. The software can be used to setup new locations or view data but no further steps are required.


<u></u>	। 🛃 🏥 🔍 न					Multi R	adout Host - Config VW	_ 🗖
🌮 📊	lome							🕐 ~ S
aste	Cut Status Bar Copy Grid Lines lect All ard View	Reconnect Monitor Options Logging Options Readout Options Readout	Download Uploa	Records	Add Exp Location CS strument	ort Dele	e Data	
Config	vw ×							
el #	Location	Previous Record Date/Time	Prev Record Value	Units	Reading #	ID		
1	DSP-3A			kPa	4	12		
2	DSP-3B			kPa	1	1211		
3	DSP-4A			kPa	0	1212		
4	DSP-4B			kPa	1	1213		
5	DSP-5A			kPa	2	1214		
6	DSP-5B			kPa	1	1215		
7	DSP-6A			kPa	5	1216		
. 61	Status 🔘						VW2106	Cano

## Data Input


Spreadsheets for piezometer data input and tracking are stored here:

X:\Mine Technical\03 - Monitoring\! Piezo and GTC

4. Open the spreadsheet for the area monitored

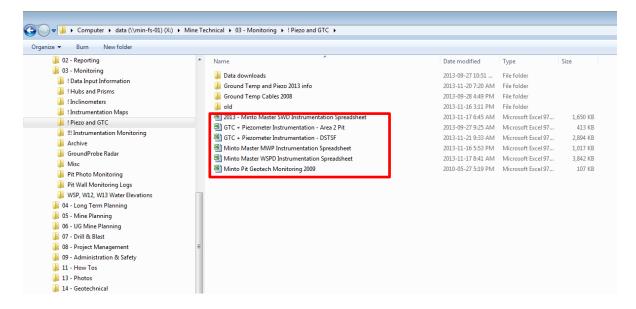

#### 5. Open the tab "Piezo Readings"

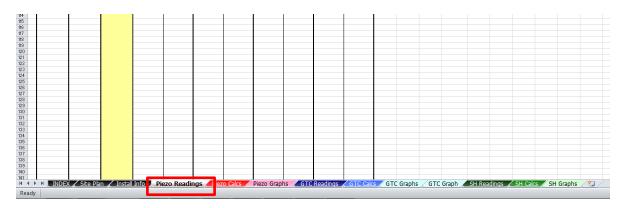

6. In a new row, input the date, time, barometric pressure, B-unit and temperature readings for each instrument.

Clipboard         Font         Alignment         Number           Y144         Font         Alignment         Number           Y144         Font         Alignment         Number           A         B         C         D         V         V         Y         Z         AA         AB         A           2         MINTO MINE: DRY STACK TAILINGS STORAGE FACILITY         Note:         Barometer         Barometer         Barometer         Note:           3         I. Emer Date         I. Emer Reading (B) and Temp Reading (C) to corresponding pieco.         Note:         Barometer readings of VW Piezometer reading of VW Piezometer reading (B)         Preading (C)         Reading (C) <th></th> <th></th> <th></th> <th></th> <th></th> <th>/iew</th> <th>eview \</th> <th>Data R</th> <th>rmulas</th> <th>out For</th> <th>Page Lay</th> <th>Insert</th> <th>Home</th> <th>File</th>						/iew	eview \	Data R	rmulas	out For	Page Lay	Insert	Home	File
Paste Clipboard         B         I		Ŧ	eral	Gene	ap Text	<b>≣</b> <sup>2</sup> Wr	<b>_</b> »	= =	· A A	- 10	ahoma	Та		ĥ
Y144         ✓         Jr           A         B         C         D         U         V         X         Y         Z         AA         AB         A           3         A         B         C         D         U         V         X         Y         Z         AA         AB         A           3         A         HINTO MINE: DRY STACK TAILINGS         STORAGE FACILITY         Note:         Barnets reading sol         Note:           4	e Co	00. 0. <b></b> 0.€ 00.	· % ,	er * \$ *	rge & Cente	🔳 📑 Me		≣≣	🏷 - <u>A</u> -	•	B <i>I</i> <u>U</u> -	Painter		Paste
A         B         C         D         U         Y         W         X         Y         Z         AA         AB         A           3	5	5	Number	Es.		nment	Alig		5	Font		Gi -	Clipboard	
A         B         C         D         U         Y         W         X         Y         Z         AA         AB         A           3										ç.	- t	- (	¥144	
3         Tab Use Instructions; 1. Enter Date         Note: Sammeter reading of VW Piecometer reading of	A	AC	AB	AA	Z	Y	X	V	٧			С		- A
2         Tab Use Instructions: 1. Enter Date         Note: Sammeter reading of VW Piecometer reading of									FACTITY	STORAGE			MINTO MIN	
4         5         1         2b Use Instructions: 1. Enter Date         Note: 2. Enter Time         Note: Barometer reading 2. Enter Time         Note: Barometer reading PED indicates assume entry row highlight indi- enty row highlight indi- e										STORAGE	CR TAILING.		THE TO THE	
5         Image: Description of the second seco			nte:											
6	ed fro								structions:	Tab Use Ins				
8         Control Recording (Plank Training Plank)         Control Recording Plank Training (Plank Training Plank)         Control Recording Plank		ngs obtainei	arometer readir											
9         Charle Geoletice Reading         Charle Geoletice Reading         Control Geoletice Reading <td>btaine</td> <td></td> <td></td> <td>Ba</td> <td></td> <td></td> <td></td> <td></td> <td>te</td> <td>1. Enter Dat</td> <td></td> <td></td> <td></td> <td></td>	btaine			Ba					te	1. Enter Dat				
DATE         TIME         EAROHICER RECONSIDE         Reading (C) Reading (C)         Temp. Reading (C)         DSP-5A         DSP-5B         DSP-6A         DSP-6B           11         Image: Construct the reconstruction of the reconstruction o		readings obt	N Piezometer I	Ba		onding piezo.	≅C) to correspo	emp Reading (	te ne	1. Enter Da 2. Enter Tin				
III         DATE         TIME         Second Exconsion         DSP-5A         DSP-5B         DSP-6B         Temp. Peading (C)         <	lues ( r	readings obt	W Piezometer I D indicates as:	Ba VV RE		onding piezo.	9C) to correspo		te ne ading (B) and 1	1. Enter Da 2. Enter Tin 3. Enter Rea				
12         DATE         TIME         BeatontTCR Recording (C)         Reading (B)         Temp. Reading (C)         Temp. Reading (C)         Reading (B)         Reading (B)         Reading (B)         Reading (C)	lues ( r es begi	readings obt sumed value ht indicates	W Piezometer ( D indicates as: rey row highlig)	Ba VV RE Gr		onding piezo.	°C) to correspo		te ne ading (B) and 1	1. Enter Da 2. Enter Tin 3. Enter Rea				
DATE         TIME         Beading(E) Reading(C)         Temp. Reading(C)         Reading(C)	lues (re es begi	readings obt sumed value ht indicates	W Piezometer ( D indicates as: rey row highlig)	Ba VV RE Gr		onding piezo.	SC) to correspo		te ne ading (B) and 1	1. Enter Da 2. Enter Tin 3. Enter Rea				
Image: 10         Image: 10 <t< td=""><td>lues (re es begin</td><td>readings obt sumed value ht indicates</td><td>W Piezometer I D indicates as: rey row highligh V/A indicates a</td><td>Ba VV RE Gr #N</td><td></td><td></td><td></td><td>g</td><td>te ne ading (B) and T rometer Readir</td><td>1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar</td><td></td><td></td><td></td><td></td></t<>	lues (re es begin	readings obt sumed value ht indicates	W Piezometer I D indicates as: rey row highligh V/A indicates a	Ba VV RE Gr #N				g	te ne ading (B) and T rometer Readir	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar				
78         2013-Åpr-16         6:15         8800         9137.6         -0.7         7705.1         -0.1         9321.5         0.4         8938.7         -0.2           73         2013-Åpr-26         17.00         87.80         6333.3         -0.8         7563.1         -0.0.3         8933.3         -0.2         9028.8         -0.7           81         2013-Åpr-26         17.00         88.20         -         8936.1         -0.3         9023.7         -0.2           82         2013-Åpr-27         10.30         883.00         833.4.8         -0.9         7561.5         -0.4         8935.5         -0.1         9017.2         -0.5           82         2013-Åpr-28         10.00         89.50         8354.5         -0.9         7561.5         -0.4         8932.8         -0.4         9017.2         -0.5           82         2013-Åpr-16         12.00         89.50         8388.2         -0.9         7565.5         -0.5         8936.3         -0.3         9024.7         -0.4           84         2013-Åur-17         12.00         89.50         9410.8         -0.9         7576.7         -0.5          9013         -0.6           82         2013-Åur-18	lues (re es begin	readings obt sumed value ht indicates	W Piezometer I D indicates as: rey row highligh V/A indicates a P-6B	Ba VV RE Gr #N			-5B	g	te ne ading (B) and 1 rometer Readir 2–5A	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar				
79         2013-Apr-26         17-00         87.80         833.33         -0.8         7563.1         -0.3         8933.3         -0.2         9028.8         -0.7           80         2013-Apr-27         13.00         833.09         -         -         9393.1         -0.2         9028.8         -0.7           81         2013-Apr-28         10.00         831.0         8334.8         -0.9         7581.5         -0.4         8931.5         -0.1         9017.2         -0.5           82         2013-Apr-30         10.30         8350.8         8355.2         -0.5         7597         -0.4         8332.8         -0.4         9016.7         -1.3           82         2013-Apr-30         10.30         8350.8         8355.2         -0.5         7597         -0.4         8332.8         -0.4         9016.7         -1.3           82         2013-Apr-13         12.00         8350         8350.8         -0.5         8997.1         -0.3         30012.4         -0.4           64         2013-Apr-17         12.00         89.50         8410.8         -0.9         757.7         -0.5         8997.1         -0.3         3013         -0.6	lues (re es begi	readings obt sumed value ht indicates	W Piezometer II D indicates as: rey row highligh V/A indicates a P-6B Temp. Reading (°C)	Ba VV RE Gr #N DSF Reading (B)	Temp.	DSP Reading (B)	<b>-5B</b> Temp.	DSF	te ne ading (B) and 1 rometer Readir <b>2-5A</b> Temp.	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar	READING (kPa)			
80         2013.Apr-27         13.30         89.20         89361         -0.3         9023.7         -0.2           81         2013.Apr-27         10.00         8810         -0.5         -0.4         89361         -0.3         9023.7         -0.2           82         2013.Apr-28         10.30         8850         83355         -0.5         75615         -0.4         89315         -0.1         9017.2         -0.5           83         2013.Apr-20         10.30         8850         83552         -0.5         75615         -0.4         8932.8         -0.4         9016.7         -1.3           83         2013.Apr-16         12.00         8850         8388.2         -0.9         7585.5         -0.5         8936.3         -0.3         9024.7         -0.4           84         2013.Jun-17         12.00         89.50         8410.8         -0.9         7576.7         -0.5         8917.1         -0.3         9013         -0.6	lues (re es begi	readings obt sumed value ti indicates missing rea	W Piezometer ( D indicates as: ey row highligh V/A indicates a P-6B Temp. Reading (°C) 0	Ba VV RE Gr #N DSF Reading (B) 9008.3	Temp. Reading (°C) -0.8	DSP Reading (B) 8938	- <b>5B</b> Temp. Reading(C)	DSF Reading (B)	te ne ading (B) and T rometer Readin <b>P-5A</b> Temp. Reading (°C)	1. Enter Da 2. Enter Tin 3. Enter Re: 4. Enter Bar DSP Reading (B)	READING (kP+) 89.00	21:30	2013-Apr-08	7
81         2013-Apr-28         10:00         8310         8334.8         -0.9         7581.5         -0.4         9391.5         -0.1         907.2         -0.5           82         2013-Apr-30         10:30         895.0         8355.2         -0.3         7597         -0.4         9391.5         -0.4         9016.7         -1.3           83         2013-Mpr-30         10:30         895.0         8358.2         -0.5         7585.5         -0.5         833.3         -0.3         9024.7         -0.4           84         2013-Jun-71         12:00         835.0         -         -         -         8917.1         -0.3         9013.4         -0.4           84         2013-Jun-71         12:00         835.0         8410.8         -0.9         7576.7         -0.5         8917.1         -0.3         9013.4         -0.6	lues (re es begi	readings obt sumed value ti indicates missing rea	W Piezometer r D indicates as: ey row highligi (/A indicates a <b>D-6B</b> Temp. Reading (°C) 0 -0.2	Ba VV RE Gr #N DSF Reading (B) 9008.3 8998.7	Temp. Reading (°C) -0.8 0.4	DSP Reading (B) 8938 8921.5	- <b>5B</b> Temp. Reading('C) -0.1	B DSF Reading (B) 7709.1	te ne ading (8) and 1 rometer Readin P-5A Temp. Reading (C) -0.7	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar DSP Reading (B) 8137.6	READING (kPa) 89.00 89.00	21:30 6:15	2013-Apr-08 2013-Apr-16	7
82         2013-Apr-30         10.30         89.50         8355.2         -0.9         7597         -0.4         8932.8         -0.4         9016.7         -1.3           83         2013-Mag-16         12:00         89.50         8388.2         -0.9         7587.5         -0.5         8936.3         -0.3         9024.7         -0.4           84         2013-Jun-17         12:00         89.50         5         -0.5         8937.1         -0.3         9013         -0.6           85         2013-Jun-18         12:00         89.50         8410.8         -0.9         7576.7         -0.5         -0.3         9013         -0.6	lues (re es begi	readings obt sumed value ht indicates missing rea	W Piezometer r D indicates as: rey row highlight WA indicates a P-6B Temp. Reading (°C) 0 0.0.2 -0.7	Ba VV RE Gr #N DSF Reading (B) 9008.3 8998.7 9028.8	Temp. Reading (°C) -0.8 0.4 -0.2	DSP Reading (B) 8938 8921.5 8933.3	- <b>5B</b> Temp. Reading('C) -0.1	B DSF Reading (B) 7709.1	te ne ading (8) and 1 rometer Readin P-5A Temp. Reading (C) -0.7	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar DSP Reading (B) 8137.6	BEADING (kP+) 89.00 89.00 87.80	21:30 6:15 17:00	2013-Apr-08 2013-Apr-16 2013-Apr-26	7
83 2013-Mag-16 12-00 8350 8388.2 -0.9 7585.5 -0.5 8336.3 -0.3 9024.7 -0.4 84 2013-Jun-17 12:00 8350 8350 - 8917.1 -0.3 8013 -0.6 85 2013-Jun-18 12:00 835.0 8410.8 -0.9 7576.7 -0.5	lues (re es begi	readings obt sumed value ht indicates missing rea	W Piezometer ( D indicates as every row highlight (/A indicates a D-6B Temp. Reading (C) 0 -0.2 -0.7 -0.2	Ba VV RE Gr HN DSF Reading (B) 9008.3 8998.7 9028.8 9023.7	Temp. Reading (°C) -0.8 0.4 -0.2 -0.3	DSP Reading (B) 8938 89215 8839.3 8936.1	P-5B Temp. Reading (°C) -0.1	g DSF Reading (B) 7709.1 7569.1	te ne ading (8) and 1 rometer Readin <b>P-5A</b> Temp. Reading (°C) -0.7 -0.8	1. Enter Da 2. Enter Tin 3. Enter Rec 4. Enter Bar DSP Reading (B) 8137.6 8333.9	READING (kP+) 89.00 89.00 87.80 89.20	21:30 6:15 17:00 13:30	2013-Apr-08 2013-Apr-16 2013-Apr-26 2013-Apr-27	7
84 2013-Jun-17 12:00 8950 8950 8917.1 -0.3 9013 -0.6 85 2013-Jun-18 12:00 8950 8410.8 -0.9 7576.7 -0.5	lues (re es begi	readings obt sumed value the indicates missing rea	W Piezometer ( D indicates as rey row highligi (/A indicates a D-6B Temp. Reading ('C) 0 0 0.0.2 0.7 0.2 0.5 0.5 0 0 0 0 0 0 0 0 0 0 0 0 0	Ba VV RE Gr Freading (B) 9008.3 8998.7 9028.8 9023.7 9027.7	Temp. Reading (°C) -0.8 0.4 -0.2 -0.3 -0.1	DSP Reading (B) 8938 89215 89393 89361 89361	5B Temp. Reading (°C) -0.1 -0.3 -0.4	g DSF Reading (B) 7709.1 7569.1 7581.5	te ne ading (8) and 1 rometer Readin <b>P-5A</b> Temp. Reading (°C) -0.7 -0.8 -0.9	1. Enter Da 2. Enter Tin 3. Enter Rea 4. Enter Bar DSP Reading (B) 8137.6 8333.9 8334.8	READING (kP+) 89.00 89.00 87.80 89.20 89.10	21:30 6:15 17:00 13:30 10:00	2013-Apr-08 2013-Apr-16 2013-Apr-26 2013-Apr-27 2013-Apr-28	7
85 2013-Jun-18 12:00 89.50 8410.8 -0.9 7576.7 -0.5	lues (re es begin	readings obt sumed value the indicates missing rea	W Piezometer         r           D indicates as:         sey row highlight           V/A indicates a         sey           P-6B         Temp.           Reading (*C)         0           0         -0.2           -0.7         -0.2           -0.5         -1.3	Ba VV RE Gr Gr MN DSF Reading (B) 9008.3 8998.7 9028.8 9023.7 9028.8 9023.7 9017.2 9016.7	Temp. Reading (°C) -0.8 -0.4 -0.2 -0.3 -0.1 -0.4	DSP Reading (B) 8938 89315 8939.3 8936.1 89315 8932.8	<b>5B</b> Temp. Reading (°C) -0.1 -0.3 -0.4 -0.4	g DSF Reading (B) 7709.1 7569.1 7581.5 7597	te ne ading (B) and T rometer Readin <b>P-5A</b> Temp. Reading (C) -0.7 -0.8 -0.9 -0.9 -0.9	1. Enter Da 2. Enter Tie 3. Enter Rei 4. Enter Bar DSP Reading (B) 8137.6 8333.9 8334.8 8355.2	READING (kP+) 89.00 89.00 87.80 89.20 89.10 89.50	21:30 6:15 17:00 13:30 10:00 10:30	2013-Apr-08 2013-Apr-16 2013-Apr-26 2013-Apr-27 2013-Apr-28 2013-Apr-30	7
	lues (re es begin	eadings obti sumed value tt indicates missing rea	W Piezometer         Piezometer           D indicates         as:           ey row highligh         V/A indicates           V-6B         Temp.           Reading (C)         0           -0.2         -0.7           -0.5         -1.3           -0.4         -0.4	Ba VV RE Gr Freading (B) 9008.3 8998.7 9028.8 9023.7 9017.2 9016.7 9024.7	Temp. Reading (°C) -0.8 0.4 -0.2 -0.3 -0.1 -0.4 -0.3	DSP Reading (B) 8938 89215 8939.3 8936.1 8932.8 8932.8 8932.8 8933.3	<b>5B</b> Temp. Reading (°C) -0.1 -0.3 -0.4 -0.4	g DSF Reading (B) 7709.1 7569.1 7581.5 7597	te ne ading (B) and T rometer Readin <b>P-5A</b> Temp. Reading (C) -0.7 -0.8 -0.9 -0.9 -0.9	1. Enter Da 2. Enter Tie 3. Enter Rei 4. Enter Bar DSP Reading (B) 8137.6 8333.9 8334.8 8355.2	READING (kP+) 89.00 87.80 89.20 89.20 89.10 89.50 89.50	21:30 6:15 17:00 13:30 10:00 10:30 12:00	2013-Apr-08 2013-Apr-16 2013-Apr-26 2013-Apr-27 2013-Apr-28 2013-Apr-30 2013-May-16	7 3 9 0 2 3
86 2013	lues (re es begin	eadings obti sumed value tt indicates missing rea	W Piezometer         Piezometer           D indicates         as:           ey row highligh         V/A indicates           V-6B         Temp.           Reading (C)         0           -0.2         -0.7           -0.5         -1.3           -0.4         -0.4	Ba VV RE Gr Freading (B) 9008.3 8998.7 9028.8 9023.7 9017.2 9016.7 9024.7	Temp. Reading (°C) -0.8 0.4 -0.2 -0.3 -0.1 -0.4 -0.3	DSP Reading (B) 8938 89215 8939.3 8936.1 8932.8 8932.8 8932.8 8933.3	5B Temp. Reading (C) -0.1 -0.3 -0.4 -0.4 -0.5	g DSF Reading (B) 7709.1 7581.5 7597 7585.5	te ne ading (8) and 1 rometer Readin P-5A Temp. Reading (C) -0.7 -0.8 -0.9 -0.9 -0.9 -0.9	1. Enter Da 2. Enter Time 4. Enter Rei 4. Enter Bar DSP Reading (B) 8137.6 8333.9 8334.8 8355.2 8388.2	READING (kP+) 89,00 87,80 89,20 89,20 89,10 89,50 89,50 89,50 89,50	21:30 6:15 17:00 13:30 10:00 10:30 12:00 12:00	2013-Apr-08 2013-Apr-08 2013-Apr-26 2013-Apr-27 2013-Apr-27 2013-Apr-30 2013-May-16 2013-Jun-17	773333333333333333333333333333333333333

Barometric pressure can be obtained from the site's weather monitoring stations. Data is stored here:

X:\Environmental\Environmental Monitoring Program\1\_MASTER LOGS\Meteorology Station Data\Met Station 1 and 2 Data Summary.xlsx

# Appendix 5: Summary of AEMP Study Design Components and Supporting Measures

Summary of Minto Mine Aquatic Environmental Monitoring Program (AEMP) study design components.

AEMP Component	Area	Area Description	Program	Method	Replication	Frequency
Effluent Sublethal Toxicity Testing	Upper Minto Creek	Minto final effluent	EEM	Evaluation of effluent will be measured in 4 toxicity tests; rainbow trout embryos, <i>Ceriodaphnia dubia</i> , <i>Pseudokerchneriella</i> <i>subcapitata</i> and <i>Lemna minor</i> .	Approximately 100 L of final effluent	Once every 3 years <sup>1</sup>
	Lower Wolverine Creek	Reference area for Lower Minto Creek.	WUL			Once a year
	Lower Big Creek	Reference area for Lower Minto Creek.	EEM		-	Once every 3 years
·	Lower Minto Creek	Farthest field exposure below water storage pond	WUL		1 station per area.	Once a year
Supporting Water		(WSP).	EEM	Water quality sampling for laboratory		Once every 3 years
Chemistry	Upper McGinty Creek	Reference area for Upper Minto Creek.	WUL	analysis <sup>3</sup> .		Once a year
	Upper Minto Creek <sup>2</sup>	Exposure area just below WSP.			3 stations per area for EEM.	·
	10 RCA Reference Creeks	The 10 most appropriate reference creeks chosen from Phase 3 IOC.	EEM		1 station per area.	Once every 3 years
	1:3 Effluent:Receiving Water 1:6 Effluent:Receiving Water	A 1:3 ratio between effluent and receiving water. A 1:6 ratio between effluent and receiving water.	22101		4 times over the exposure period.	Once every 5 years
	Lower Wolverine Creek	Reference area for Lower Minto Creek.		A hand corer and petite ponar is used to	3 hand corer composite for metals and 3 ponar	
Sediment Chemistry	Lower Minto Creek	Farthest field exposure area below WSP.	WUL	collected sediment for laboratory analysis <sup>3</sup> .	composite for particle size at each station. 5 stations per area.	Once a year
	Upper McGinty Creek	Reference area for Upper Minto Creek.		A stainless steel spoon used to collected	1 jar for metals at each station and 1 bag for particle	ence a year
-	Upper Minto Creek	Exposure area just below WSP.		sediment for laboratory analysis <sup>3</sup> .	size at each area. 5 stations per area.	
Sediment Toxicity	Lower Wolverine Creek	Reference area for Lower Minto Creek.	WUL	A petite ponar is used to collect sediment for toxicity testing. A 14d <i>Hyalella azteca</i> and a	3 ponar composite will be collected at each stations	
Testing	Lower Minto Creek	Farthest field exposure area below WSP.	WUL	10d <i>Chironomus dilutus</i> sediment toxicity test will be conducted.	per area. 5 stations per area.	Once a year
Periphyton	Lower Wolverine Creek	Reference area for Lower Minto Creek.	WUL	Periphyton from a 4x4 cm <sup>2</sup> template is collected on filter paper and wrapped in	5 rock composite from each station per area. 5	Once a year
Chlorophyll a	Lower Minto Creek	Farthest field exposure area below WSP.	WOL	aluminum foil.	stations per area.	enee a year
Periphyton	Lower Wolverine Creek	Reference area for Lower Minto Creek.	WUL	Periphyton from a 4x4 cm <sup>2</sup> template is collected and placed in small plastic jars with	5 rock composite from each station per area. 5	Once a year
Community	Lower Minto Creek	Farthest field exposure area below WSP.	WOL	water and Lugol's solution.	stations per area.	Chief a year
Periphyton Tissue	Lower Wolverine Creek	Reference area for Lower Minto Creek.		Periphyton from a 4x4 cm <sup>2</sup> template is	E rock composite from each station per area. E	
Chemistry	Lower Big Creek	Reference area for Lower Minto Creek.	WUL	collected and placed in small plastic jars with	5 rock composite from each station per area. 5 stations per area.	Once a year
Onernioury	Lower Minto Creek	Farthest field exposure area below WSP.		little or no water for laboratory analysis <sup>3</sup> .		
	Lower Wolverine Creek	Reference area for Lower Minto Creek.			3 composite samples collected per station. Area	
	Lower Big Creek	Reference area for Lower Minto Creek.	WUL		includes 5 stations.	Once a year
Benthic Invertebrate	Lower Minto Creek	Farthest field exposure area below WSP.		Rocks scrubbed within Hess sampler to collect		
Community	Upper Minto Creek <sup>2</sup>	Exposure area just below WSP.	EEM	benthic invertebrate community.	3 composite samples collected per station. Area includes 3 stations.	
	10 RCA Reference Creeks	The 10 most appropriate reference creeks chosen from Phase 3 IOC.			3 composite samples collected per station. Area includes 1 station.	Once every 3 years
Donthia Investations	Lower Wolverine Creek	Reference area for Lower Minto Creek.		Either the kick and sweep or flipping rocks		
Benthic Invertebrate Tissue Chemistry	Lower Big Creek	Reference area for Lower Minto Creek.	WUL	method used to collect 2 g of benthic tissue	1 sample collected at each station, 5 stations per area.	Once a year
rissue orientistry	Lower Minto Creek	Farthest field exposure area below WSP.		samples for laboratory analysis <sup>3</sup> .		

Summary of Minto Mine Aquatic Environmental Monitoring Program (AEMP) study design components.

AEMP Component	Area	Area Description	Program	Method	Replication	Frequency
Fish Community	Lower Big Creek Lower Minto Creek	Reference area for Lower Minto Creek. Farthest field exposure area below WSP.	EEM	Minnow traps used to characterize fish use and associated population sizes.	Fishing will be done to confirm time, extent and magnitude of use by fish.	Twice a year every 3 years
Fish Field/Lab Testing	Lower Minto Creek 1:3 Effluent:Receiving Water 1:6 Effluent:Receiving Water	Farthest field exposure area below WSP. A 1:3 ratio between effluent and receiving water. A 1:6 ratio between effluent and receiving water.	EEM	Mobile laboratory exposure system will be set up on site to evaluate survival and growth.	Exposure includes 3 tanks (Control, 1:3 and 1:6) with 150 fish per tank.	Once every 3 years
	Lower Wolverine Creek	Reference area for Lower Minto Creek. Reference area for Lower Minto Creek.			Depth and velocity taken at locations where Hess sampler used. 5 depths taken at 1 station per area. Meter measurements taken at 5 stations per area. Area includes 5 stations.	
	Lower Minto Creek	Farthest field exposure area below WSP.	WUL		Depth and velocity taken at locations where Hess sampler used. 5 depths taken at 1 station per area. Meter measurements taken at 5 stations per area. Area includes 5 stations.	Once a year
	Upper McGinty Creek	Reference area for Upper Minto Creek.		Physical observations (depth and velocity),	Meter measurements taken at 5 stations per area.	
Supporting Measures				meter measurements of temperature,	Meter measurements taken at 5 stations per area.	
	Upper Minto Creek <sup>2</sup>	Exposure area just below WSP.		dissolved oxygen, conductivity and pH.	Depth and velocity taken at locations where Hess sampler used. Meter measurements and 5 depths taken at 3 stations per area. Area includes 3 stations.	
	10 RCA Reference Creeks	The 10 most appropriate reference creeks chosen from Phase 3 IOC.	EEM		Depth and velocity taken at locations where Hess sampler used. Meter measurements and 5 depths taken at 1 station per area. Area includes 1 station.	Once every 3 years
	1:3 Effluent:Receiving Water	A 1:3 ratio between effluent and receiving water.			Meter measurements taken 4 times over the exposure	
	1:6 Effluent:Receiving Water	A 1:6 ratio between effluent and receiving water.			period.	

' Sublethal toxicity testing is conducted once a year after the mine has subjected to section 7 of the MMER for three years, previous to this sublethal toxicity testing occurs twice a year.

<sup>2</sup> Under RCA design upper Minto Creek, for EEM, will include 3 stations whereas references areas will only include 1 station. All sampling will occur at each individual station for upper Minto Creek.

<sup>3</sup> Laboratory analysis includes for water, sediment and periphyton and benthic tissue chemistry described in Table 4.

WUL = Water Use Licence

EEM = Environmental Effects Monitoring Program

RCA = Reference Condition Approach

Monitoring Program	Sup	oporting Measures	Replication
	Meter measurements <sup>1</sup>		every station
	GPS coordinates		every station
Sediment	Depth (lower reaches)	Depth of station	every station
oconnent	Depth (lower reaches)	Core penetration depth	every core
	Photographs (lower reaches)	Core and Ponar samples	every station
	<b>U I I I</b>	Substrate type	every station
	GPS coordinates		every station
Periphyton	Area scraped	Chlorophyll a	every rock
renpriyton	Area scraped	Community	every rock
	Photographs	Rocks after scraping	every rock
	Meter measurements <sup>1</sup>		every station
	GPS coordinates		every station
	Water chemistry sampling		1 station per area <sup>2</sup>
Benthic Invertebrate	Depth and velocity		each Hess location
Dentine invertebrate	100 Pebble Count	Intermediate axis	every station
		Embeddness on 10% of pebbles	every station
	Photographs	Upstream, downstream, across, substrate	every station
	Habitat assessment	Description of area sampled	1 station per area <sup>2</sup>
	Meter measurements <sup>3</sup>		every station
	GPS coordinates		every station
Fish Monitoring	Water chemistry sampling		1 station per area
r isir wormoning	Weather		every station
	Trap location	With a description of area	every station
	Photographs	Upstream, downstream, across, substrate	every station

Supporting Measures for Monitoring Programs Under the AEMP, Minto Mine.

<sup>1</sup> Meter measurements include: dissolved oxygen, pH, temperature and conductivity <sup>2</sup> Sampling occurs at all 3 stations for upper Minto Creek during EEM.

<sup>3</sup> Meter measurements include: dissolved oxygen, temperature, specific conductivity and flow

WUL = Water Use Licence

EEM = Environmental Effects Monitoring Program

# Appendix 6: Benthic Sampling SOP

# STANDARD OPERATING PROCEDURE FOR BENTHIC INVERTEBRATE COMMUNITY MONITORING UNDER THE MINTO MINE ENVIRONMENTAL MONITORING, SURVEILLANCE AND REPORTING PLAN (EMSRP)

# TABLE OF CONTENTS

1.0	INTRODUCTION	1
2.0	SAMPLING DEVICE	3
3.0	SAMPLING METHODS	4
3.1	BMP Sampling Methods	4
3.2	EEM Sampling Methods	5
4.0	SAMPLE CONSOLIDATION	6
5.0	LABELLING	7
6.0	PRESERVATION	8
7.0	DOCUMENTATION	9
7.1 F	ield Sheets	9
7.2 C	Chain of Custody	9
8.0	SHIPPING	11
9.0	POTENTIAL HAZARDS	12
10.0	REFERENCES	13

# 1.0 INTRODUCTION

The Minto Mine Environmental Monitoring, Surveillance and Reporting Plan (EMSRP) includes benthic invertebrate community monitoring, with data collection using a Hess sampler. This Standard Operating Procedure (SOP) outlines the procedures applied to benthic invertebrate community monitoring under the EMSRP. Benthic invertebrate community monitoring is included in the EMSRP to evaluate potential impacts of effluent discharged into Minto Creek. Community metrics are compared between Minto Creek and associated reference areas and among years.

Two sampling programs are included in the overall EMSRP at the Minto Mine, the Biological Monitoring Program (BMP) and the Environmental Effects Monitoring program (EEM). A Hess sampler is used for both programs, but collection methods differ between programs. The BMP monitoring assessed 3 areas, with 5 stations per area, for a total of 15 samples each of which is a three grab composite (described in Section 3.1). The EEM includes 11 areas (1 exposed area and 10 reference area), with triplicate samples collected at the sole exposed area and single sample collected at the 10 reference areas, for a total of 13 samples each of which is a three grab composite (described in Section 3.2). Sample consolidation, labelling, preservation, documentation, and potential sampling hazards are the same for both programs.

Prior to sampling, carefully review the study plan (design), order water sampling bottles (including preservatives and filters) and gather all equipment from the equipment list (Table 1). Erosional Benthic Grab Sample Collection field sheets (Figure 1) must be prepared on waterproof paper and some initial information can be pre-filled out, including: waterbody, program, sampling device, mesh size and sampler size. Coordinates of sampling stations from previous years should be obtained and inputted into a GPS; all attempts should be made to sample the same stations as in previous sampling events.

Upon arrival at the sampling location, a visual assessment of the site must be undertaken to evaluate any safety/hazard concerns and to identify the most appropriate placement of the sampling stations based on the erosional habitat and substrate. After a visual inspection, flow and depth are measured to identify three appropriate sampling locations that are similar (flow, depth, substrate). Flow is measured using a flow meter (Marsh McBirney Flo-Mate 2000) and depth is measured either using a wading rod or a meter stick. If no suitable locations are found at previous sampling stations, move to a more appropriate location keeping stations at least six bankfull widths apart. Once a suitable station is found, record depth and flow of all locations and the GPS coordinates. At this time, more information can be filled out on the field sheet,

## Table 1: Equipment list for benthic invertebrate community sampling.

Equipment	Amount
	Anodin
Water Quality Sampling	
YSI (temp, DO, pH, specific conductivity)	1
Calibration solutions	1 bottle each of pH 4, 7 and 10
Back up water quality reader (pen, DO kit)	1 set
Flow mate with wading rod	1
Meter stick	1
	•
Water Sampling	
Water bottle from Analytical Laboratory	25 sets
Preservatives	25 sets
Syringes (large)	25
Polypropylene 0.4 µm filters	25
Benthic Invertebrate Sampling	
Wide mouth bottles (1 L)	35
Hess (500 um)	1
Surber (500um) as back-up	1
Long gloves (and fleece liners)	2 pair
White plastic tub	4
Squeeze bottles	2
Formalin	4 L
Borax	1 L
Nail brush	2
Internal labels	40
30 cm ruler	2
Measuring cup	2
Miscellaneous	
Camera with charger	1
GPS	1
Sharpies	5
Pencils	5
Extra batteries for YSI, SPOT, GPS	many
Field sheets on waterproof paper	35
Field notebook - waterproof	1
Health and Safety	
bear spray	1
EPIRB or SPOT device	1
Floater coat	1

Erosional Benthic Grab Sample Collection		MINTO MINE					
Program:							
Date/Time:		 Field C	rew:				
Waterbody:		Station Identifier:					
Sampling Device:			Sampler Size:				
Mesh Size:		Grabs in Composite:					
Water Velocity (mean):	m/s	Station Depth (m):					
Habitat Sheet Completed	Benthic Tissue Sample Collected:						
SAMPLE CHARACTERISTICS							
Number of Jars: Average Depth that Sampler is Pushe	d into Substrato (whore a	pplicable);	cm				
Average Deptir that Sampler is Pushe	d into Substrate (where a						
Average Depth to Which Substrate is	Sampled/Cleaned:	cm					
Average Sampling Time per Grab:	r	min					
Sample Texture: Cobble (% Comments		Sand and Finer	· (%)Organic (%):				
Macrophytes (in sample): none	sparse	common	abundant				
Algae (in sample): none	sparse	common	abundant				
List Macrophyte/Algae Type/Species	in sample; to the extent p	oossible):					
Periphyton Community Sample	Collected:	Periphyt	on Tissue Sample Collected	: 🗖			
*** 3 m	*** 3 measurements per station for flow, depth and substrate (each replicate) ***						
Latitude		Longitude					
Tamaratina							
Temperature Sp Cond	_ DO mg/L _	рН					
	DO % Sat						
Depth (cm):		Flow (m/s):		_			
Pictures: Field Sheet							
US			Signature:				
DS							
Across Substrate							

Figure 1: Erosional Benthic Grab Sample Collection Field Sheet.

including: date/time, field crew and station identifier. Before any sampling occurs, take pictures of the station in the following order: field sheet, upstream view, downstream view, across the river and of the substrate (after completion this can be checked off in the field sheet).

All required *in situ* water quality measurements (temperature, dissolved oxygen, pH and specific conductivity) and water samples should be obtained prior to disturbing the substrate and water column. Water quality is measured using an YSI 650 MDS (Multi-parameter Display System) field meter equipped with a YSI 6600 Sonde (Yellow Springs Instruments, Yellow Springs, OH) or a Hanna 4M Multi-parameter meter (Woonsocket, RI). These measurements should be taken upstream of all determined sampling locations. Record all measurements in the Erosional Benthic Grab Sample Collection field sheet (Figure 1). Water samples should be taken upstream of the field technicians standing location so not to cause any contamination of the sample.

# 2.0 SAMPLING DEVICE

A Hess sampler is a large cylindrical device (36 cm diameter) open at either end and covered with mesh on the sides with one side forming a collection bag (Figure 2; Dynamic Aqua-Supply Ltd. 2016). The collection bag is closed by tightly tying a string around the end. Double check that the collection bag is completely closed and there are no gaps. Using the handles push the Hess sampler into the substrate and positioned so the collection bag is downstream. Substrate within the Hess is disturbed and washed, and benthic invertebrates are swept into the collection bag by the current flowing through the mesh. The standard Hess used for both program has a 0.10 m<sup>2</sup> sampling area and is outfitted with a 500 µm mesh.



Figure 2: Hess sampling device (Dynamic Aqua-Supply Ltd. 2016).

# 3.0 SAMPLING METHODS

At each area, sampling commences at the furthest downstream station in riffle/run habitat. Subsequent stations are sampled moving upstream. Suitable areas are evaluated by looking for cobble/gravel substrates in erosional habitats and finding sample locations with similar depths and flow. Flow is measured using a flow meter (Marsh McBirney Flo-Mate 2000) and depth is measured either using a wading rod or a meter stick. Flow should be between 0.20 -0.40 m/s and depth should be greater than 10 cm or the water will not flow properly into the collection bag. Once an ideal sampling location is identified, the bottom of the Hess sampler is firmly placed in the substrate with the mesh collection bag facing downstream. A nail brush is used to clean rocks within the Hess sampler to disturb substrate. This disturbance causes detritus and benthic invertebrates to be passively collected within the collection bag by the stream current. Cleaned rocks are removed from the Hess sampler and 100 are saved to measure intermediate axis for supporting data. The substrate is disturbed to a depth of approximately 5 cm over a period of about 10 minutes or until the area has been cleared. It is important that the rocks are fully cleaned and all organisms and debris is allowed to flow into the collection bag to capture the majority of the benthic invertebrates and ensure consistency among samples. Each sample is made up of a three grab composite; all grabs are collected in the Hess sampler before consolidation. After each individual grab, the Hess sampler is moved to the next sub-sampling location. Care must be taken to make sure that material within the collection bag does not fall out between each individual grab. The procedure is repeated two more times for a total of three grabs, which will make up a composite sample. Number of grabs in composite is recorded in the Erosional Benthic Grab Sample Collection field sheet (Figure 1) and the following sample characteristics are recorded: average depth that the sampler is pushed into substrate, average depth which the substrate was cleaned, average sampling time per grab and sample texture (while cleaning rocks make an estimate of percent substrate size, cobble, gravel, sand/finer and organic). If there are any macrophytes or algae in the sample a semi-qualitative description of quantity (none, sparse, common or abundant) and type/species is recorded.

## 3.1 BMP Sampling Methods

Lower Minto Creek and two reference areas, lower Wolverine and lower Big Creek, are sampled for the BMP. Sampling is conducted in erosional habitat and there are a total of five replicates (stations) per area. Each station is made up of a three grab composite. The procedure described in Section 3.0 is completed at each area. A total of 15 benthic invertebrate community samples are collected for the BMP.

4

#### 3.2 EEM Sampling Methods

For the EEM benthic invertebrate community monitoring, a Reference Condition Approach (RCA) is applied. Under an RCA design, a greater number of reference areas are typically used to characterize the reference condition and then to determine whether or not the exposure area is within the reference condition. In the case of the Minto Mine EEM, the exposure area (upper Minto Creek) is evaluated against reference condition defined by a total of 10 references areas. At each area, the procedure described above in Section 3.0 is conducted. For each reference areas, only one sample (site) is collected but the exposure area is sampled in triplicate. All samples are three grab composites. During the EEM, a total of 13 benthic invertebrate community samples are collected.

# 4.0 SAMPLE CONSOLIDATION

Following each composite sample collection, material must be consolidated and removed from the Hess and placed in a sample jar. Material captured by the Hess can be easily removed by first washing the contents down into the mesh collection bag by forcefully splashing ambient water at the outside of the Hess. Once the sample is rinsed down into the collection bag, bring the Hess sampler to the sample jar without spilling any of the contents in the collection bag. A white plastic tub is placed under the sample jar so any benthic invertebrates that may fall from the net will not be lost. Once over the sample jar/plastic tub, untie the string holding the collection bag closed. The contents are washed from the collection bag into a sample jar using a squirt bottle filled with ambient water.

When transferring the benthic invertebrate sample from the Hess into the sample jar, care should be taken to remove all invertebrates from the Hess, paying particular attention to net seams. Any benthic invertebrates remaining on the inside of the sampler are removed by lightly picking them off the mesh by hand. The tray is checked and any organisms found are placed into the sample jar. Some ambient water can be added to the sample jar to cover all material, if needed.

# 5.0 LABELLING

All benthic sample jars are labelled using a Sharpie on both the lid and jar wall. An internal label is also prepared, using pencil written on either a wooden tongue depressor or waterproof paper. The wooden tongue depressor is preferable, as it is more resistant to abrasion from the sample contents. The lid, jar wall and internal label are marked with the project number, sample ID, date (e.g., "7-Sep-16"), and samplers' initials. If multiple jars are required for one sample, the jars should each be labelled with a jar number and the total number of jars (e.g., "Jar 1 of 3"). The number of jars used is recorded in the Erosional Benthic Grab Sample Collection field sheet (Figure 1).

# 6.0 PRESERVATION

Once the sample is in the sample jar, a preservative (commercially available 37% formalin solution) must be added to prevent sample degradation. Formalin is a carcinogen, so safety procedures must be strictly followed:

- Work outside or in a well-ventilated room;
- Wear the appropriate PPE: safety glasses, long nitrile gloves, and a respirator fitted with N7500-2 acid gas cartridges; and,
- Store an MSDS with the formalin.

In the field, formalin solution is diluted when it is added to the sample; the final volume is to be nine parts ambient water and sample material to one part formalin.

Formalin is acidic and may cause decalcification of invertebrates or increase hardening of other tissues. Therefore, the sample is buffered using borax, which is added at a ratio of ¼ to ½ cup per litre of the formalin solution. The samples are placed in a cooler and stored until ready to be shipped to the analytical laboratory. Chains of custody (COC) must be prepared before shipping any samples, this is described in Section 7.0.

# 7.0 DOCUMENTATION

Field sheets, field notes and a Chain of Custody (COC) forms must all be filled out. Photocopies of all these documents are required as a record and in case originals become lost or damaged. Both benthic invertebrate community samples and water samples require a COC form.

## 7.1 Field Sheets

Sampling records are kept by completing the standardized Erosional Benthic Grab Sample Collection field sheet (Figure 1) and recording any additional relevant information in a waterproof field notebook. A variety of information is required, including: date/time, sampling device, station identifier, depth, flow, sample characteristics, GPS coordinates and water quality measurements. Once photographs of the station have been taken they are also checked off. The field sheet also has check boxes for other sampling associated with the BMP; once they are completed they can be checked off. These other sampling requirements include checking that: the habitat field sheet was completed, the benthic tissue sample was collected, the periphyton community sample was collected, and the periphyton tissue sample was collected. Once all information is recorded, the field sheet is reviewed to make sure everything has been collected and there are no recording errors. After review, the field sheet is signed by the field crew leader.

## 7.2 Chain of Custody

A COC must accompany all samples being submitted to ensure that the required analyses are completed, and to confirm receipt of samples by the laboratory. The form is especially crucial if the project is being carried out for legal reasons (e.g., compliance monitoring). The chainof-custody record portion of the form is critical because it documents sample possession from the time of collection through to final disposal of the sample. A sample is considered to be in a person's custody if any of the following criteria are met:

- The sample is in the person's possession;
- The sample is in the person's view after being in possession;
- The sample is in the person's possession and is being transferred to a designated secure area; and
- The sample has been locked up to prevent tampering after it was in the person's possession.

The analytical request portion of the form provides information to the laboratory regarding what analyses are to be performed on the samples that are shipped. Information on the record must include:

- Laboratory name;
- Contact person name and contact information;
- Sampler name and contact information;
- Project number;
- Date results required by;
- Sample identifiers;
- Sample date;
- Sample matrix;
- Laboratory analyses;
- Number of containers;
- Submission date and time (24-hour clock); and
- Comments on any unusual conditions or other important information.

Most commercial analytical laboratories will provide a COC Record for samples submitted to their laboratory. If the laboratory does not have a COC one can created as a spreadsheet (Figure 3).

Minto Mine Telephone: (604) 759-4659									
						CHAIN OF CUSTODY RECORD			
Laboratory Address:									of
						Mir			
Contact:							Program		
Phone:		e-mail:				Date Results Required By:			
					_			- 1	
Sample	O a mara la JD	Dete Cererlad	Collection	Samp	ler Size	Grabs in		Number of	O a man a m ta
Number	Sample ID	Date Sampled	Method	Per Grabs	Total Grabs	Mesh Size	Sample	Containers	Comments
1									
2									-
3									-
4									-
5									
6									_
7									-
8									-
9									-
10									
11									
12									
13									_
14									_
15									
-	elinquished to Lab E	By:				Date:		Shipment Metho	od:
	ployee Signature)								
Samples Received in Lab By: (Lab Employee Signature)			Date:		Sample Condition upon Receipt:				
(Lab E	impioyee Signature)								
		SUBMIT	ORIGINAL TO	O LAB WITH S	AMPLES AND	<b>RETAIN TWO</b>	PHOTOCOPIE	S	

Figure 3: Chain of Custody form.

# 8.0 SHIPPING

While packing the samples to be shipped, fill out the COC at the same time. This allows you to reconcile what has been physically placed in the shipping container to the COC. Once samples are packed the COC is placed in a Ziploc<sup>™</sup> bag and added to the shipping containers. From the Minto Mine, a bus or driver must be organized to ship the samples to Whitehorse, YT. From Whitehorse, benthic invertebrate samples are shipped by bus to the laboratory. Water samples can either be dropped off to a local laboratory or shipped by plane for same day delivery to a laboratory.

Water samples must be sent in a cooler packed with ice packs, from Minto Mine the same day of collection or the following day due to short holding times for several required analyses. Date of collection must consider when the samples will arrive at the laboratory. Samples will need to arrive when the laboratory is opened; during the week day and not on holidays or weekends.

Benthic invertebrate community samples do not have a hold time so shipping can occur any time after sampling. Samples are shipped in a cooler and no ice packs are required. Since samples are preserved in formalin the appropriate safety labels must be visible on the cooler and a copy of the MSDS is added to the cooler.

# 9.0 POTENTIAL HAZARDS

Potential hazards	Mitigation
Formalin	<ul> <li>Wear PPE.</li> <li>Work in a well-ventilated area.</li> <li>Have access to the formalin MSDS.</li> </ul>
Working on water: falling, current, and drowning	<ul> <li>Mindfulness and awareness of surroundings.</li> <li>Work in pairs, communicate with your partner.</li> <li>Wear personal flotation device when working in or around water bodies.</li> </ul>

# **10.0 REFERENCES**

Dynamic Aqua-Supply Ltd. 2016. Hess Sampler. Available from <u>http://www.dynamicaqua.com/streamsampling.html</u> [Accessed 2 March 2016].

# STANDARD OPERATING PROCEDURE FOR BENTHIC INVERTEBRATE TISSUE QUALITY MONITORING UNDER THE MINTO MINE ENVIRONMENTAL MONITORING, SURVEILLANCE AND REPORTING PLAN (EMSRP)

# TABLE OF CONTENTS

1.0		1
2.0	SAMPLING DEVICE	2
3.0	SAMPLING METHODS	3
4.0	SAMPLE CONSOLIDATION	4
5.0	LABELLING AND PRESERVATION	5
6.0	DOCUMENTATION	6
7.0	SHIPPING	8
8.0	POTENTIAL HAZARDS	9
9.0	REFERENCES	.10

# 1.0 INTRODUCTION

The Minto Mine Environmental Monitoring, Surveillance and Reporting Plan (EMSRP) includes collection of benthic invertebrates for tissue chemistry under the Biological Monitoring Program (BMP). Collection of benthic invertebrate tissue is undertaken in conjunction with the benthic invertebrate community sampling, but is completed after community samples are collected to avoid disturbance that could distort the community characterization (see Minto Mine SOP – Benthic Invertebrate Community). This Standard Operating Procedure (SOP) outlines the procedures applied to benthic invertebrate tissue monitoring under the EMSRP. Benthic invertebrate tissue sampling is included in the EMSRP to evaluate potential impacts of effluent discharge to Minto Creek. Tissue sample chemistry is compared among lower Minto Creek and reference areas (lower Wolverine Creek and lower Big Creek) and among years.

Prior to sampling, carefully review the study plan (design), gather all equipment needed (kick net, Whirl-Pak<sup>™</sup> bags, tweezers, white plastic tub, squeeze bottle, waterproof field notebook, GPS and a 10 g Pesola balance). Coordinates of the sampling stations from previous years should be obtained and input into a handheld GPS; all attempts should be made to sample the same stations used in previous sampling events.

Upon arrival at the sampling location, a visual assessment of the site must be undertaken to evaluate any safety/hazard concerns and to identify the most appropriate place to collect benthic tissue samples. Since benthic invertebrate tissue is sampled concurrent with benthic invertebrate community sampling, supporting measures such as water quality meter measurements, water samples and photographs will not need to be repeated. There are no field sheets associated with benthic invertebrate tissue sampling. Notes on the number, types and weight of taxa collected can be recorded in a waterproof field notebook.

Tissue samples can be collected by either a kick net or by overturning rocks by hand to collect organisms. Priority is placed on collecting adequate tissue mass and not the method used to collect benthic invertebrate tissue samples. Benthic invertebrate tissue samples are collected at three areas (lower Minto, lower Wolverine, and lower Big Creek), with samples collected at five stations within each area.

# 2.0 SAMPLING DEVICE

The dimensions, mesh size and type of kick net can vary as type of device used is not as important as the mass of tissue required for chemical analysis. A kick net that is consistent with the Canadian Aquatic Biomonitoring Network (CABIN) protocol is commonly used (CABIN 2010). This net has a triangular opening ( $36 \times 36 \times 36 \text{ cm}$ ), 400 µm mesh and a detachable plastic collection bottle with a screen bottom which is screwed onto the end of the net (Figure 1; Halltech Aquatic Research Inc. 2016).



Figure 1: Kick net sampling device (Halltech Aquatic Research Inc. 2016).

## 3.0 SAMPLING METHODS

At each area, sampling commences at the furthest downstream station and subsequent locations are sampled moving upstream. Suitable areas are selected by looking for cobble/gravel substrates in riffle/run areas. Using a technique commonly referred to as the kick-and-sweep method, the kick net is firmly placed on the substrate immediately downstream of the feet of the sampling technician. Samples are collected by kicking (toe or heel) and twisting your feet to ensure that the substrate is fully dislodged. Moving along the creek, the technician makes sure the kick net stays on the substrate and shadows the technician's feet. Ensuring a specific depth of kicking or amount of time sampling is not necessary as this tissue collection is not quantitative; ensuring that the required mass of tissue is collected is the priority. Samples can also be collected by overturning rocks and picking organisms by hand.

# 4.0 SAMPLE CONSOLIDATION

Following the kick and sweep, material must be consolidated and removed from the kick net and placed in a Whirl-Pak<sup>TM</sup> bag. It is common for large rocks and sticks to be captured in the kick net; these can be carefully washed into the net using a squirt bottle with ambient water. Material captured by the kick net can be easily removed by first washing the contents down into the bottle by forcefully splashing ambient water at the outside of the net. Once the sample is rinsed down into the bottle, it can be removed by unscrewing the bottle cap from the bottle. The contents from the net and bottle are then emptied into a white plastic tub. Tweezers are used to pick benthic invertebrates from the plastic tub and place them into a Whirl-Pak<sup>™</sup> bag. If benthic invertebrates are obtained from overturned rocks, they are also placed into the Whirl-Pak<sup>™</sup> bag. Use a Pesola spring balance to measure an empty Whirl-Pak<sup>™</sup> bag, use this value to subtract from a Whirl-Pak<sup>™</sup> bag with sample in it. This value is the weight of the sample. Continue to pick as many benthic invertebrates from the plastic tub as possible until the target sample weight has been achieved (2 - 5 g). If the desired sample weight has not been achieved, continue using the kick net or overturning rocks to collect more benthic invertebrates. Using a waterproof field notebook, record the sample weight and estimate the proportion of major taxon groups based on the number and volume of the organisms.

# 5.0 LABELLING AND PRESERVATION

All Whirl-Pak<sup>™</sup> bags are labelled using a Sharpie and are marked with the project number, sample ID, date (e.g., "7-Sep-16"), and samplers' initials.

Once the sample is in the Whirl-Pak<sup>TM</sup> bag it is placed in a cooler with ice packs and later transferred to a freezer. Samples are kept in the freezer until they are ready to be sent to the analytical laboratory.

## 6.0 DOCUMENTATION

In a waterproof field notebook, record the approximate weight of the sample and an estimate of the taxon groups that make up the sample (by number and mass). In the Erosional Benthic Grab Sample Collection field sheet (see Minto Mine SOP – Benthic Invertebrate Community) check off that the benthic invertebrate tissue sample has been collected. Photocopy any field notes made as a record and in case originals become lost or damaged.

Most commercial analytical laboratories will provide a Chain of Custody (COC) for samples submitted to their laboratory. Fill out this COC form and make two photocopies for your records.

A COC must accompany all samples being submitted to ensure that the required analyses are completed and to confirm receipt of samples by the laboratory. The form is especially crucial if the project is being carried out for legal reasons (e.g., compliance monitoring). The chain-of-custody record portion of the form is critical because it documents sample possession from the time of collection through to final disposal of the sample. A sample is considered to be in a person's custody if any of the following criteria are met:

- The sample is in the person's possession;
- The sample is in the person's view after being in possession;
- The sample is in the person's possession and is being transferred to a designated secure area; and
- The sample has been locked up to prevent tampering after it was in the person's possession.

The analytical request portion of the form provides information to the laboratory regarding what analyses are to be performed on the samples that are shipped. Information on the record must include:

- Laboratory name;
- Contact person name and contact information;
- Sampler name and contact information;
- Project number;
- Date results required by;
- Sample identifiers;
- Sample date;
- Sample matrix;
- Laboratory analyses;

- Number of containers;
- Submission date and time (24-hour clock); and
- Comments on any unusual conditions or other important information.

## 7.0 SHIPPING

When samples are ready to be shipped, fill out the COC at the same time. This allows you to reconcile what has been physically placed in the shipping container to the COC. Once samples are packed, the COC is placed in a Ziploc<sup>TM</sup> bag and added to the shipping container. From the Minto Mine, a bus or driver must be organized to ship the samples to Whitehorse, YT. From Whitehorse, samples can either be dropped off to a local laboratory or shipped by plane for same day delivery to a laboratory.

Benthic invertebrate tissue samples are to be packed in a small cooler with ice. Shipping time must be sufficiently short that the samples do not thaw. Consideration must be given to shipping date, as samples will need to arrive when the laboratory is opened; during the week day and not on holidays or weekends.

# 8.0 POTENTIAL HAZARDS

Potential hazards	Mitigation
Formalin	<ul> <li>Wear PPE.</li> <li>Work in a well-ventilated area.</li> <li>Have access to the formalin MSDS.</li> </ul>
Working on water: falling, current, and drowning	<ul> <li>Mindfulness and awareness of surroundings.</li> <li>Work in pairs, communicate with your partner.</li> <li>Wear personal flotation device when working in or around water bodies.</li> </ul>
Unnatural objects	<ul> <li>Do not kick and sweep sample in area where it is expected that foreign objects may be concealed in the substrate (i.e. rusted metal or urban refuse).</li> </ul>

## 9.0 REFERENCES

- CABIN (Canadian Aquatic Biomonitoring Network). 2010. Field Manual: Wadeable Streams. Environment Canada. March 2010.
- Halltech Aquatic Research Inc. 2016. Kick net sampler. Available from <a href="http://www.halltechaquatic.com/cabin-protocol-benthic-kick-net/296.html">http://www.halltechaquatic.com/cabin-protocol-benthic-kick-net/296.html</a> [Accessed 3 March 2016].

# Appendix 7: Yukon Invasive Plants by Taxonomy

#### Invasiveness Rank

- 1 highly invasive may displace or replace native ecosystems
- 2 aggressive widespread, persistent, but may not replace native species or change ecosystem function
- 3 taxa present in the territory that area not known to be invasive here but have been found to be invasive in other jurisdictions
- 4 has been reported in the territory. Has not been shown to be problematic, may not persist
- 5 species that likely don't persist
- 6 false reports
- 7 native and introduced populations exist

#### General Abundance

- C common widespread established F falsely reported, P possible but not yet documented R rare known from only 1 or two localities, U unknown X possibly not persistent,
- possibly not persisten
   possibly native,

Persistence 1=widespread 2=local 3=not persistent, 4=falsely reported

Alaska Invasiveness Rank not ranked <40 = Very Weakly Invasive 40-49 = Weakly Invasive 50-59 = Modestly Invasive 60-69 = Moderately Invasive 70-79 = Highly Invasive >80 = Extremely Invasive

Ranking from: Matthew L. Carlson, Irina V. Lapina, Michael Shephard, Jeffery S. Conn, Roseann Densmore, Page Spencer, Jeff Heys, Julie Riley, and Jamie Nielsen. 2008. Invasiveness Ranking System for non-native plants if Alaska. USDA Forest Service Alaska Region R10-TP-143 http://www.fs.fed.us/r10/spf/fhp/invasive/invasiveness%20ranking%20report.pdf Introduced Plants of the Yukon - Source Cody, 1996 (cody et al 1998, 2000, 2001, 2002, 2003, 2004, 2005) Bennett, B. et al. (2008) revised by B.A. Bennett December 2011 - this is a tentative list for review purpose only

Invasiveness Rank	Family	Genus	Species	Common Name	Abundance	Persistence	Alaska Rank	Source	Date of first collection
1	Grass family	Agropyron	cristatum	Crested Wheat Grass	С	1	nr	revegetation	1947
4	Grass family	Agropyron	fragile	Siberian Wheat Grass	U	2	nr	revegetation	1949
4	Grass family	Agrostis	capillaris	Colonial Bent Grass	R	2	nr	agriculture, revegetation	1993
3	Grass family	Agrostis	gigantea	Redtop	R	2	nr	revegetation	1916
Р	Grass family	Agrostis	stolonifera	Creeping Bent Grass	Р	Р	nr	revegetation	
5	Grass family	Aira	caryophyllea	Silver Hair Grass	х	3	nr	transportation	1946
5	Grass family	Alopecurus	geniculatus	Water Foxtail	R	2	49	agriculture	1899
3	Grass family	Alopecurus	pratensis	Meadow Foxtail	С	1	52	agriculture	1947
3	Grass family	Avena	fatua	Wild Oasts	R	3	nr	agriculture	1943
5	Grass family	Avena	sativa	Cultivated Oats	х	3	nr	agriculture, transportation	1949
4	Grass family	Bromus	carinatus	California Brome	R	2		revegetation	1995
5	Grass family	Bromus	japonicus	Japanese Brome	х	3		revegetation	2003
5	Grass family	Bromus	racemosus	Bald Brome	х	3		agriculture	1902
1	Grass family	Bromus	inermis	Smooth Brome	С	1	62	agriculture, revegetation	1943
5	Grass family	Bromus	secalinus	Rye Brome	х	3	nr	agriculture	1902
5	Grass family	Bromus	tectorum	Downy Brome	х	3	78	agriculture	1916
2	Grass family	Dactylis	glomerata	Orchard Grass	R	3	53	revegetation	2000
5	Grass family	Deschampsia	danthonioides	Annual Hairgrass	Х	3	nr	unknown	1902
5	Grass family	Deschampsia	elongata	Slender Hairgrass	х	3	35	transportation (railway)	1902

Invasiveness Rank	Family	Genus	Species	Common Name	Abundance	Persistence	Alaska Rank	Source	Date of first collection
2	Grass family	Elymus	repens	Creeping Wild Rye	U	2	59	revegetation	1949
2	Grass family	Elymus	sibiricus	Siberian Wild Rye	С	1	53	revegetation	1980
3	Grass family	Festuca	rubra ssp. rubra	Red Fescue	С	1		revegetation	
4	Grass family	Festuca	trachyphylla	Hard Fescue	R	2		agriculture	1949
5	Grass family	Hordeum	vulgare	Common Barley	R	3	39	agriculture	1983
1	Grass family	Leymus	angustus	Narrow-leaved (Altai) Lyme Grass	R	2	nr	revegetation	1998
4	Grass family	Lolium	multiflorum	Annual Rye Grass	R	1	41	revegetation	1902
2	Grass family	Lolium	perenne	Perennial Rye Grass	R	1	52	revegetation	1994
5	Grass family	Lolium	temulentum	Bearded Rye Grass	х	3	nr	unknown	1902
1	Grass family	Phalaris	arundinacea	Reed Canary Grass	?	1	83	agriculture, revegetation	1979
5	Grass family	Phalaris	canariensis	Common Canary Grass	х	3	nr	agriculture	1941
4	Grass family	Phleum	pratense	Common Timothy	С	1	54	agriculture	1902
3	Grass family	Poa	annua	Annual Blue Grass	С	1	46	transportation	1968
3	Grass family	Poa	compressa	Canada Blue Grass	U	1	39	revegetation	1980
7	Grass family	Poa	nemoralis	Forest Blue Grass	?	2		revegetation	
2	Grass family	Poa	pratensis ssp. pratensis	Kentucky Blue Grass	С	1	52	unknown	
3	Grass family	Poa	trivialis	Rough Blue Grass	U	1	52	revegetation	1902
5	Grass family	Polypogon	monospeliensis	Rabbit's-foot Grass	х	3		unknown	1902
3	Grass family	Psathyrostachys	juncea	Russian Wild-Rye	R	2	nr	agriculture	1960
7	Grass family	Puccinellia	distans	Spreading Alkali Grass	?C	1			
3	Grass family	Schedonorus	arundinaceus	Tall Fescue	R	2	66	revegetation	1980
5	Grass family	Secale	cereale	Common Rye	R	3	nr	agriculture, transportation	1949
5	Grass family	Setaria	viridis	Green Bristle Grass	х	3	nr	transportation	1998
4	Grass family	Thinopyrum	intermedium	Intermediate Wheat Grass	R	2		transportation	1999
2	Grass family	Thinopyrum	ponticum	Tall Wheat Grass	R	1	nr	agriculture	2000
5	Grass Family	Triticum	aestivum	Common Wheat	х	3	nr	agriculture, transportation	1943
5	Grass family	Vulpia	myuros	Rat-tail Six-weeks Grass	х	3	nr	unknown	1902
5	Nettle family	Urtica	urens	Burning Nettle	х	3	nr	unknown	1904
5	Goosefoot family	Atriplex	patula	Spear Saltbush	Х	3	nr	unknown	1
5	Knotweed family	Fagopyrum	esculentum	Buckwheat	Х	3	nr	agriculture (birdseed)	1997
2	Knotweed family	Polygonum	achoreum	Leathery Knotweed	U	1		transportation	1997
7	Knotweed family	Polygonum	buxiforme	Prairie Knotweed	?C	1	45	transportation	1
3	Knotweed family	Fallopia	convolvulus	Eurasian Black-bindweed	С	1	50	horticulture	1975
5	Knotweed family	Polygonum	fowleri	Fowler's Knotweed	Х	3		unknown	1943
6	Knotweed family	Persicaria	maculosa	Spotted Lady's-Thumb	F	4	47		1
3	Knotweed family	Rheum	rhaponticum	Rhubarb	C	1	nr	agriculture	1999
4	Knotweed family	Rumex	acetosella	Sheep Sorrel	R	2	51	unknown	1994
3	Knotweed family	Rumex	crispus	Curled Dock	R	2	48	unknown	1980
3	Knotweed family	Rumex	longifolius	Door-yard Dock	R	2	48	transportation	1980
3	Knotweed family	Rumex	pseudonatronatus	Field Dock	R	2	nr	transportation	2004

Invasiveness Rank	Family	Genus	Species	Common Name	Abundance	Persistence	Alaska Rank	Source	Date of first collection
3	Goosefoot family	Chenopodium	album	Lamb's-Quarter	С	1	37	unknown	1883
4	Pink family	Cerastium	fontanum	Common Mouse-ear Chickweed	U	1	36	unknown	1968
4	Goosefoot family	Spinacia	oleracea	Spinach	R	2		agriculture	1980
4	Pink family	Cerastium	glomeratum	Sticky Mouse-ear Chickweed	R	2	36	horticulture	2004
4	Pink family	Cerastium	nutans	Nodding Chickweed	R	2		horticulture	1996
5	Pink family	Dianthus	plumarius	Carnation	R	3		horticulture	1994
5	Pink family	Gypsophila	elegans	Showy Baby's-breath	R	3	nr	unknown	1980
3	Pink family	Silene	noctiflora	Night-flowering Catchfly	R	2	43	revegetation	1996
2	Pink family	Silene	vulgaris	Bladder Campion	R	2	42	agriculture, horticulture	1984
5	Pink family	Spergula	arvensis	Corn Spurry	х	3	32	unknown	1902
4	Pink family	Spergularia	rubra	Red Sandspurry	R	2	34	unknown	1977
2	Pink family	Stellaria	media	Common Chickweed	С	1	42	agriculture, horticulture	1943
5	Pink family	Vaccaria	hispanica	Cowcockle	R	3	nr	agriculture (birdseed)	1902
2	Buttercup family	Clematis	tangutica	Golden Clematis	R	1	nr	horticulture	1958
5	Buttercup family	Ranunculus	repens	Creeping Buttercup	Х	3	54	transportation	1977
4	Buttercup family	Thalictrum	dasycarpum	Purple Meadow-rue	R	2		agriculture	1991
4	Buttercup family	Thalictrum	venulosum	Veiny Meadow-rue	?R	2		unknown	1949
4	Poppy family	Papaver	croceum	Saffron Poppy	U	2	39	horticulture	1949
4	Mustard family	Arabis	caucasica	Gray Rockcress	R	2		horticulture	2001
4	Mustard family	Arabis	glabra	Tower Mustard	?R	2	nr	transportation	1977
6	Mustard family	Armoracia	rusticana	Horse Radish	F	4			
3	Mustard family	Brassica	rapa	Bird's Rape	R	1	50	agriculture, revegetation	1980
4	Mustard family	Camelina	microcarpa	Little-pod False Flax	R	2	nr	unknown	1943
5	Mustard family	Camelina	sativa	Large-seeded False Flax	R	3	nr	agriculture	2007
3	Mustard family	Capsella	bursa-pastoris	Shepherd's Purse	С	1	40	agriculture	1916
4	Mustard family	Descurainia	sophia	Herb-Sophia	U	2	41	unknown	1943
5	Mustard family	Erysimum	cheiri	Wallflower	х	3		horticulture	2001
3	Mustard family	Hesperis	matronalis	Dames Rocket	R	2	41	horticulture	2010
3	Mustard family	Lepidium	ramosissimum	Branched Pepperwort	С	1	nr	unknown	1979
5	Mustard family	Lepidium	sativum	Garden Pepperwort	Х	3	nr	horticulture	1902
5	Mustard family	Neslia	paniculata	Yellow Ball-mustard	Х	3	nr	agriculture	1904
5	Mustard family	Rorippa	curvipes var. truncata	Blunt-leaved Yellowcress	R	3		unknown	1982
5	Mustard family	Sinapis	alba	White Mustard	Х	3	nr	unknown	1902
5	Mustard family	Sinapis	arvensis	Corn Mustard	R	3	36	unknown	2002
5	Mustard family	Sisymbrium	altissimum	Tall Hedge Mustard	R	3	nr	unknown	1916
3	Mustard family	Thlaspi	arvense	Field Pennycress	C	1	42	agriculture	1949
5	Rose family	Potentilla	biennis	Biennial Cinquefoil	X	3	nr	unknown	1902
2	Rose family	Prunus	padus	Maytree or European Bird Cherry	C	2	74	horticulture	2003
2	Rose family	Sorbaria	sorbifolia	False Spiraea	R	2	nr	horticulture	1992
2	Pea family	Astragalus	cicer	Chick-pea Milk-vetch	R	2	nr	revegetation	1995

Invasiveness Rank	Family	Genus	Species	Common Name	Abundance	Persistence	Alaska Rank	Source	Date of first collection
2	Pea family	Caragana	arborescens	Siberian Peashrub	R	2	74	horticulture	1949
3	Pea family	Lotus	corniculatus	Garden Bird's-foot Trefoil	R	3	63	revegetation	2000
1	Pea family	Medicago	falcata	Lucerne	С	1	64	argiculture	1967
3	Pea family	Medicago	lupulina	Black Medick	R	2	48	transportation	2007
2	Pea family	Medicago	sativa	Alfalfa	С	1	59	agriculture, revegetation	1980
1	Pea family	Melilotus	alba	White Sweetclover	С	1	81	agriculture	1935
1	Pea family	Melilotus	officinalis	Yellow Sweetclover	С	1	69	argiculture	1980
3	Pea family	Onobrychis	viciifolia	Common Sainfoin	R	2	nr	revegetation	1980
5	Pea family	Trifolium	cyathiferum	Cup Clover	х	3		agriculture	1902
2	Pea family	Trifolium	hybridum	Alsike Clover	С	1	57	agriculture, revegetation	1902
2	Pea family	Trifolium	pratense	Red Clover	С	1	53	agriculture, revegetation	1902
2	Pea family	Trifolium	repens	White Clover	С	1	59	agriculture, revegetation	1916
7	Pea family	Vicia	americana	American Vetch	?R	1		unknown	
3	Pea family	Vicia	angustifolia	Garden Vetch	R	2		unknown	1992
1	Pea family	Vicia	cracca	Tufted Vetch	С	2	73	agriculture, transportation, horticulture	1943
5	Pea family	Vicia	villosa	Wolly Vetch	х	3	53	unknown	1916
3	Maple family	Acer	negundo	Manitoba or Ash-leaf Maple	R	2	nr	horticulture	1998
1	Euphorbia family	Euphorbia	esula	Leafy Spurge	R	2	84	argiculture	1992
4	Violet family	Viola	tricolor	Johnny-jump-up	С	1	34	horticulture	1995
4	Oleaster family	Hippophae	rhamnoides	Sea-Buckthorn	R	2		horticulture	2007
3	Carrot family	Heracleum	sibiricum	Siberian Cow-parsnip	R	2		unknown	1991
5	Carrot family	Pastinaca	sativa	Wild parsnip	R	3	nr	agriculture	1949
3	Mallow family	Malva	neglecta	Common Mallow	R	2	nr	agriculture	2008
5	Jacob's ladder family	Gilia	capitata	Blue-headed Gily Flower	x	3		unknown	1902
3	Forget-me-not family	Amsinckia	menziesii	Menzies' Fiddleneck	R	2	nr	unknown	1943
5	Forget-me-not family	Asperugo	procumbens	German Mad-wort	х	3	nr	horticulture	1949
7	Forget-me-not family	Hackelia	deflexa	Nodding Stickseed	?X	3		unknown	
3	Forget-me-not family	Lappula	squarrosa	European Stickseed	U	2	44	unknown	1973
5	Forget-me-not family	Myosotis	scorpioides	True Forget-me-not	R	3	54	horticulture	2000
7	Forget-me-not family	Plagiobothrys	scouleri	Scouler's Popcornflower	?R	3		unknown	
6	Verbena family	Verbena	hastata var. scabra	Simpler's-Joy	F	4			
5	Mint family	Dracocephalum	thymiflorum	Thyme-flowered Dragonhead	R	3	nr	agriculture	1949
3	Mint family	Galeopsis	tetrahit var. bifida	Bifid Hemp-nettle	R	1	50	revegetation, horticulture	1980
4	Mint family	Lamium	amplexicaule	Common Dead-nettle	R	3	nr	horticulture	2007
7	Mint family	Stachys	pilosa	Hedge-nettle	?R	2		unknown	1
1	Figwort family	Linaria	dalmatica	Dalmatian Toadflax	X	3	58	unknown	2004
1	Figwort family	Linaria	vulgaris	Butter-and-Eggs	C	1	69	horticulture	1970
5	Figwort family	Veronica	arvensis	Corn Speedwell	R	3		unknown	1970
4	Figwort family	Veronica	longifolia	Long-leaf Speedwell	R	2	nr	agriculture, horticulture	1980
5	Figwort family	Veronica	serpyllifolia	Thyme-leaf Dragonhead	R	3	36	unknown	1970

Invasiveness Rank	Family	Genus	Species	Common Name	Abundance	Persistence	Alaska Rank	Source	Date of first collection
5	Plantain family	Plantago	aristata	Large-bract Plantain	х	3		unknown	1902
7	Plantain family	Plantago	major	Great Plantain	?C	1	44	unknown	
5	Bedstraw family	Galium	aparine	Sticky-willy	х	3		agriculture (birdseed)	2007
6	Bedstraw family	Galium	palustre	Common Marsh Bedstraw	F	4			
3	Valerian family	Valeriana	officinalis	Garden Valerian or Allheal	R	2	nr	horticulture	2007
4	Sunflower family	Achillea	ptarmica	Sneezeweed	R	2	46	horticulture	2011
5	Sunflower family	Anthemis	cotula	Stinking Chamomile	х	3	41	agriculture	1902
7	Sunflower family	Artemisia	biennis	Biennial Wormwood	R	4	nr	unknown	
5	Sunflower family	Centaurea	cyanus	Cornflower	х	3		horticulture	1998
1	Sunflower family	Centaurea	stoebe	Spotted Knapweed	х	3	86	unknown	1995
5	Sunflower family	Chrysanthemum	ircutianum	Early Daisy	х	3		unknown	1949
1	Sunflower family	Leucanthemum	vulgare	Oxeye daisy	R	1	61	horticulture, transportation	1980
1	Sunflower family	Cirsium	arvense	Creeping (Canada) Thistle	R	2	76	transportation	1995
5	Sunflower family	Crepis	capillaris	Smooth Hawksbeard	х	3	nr	transportation	1998
1	Sunflower family	Crepis	tectorum	Narrow-leaved Hawksbeard	С	1	56	transportation	1957
4	Sunflower family	Gaillardia	aristata	Great Blanket-flower	R	2	nr	agriculture	1973
7	Sunflower family	Gnaphalium	uliginosum	Marsh Cudweed	?R	2	nr	unknown	
5	Sunflower family	Helianthus	subrhomboideus	Stiff Sunflower	х	3		unknown	1904
1	Sunflower family	Hieracium	caespitosum	Field Hawkweed	R	2	79	transportation	2009
5	Sunflower family	Madia	glomerata	Mountain Tarplant	х	3	nr	unknown	1902
3	Sunflower family	Matricaria	discoidea	Pineapple Weed	С	1	32	unknown	1902
1	Sunflower family	Tripleurospermum	inodoratum	Scentless Chamomile	R	1	48	unknown	1980
5	Sunflower family	Senecio	eremophilus	Dryland Ragwort	R	3		transportation	1968
3	Sunflower family	Senecio	vulgaris	Common Ragwort	R	2	36	horticulture, agriculture	1902
1	Sunflower family	Sonchus	arvensis ssp. uliginosus	Field Sow-thistle	С	1	73	unknown	1980
2	Sunflower family	Sonchus	asper	Prickly Sow-thsitle	R	2	46	horticulture	1904
6	Sunflower family	Sonchus	oleraceus	Common Sow-thistle	F	4	46		
1	Sunflower family	Tanacetum	vulgare	Common Tansy	U	2	60	horticulture, transportation	1995
4	Sunflower family	Taraxacum	erythrospermum	Red-seeded Dandelion	Х	2		unknown	1949
2	Sunflower family	Taraxacum	officinale	Common Dandelion	С	1	58	unknown	1943
2	Sunflower family	Tragopogon	dubius	Yellow Goat'sbeard	R	2	50	transportation	1995

# **Appendix 8: Minto Mine Vegetation Metal Uptake Monitoring Plan**



## VEGETATION METAL UPTAKE MONITORING PLAN

FOR MINTO MINE

September 2015

Prepared for:

MINTO EXPLORATIONS LTD.



## TABLE OF CONTENTS

3 VMU MONITORING PLAN DEVELOPMENT	3
3.1 DOCUMENT REVIEW	3
3.2 STUDY AREA AND MONITORING NETWORK	5
3.3 SELECTED TARGET VEGETATION SPECIES	7
3.4 METALS OF CONCERN	7
4 DETAILED VMU MONITORING PLAN	8
4.1 MONITORING NETWORK	8
4.2 METHODOLOGY	10
4.2.1 Microsite Selection	
4.2.2 Soil Sampling	
4.2.3 Vegetation Sampling	
4.2.4 Laboratory Analysis - Sample Preparation	
	12
4.3 SCHEDULE 4.4 QUALITY CONTROL AND QUALITY ASSURANCE (QA/QC)	



## LIST OF TABLES

Table 1: Documents Reviewed	4
Table 2: Selected Species	7

## LIST OF FIGURES

Figure 1: Minto Wind Rose Plot April to October 2010-2015 (partial)	5
Figure 2: Proposed Monitoring Network for VMU Monitoring Program for Minto Mine	<b>;</b>

#### LIST OF APPENDICES

APPENDIX A CONTROL PLOT SUMMARIES

APPENDIX B SOIL AND VEGETATION LAB RESULTS 2009-10

APPENDIX C ACCESS ECOSYSTEM FORM



## **1** INTRODUCTION

Heavy metal contamination on mine sites is a common issue due to both the extraction of highly mineralized rock, which is transported, milled and stored in these areas, and the exposure of mined materials to environmental influences. Metals can leach from mining waste into the immediate aquatic environment via direct surface water runoff or infiltration of precipitation (aqueous transport). In terrestrial systems, in-situ soils may already have heightened concentrations of metals due to local mineralization of the surficial parent material. Dust from blasting, ore crushing and waste dumping, can be wind (aeolian) transported to surrounding terrestrial areas, settling on the ground and the surface of plant leaves, stems and fruits. These receiving environments can, over time, accumulate contaminants to the point that biological functioning can be affected in aquatic and terrestrial ecosystems.

The potential for these effects, and the degree to which they occur, are a function of a number of variables, and the accumulation processes can be highly complex. Generally speaking, plants can become intermediaries or vectors in transferring heavy metals to higher trophic levels when consumed by herbivores, which in turn become prey for carnivorous species. Harvesting and consumption of country foods by humans can also present an exposure pathway.

Monitoring of metal uptake in plants in mining areas has been used to assess potential and ongoing risks to these receptors. Understanding this potential can be useful in guiding mine operations.

Access Consulting Group (ACG) was retained by Minto Explorations Ltd (Minto) to develop a Vegetation Metals Uptake (VMU) Monitoring Plan (the Plan). The Plan is required by the Government of Yukon, Department of Energy Mines, and Resources (EMR), to form part of the revised Minto Phase V/VI Environmental, Monitoring, Surveillance and Reporting Plan (EMSRP). Specifically, the VMU Monitoring Plan will meet requirement (d) of EMR's Plan Requirement Letter (December, 2014). to Minto which specifies that the following be submitted:

a program for monitoring and measuring metal uptake in vegetation on the mine site, and in areas surrounding the mine site.



## **2 PROGRAM OBJECTIVES**

The main objective of the VMU Monitoring Program is to develop and execute a plan that monitors and measures metal uptake in vegetation on the mine site and surrounding areas that:

- Utilizes previously established or documented conditions, monitoring results or predictive efforts, where appropriate and possible;
- Establishes a network of plots for monitoring both soil and vegetation metal concentrations; and
- Allows for an ongoing evaluation of the extent and degree that metals from mining activity is affecting vegetation in the proximity of the project site.



## **3 VMU MONITORING PLAN DEVELOPMENT**

A number of tasks were undertaken as part of the development of a VMU Monitoring Plan for the Minto Mine. These tasks were scoped to result in a detailed VMU Monitoring Plan (Section 4) that met the program objectives presented previously in Section 2:

- Review relevant previous work (management plans, monitoring information, predictive modeling) for the mine site;
- Identify a study area based on this previous review;
- Identify potential exposure pathways for metals through vegetation;
- Select vegetation species to monitor based on exposure pathways and documented or expected use;
- Identify metals of concern for focus in the analysis; and
- Formulate a detailed vegetation metal uptake monitoring plan.

The following sections provide more information regarding these tasks and the key aspects considered in the development of a meaningful VMU Monitoring Plan for the Minto Mine.

#### **3.1 DOCUMENT REVIEW**

To help inform the development of the VMU Monitoring Plan, ACG reviewed a number of existing documents that were potentially relevant. Table 1 outlines the documents reviewed, and delineates how information was used or incorporated into the Plan.



#### Table 1: Documents Reviewed

Document Review	Potentially Relevant Information	Use in VMU Monitoring Plan
Access Consulting Group. 2010. Minto Mine Environmental Baseline Ecosystems and Vegetation Report	Ten soil samples were collected from the following ecological plots: M07, M29, M35, M54, M54A, M76A, M80, M84, M85, M90A, and M93. These are permanent plots with full description of ecological parameters.	Some of these plots can be used as controls to determine natural background metal concentrations or sampling sites. Need to revisit previously established ecoplots as per recommendations to monitor ecological changes and collect plant samples.
2010 Reclamation Research Report by Access Consulting Group	Lab analysis of 12 soil samples for metals, nutrient levels and texture. Soil samples from revegetation plots. Metal analysis of grasses used in revegetation and naturally regenerating willows.	Gives metal concentrations of soils within project area, can be used to augment sample size of soil samples taken in VMU program. Gives indication of willow and grass uptake of specific metals in three locations within the project site.
2007, 2008 and 2009 Revegetation Trial Reports by Stu Withers/Access Consulting Group	Two soil samples were collected from the overburden stockpile in late March 2007 and were analyze for texture, metals (ICP Method) and nutrients. The analysis results were similar for both samples, with both looking reasonably good for reclamation purposes. (ACG, 2007)	Additional soils data for metal content, furthers characterization of soils on site.
Minto Mine Phase V/VI, YESAB Project Proposal, Minto Climate Baseline Report, 2014	Provides meteorology data and climate trends, such as; prevailing wind directions, precipitation and temperature.	Important information on which to formulate VMU plan for sampling sites based on dust source locations and prevailing wind direction.
Minto Mine Phase V/VI Reclamation and Closure Plan version 5.1	Reclamation schedule indicates timing of closure for specific dust sources. Health and safety objectives	Guides VMU plan objectives in the future, and contributes an understanding of projected revegetation efforts and waste cover prescriptions, that will reduce dust sources and runoff.
Vegetation Metal Uptake studies completed for Casino baseline, Keno closure and during Red Dog mine operations.	To ensure the degree of detail for VMU is consistent with other mineral extraction projects in northern jurisdictions.	To check VMU procedures and EMR expectations.




### **3.2 STUDY AREA AND MONITORING NETWORK**

The identification of a study area took the following elements into consideration:

- 1. Area of direct disturbance (and reclamation) by mining activities;
- 2. Previous monitoring locations;
- 3. Access road/ground based access to monitored areas was preferential; and
- 4. Anticipated dispersal mechanisms and extent of metal contamination.

The proposed VMU monitoring network is presented in Figure 2 in Section 4.1. The VMU sampling sites were selected in the areas anticipated to receive higher density dust fallout, and control or outlying stations were positioned outside of the projected dispersion area. This involved utilizing, where possible and accessible, ecosystem plots established in 2010 where soil and vegetation information data were collected. The stations to be monitored are divided into 'site' stations (within or upon the direct mine footprint area) and 'control' stations (outside the anticipated zone of influence of the mining activities.)The proposed monitoring station network is presented in Section 4.1.

The meteorological data collected on site, over a five year period, shows that the prevailing winds between April to October are from the northwest and the southeast (Figure 1). The areas that have been observed to generate the greatest loads of dust are the crushing and conveying infrastructure areas near the mill. To a much lesser degree, pit blasting and waste rock dumping would also contribute to dust loading and dispersion. To this end, the VMU sampling sites have been located in vegetated areas near the perimeter of these dust sources and extend roughly along a NW to SE axis.

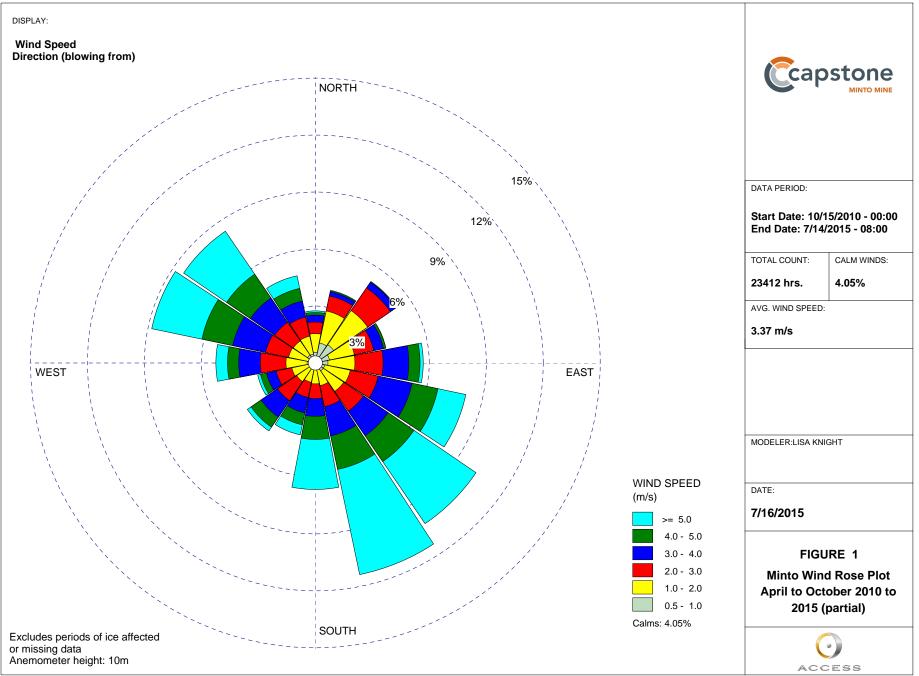

WRPLOT View - Lakes Environmental Software



### **3.3 SELECTED TARGET VEGETATION SPECIES**

There are numerous plants species that are either known or expected to be consumed directly by wildlife in the study area. To a lesser degree, there are some plant species in the study area which are known to be consumed by humans as part of traditional gathering in other areas. Actual anticipated future use, particularly by humans in traditional gathering is uncertain, however key species in both of these areas of potential exposure have been selected for monitoring. A review of other vegetation metal uptake programs as outlined in Table 1 also informed the species selection. The selected species and the rationale is provided in Table 2 below.

#### Table 2: Selected Species

Target Plants	Plant Part to be Collected	Rationale for Selection
Willows (Salix spp.)	Leaves	Moose browse
Horsetail (Equisetum spp.)	Plant	Moose browse
Blueberries (Vaccinium spp.) or Soapberries	Fruit	Human gathering/bear forage
Grasses (Species used in revegetation)	Culm and leaves, roots	Used for revegetation, potential for browse for a variety of species

### **3.4 METALS OF CONCERN**

Based on the Canadian Council of Ministry of Environment (CCME), the Yukon <u>Environment Act</u> and U.S. Environmental Protection Agency (U.S. EPA) certain metals are identified Constituents of Potential Concern (COPC), since exposure and/or bioaccumulation to relatively high concentrations of these elements can resulted in damage to plants, aquatic organisms, terrestrial wildlife, and human health. Of these COPC, only the metals that are known to have elevated concentrations as compared to background levels at the Minto site are of interest. It should be noted that toxic effects usually require persistent exposure to high concentrations of the metals listed, and that as a confirmed mineralized area, elevated metals concentrations in soil (and to some degree in vegetation) are indeed expected in the baseline condition in the vicinity of the mine site, as noted previously.

Initial analysis will focus on metals listed below that have been identified as occurring at the Minto mine site during previous soil sampling done in 2009 and 2010 (Appendix B). These metals are considered to be COPC according to CCME. This list may be revised based on the results of the first sampling event as the program proceeds in the future:

Aluminum (Al), Antimony (Sb), Arsenic (As), Cadmium (Cd), Chromium (Cr), Copper (Cu), Iron (Fe), Lead (Pb), Manganese (Mn), Mercury (Hg), Molybdenum (Mo), Nickle (Ni), Silver (Ag), Zinc (Zn), and Selenium (Se).



## 4 DETAILED VMU MONITORING PLAN

The following sections present the detailed elements of the VMU Monitoring Plan. This section has been developed to allow competent monitors to execute the program using consistent methods that allow for comparison between sampling events.


#### **4.1 MONITORING NETWORK**

The network of monitoring stations is presented on Figure 2. Stations are either designated as site (exposure) or control stations. Progression of the mine plan (waste dump covering) and analysis of the monitoring results may result in recommendations for additional monitoring locations. For example, progressive reclamation of waste dumps may allow for areas that have been revegetated to be included into the monitoring network.

Dust dispersal is predicted to be spread unevenly due to local meteorological influences. The two predominant wind directions at site are S to SE and N to NW. Average wind speed is 2.64 m/s at 3 m height and 2.9 m/s at 10 m. In addition, the local topography is varied and different mining sources produce particular matter of different sizes at different rates. Site sampling stations are located in areas anticipated to accumulate the most dust based on meteorological data collected at site.

Three of the four control plots selected for the VMU monitoring network were established during 2010 ecosystem mapping (M07, M80 and M90A). Summaries of these plots ecological characteristics can be found in Appendix A. Also, results of soil analysis for metal concentration, pH, texture and nutrient parameters for these control plots are provided in Appendix B. The fourth control plot selected is adjacent to the water quality station C4 which is approximately two km downstream of the dam on Minto Creek. The control at C4 will need to be established and its ecological properties recorded and soils tested to the same level as the other control plots. A sample Ecosystem Data form is provided in Appendix C.



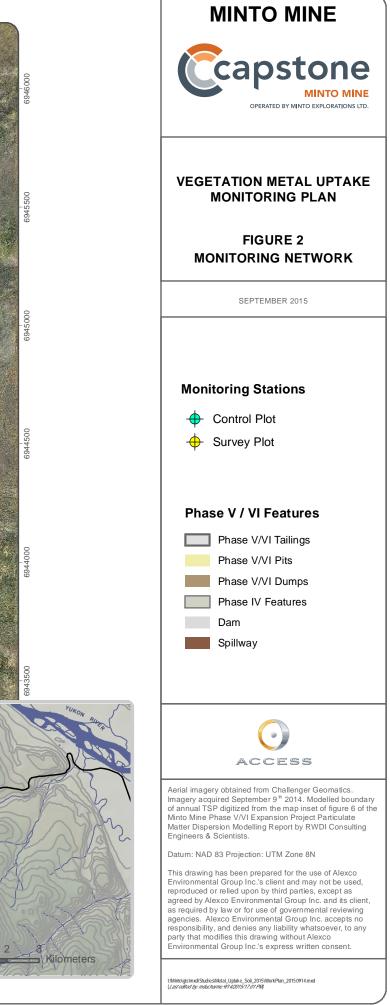



### 4.2 METHODOLOGY

Observations and sampling at each station will include the following steps:

- 1. Selection of an appropriate microsite in the vicinity of the station identified on the map;
- 2. Generation of a station ID and documenting relevant ecological attributes of the station area (see Appendix C);
- 3. Soil sampling; and
- 4. Vegetation sampling.

#### 4.2.1 Microsite Selection

The points provided as UTM coordinates and on the map are meant to guide the sampler to a vicinity not to an exact point. The sampler(s) must use their best judgement of the appropriateness of each microsite based on ground conditions. The following steps and considerations should be followed in selecting and documenting a microsite:

- 1. Locations that have been disturbed to the extent that soil is exposed and vegetation is damaged should be avoided;
- 2. The microsite should have at least two of the plant species listed in Table 2;
- 3. Look around the general location to find a relatively undisturbed site where soil pedon are not fragmented and vegetation is established (early successional communities are fine);
- 4. Situate the soil pit where the roots of the plants to be sampled are present;
- 5. Hang two pieces of flagging tape at the plot with the plot number, project, and date to ease relocation for future monitoring.
- 6. GPS the location with station ID and note coordinates; and
- 7. Fill out ecological attribute form for station, including:
  - a. Mesoslope position, slope and aspect;
  - b. Dominant vegetation and main cover heights;
  - c. Plant species sampled;
  - d. Successional stage;
  - e. Signs of wildlife diggings, browsing and/or grazing;



- f. Signs of site disturbance;
- g. Distance from possible dust source (can be determined from map); and
- h. Take photographs of soil pit and a representative shot of the site.

#### 4.2.2 Soil Sampling

The depth of soil sampling is contingent upon the drainage properties of soils, amount of precipitation, and migration ability of metal ions. The soil textures common in the Minto area are silty to sandy loams. The area is semi-arid receiving an average annual rainfall of 1.74 cm. Due to these conditions, soil samples should be collected from the top surface layer of mineral soil at a depth of 4–10 cm (within the rooting zone of plants to be sampled) and again at 20-30 cm, where possible, to determine migration potential of specific metals through the pedon. If soils are not deep, try to obtain one sample in the rooting zone and one about 10 cm deeper, if this is still not possible then collect soils in the rooting zone.

The inductively coupled plasma mass spectrometry (ICP-MS) analysis for metal concentrations is sensitive in detecting concentrations in the range of micrograms per kilogram. Due to this level of sensitivity, cross contamination of soil samples needs to be carefully avoided throughout sample collection and shipping or results will be compromised. The following protocol for soil sampling needs to be follow to ensure soil samples are of high quality:

- 1. If possible, one member of the field sampling team can fill out site data sheets, take photographs and collect vegetation samples, while the other member(s) collects the soil samples.
- 2. Sample collection activities shall proceed progressively from the least suspected contaminated area to the most suspected contaminated area.
- 3. Dig a soil pit to a depth of 40 cm. After a soil pit is dug, scrape the vertical surface where soil will be extracted with a clean trowel or knife. This is necessary to minimize the effects of contamination due to smearing of material from other levels. Start with the lower sample depth at 25 cm, clean tools and change gloves before taking the next sample in the rooting zone at 4-10 cm depth.
- 4. A clean pair of nitrile disposable gloves should be worn each time a different soil sample is collected and digging tools cleaned with deionized water and paper towels prior to each soil sample taken. The gloves should be donned immediately prior to sampling.
- 5. Put approximately 300 g or four cups of soil in a fresh plastic sample bag which should be labeled with sample site identifier, date, project number and sampler's initials. Labs usually supply these bags. Ensure sample bags are well sealed so no soil can leak out.
- 6. Sample bags with soils suspected of containing high concentrations of contaminants shall be handled and stored separately from control samples and vegetation samples. And,
- 7. Keep all samples cool and out of the light. Coolers with ice packs will suffice for storage, but samples should be sent to the lab within five days of collection date.



### 4.2.3 Vegetation Sampling

Table 2 in Section 3.3 identifies which parts of the plant should be sampled. Vegetation samples should be collected in plastic bags provided by the laboratory, and stored in a cool dark location until shipped. For each vegetation sample a minimum of 150 g should be collected from the plants or approximately four compacted handfuls. Sample only healthy mature leaves or berries, avoid collecting old, dead or damaged leaves.

It is best that the person collecting vegetation samples is not the same person sampling soils, as residual soils can be left on clothing, hair and hands, which could be unintentionally transferred to the plant material. Use fresh nitrile gloves for each plant collection. Leaves can be stripped off branches of willows. Horsetails can be pinched off just above ground level.

Grasses can be also cut (use stainless steel or ceramic knife washed with deionized water prior to each collection) about 2 cm above ground avoid including dead plant material. Grass root samples are to be collected to determine intermediate uptake in the root systems. Shake dirt from roots prior to putting into sample bag. The lab will wash the remaining soil off the roots before analysis.

#### 4.2.4 Laboratory Analysis - Sample Preparation

The evaluation of metal uptake in plants versus metal accumulation on plant surface due to dust dispersal requires that the lab prepare samples in a specific manner. These following directions need to be clearly communicated to the lab on receipt of soil and vegetation samples.

Plant samples (leaves and berries) have been gathered to determine the effects of dust settlement from potential mine sources on nearby vegetation. In order to understand the degree of metal contamination being contribute by dust, each vegetation sample needs to be divided in two (except for root samples). Only one half of each vegetation sample is to be wash prior to ICP-MS analysis. The remaining half of the vegetation sample is not washed or prepared in a manner that would remove surface dust. The unwashed vegetation analysis will then reflect the total amount of contaminates both external and internal. The analysis of the washed half of the sample will reflect only metal contaminants residing within the plant tissues. The difference between the two sets of results will give the amount of contaminants that were dust-borne.

Soil samples will be dealt with as per usual by the lab prior to metal analysis. Other parameters to be obtained for each soil sample by lab analysis include: pH, texture and cation exchange capacity (CEC).

#### 4.3 SCHEDULE

This monitoring should take place in July or early August of any given year before seasonal desiccation of vegetative material occurs. Continued monitoring should occur every three years after initial study, to determine any changes in dust dispersal and vegetation metal uptake.



## 4.4 QUALITY CONTROL AND QUALITY ASSURANCE (QA/QC)

There are eighteen sites selected for vegetation and soil sampling. At two of these sites duplicate samples should be taken and submitted to the lab under a pseudonym sample number. The lab results will be compared to ensure that the lab procedures and results are consistent. All other QA/QC protocols have been identified in the sampling methodology in the previous section.

#### **4.5 REPORTING AND EVALUATION**

Existing and gathered soils and vegetation data will be compiled into a workable data base. Soil and plant tissue metal concentrations results will be compared to CCME guidelines (as a benchmark), and site station data statistics will be compared with the control station data located outside of the zone of influence. Other soil and vegetation metal concentrations taken in previous studies will be used to make the sample pool more robust for comparative analysis and definition of patterns occurring in vegetation metal uptake.

Results will be presented with an interpretation in the Project's Annual Report under the Quartz Mining License.



### **5 R**EFERENCES

- Access Consulting Group, 2007. Minto Mine, Reclamation Research Program, Detailed Decommissioning and Reclamation Plan, 2007 Activities. Prepared for Minto Explorations Ltd., a subsidiary of Capstone Mining Ltd.
- Access Consulting Group, 2008. Minto Mine, Reclamation Research Program, Detailed Decommissioning and Reclamation Plan, 2008 Activities. Prepared for Minto Explorations Ltd., a subsidiary of Capstone Mining Ltd.
- Access Consulting Group, 2009. Minto Mine, Reclamation Research Program, Detailed Decommissioning and Reclamation Plan, 2009 Activities. Prepared for Minto Explorations Ltd., a subsidiary of Capstone Mining Ltd.
- Access Consulting Group, 2010. Minto Mine, Reclamation Research Program, Detailed Decommissioning and Reclamation Plan, 2010 Activities. Prepared for Minto Explorations Ltd., a subsidiary of Capstone Mining Ltd.
- Access Consulting Group, 2010. Minto Mine, Reclamation Research Program, Decommissioning and Reclamation Plan, 2010 Activities. Prepared for Minto Explorations Ltd., a subsidiary of Capstone Mining Ltd.
- Access Consulting Group, 2012. Keno District Soils and Vegetation Metals. Prepared for Elsa Reclamation and Development Company.
- Access Consulting Group, 2014. Minto Mine Phase V/Vl, YESAB Project Proposal, Minto Climate Baseline Report.
- CACAR II. 2003. Canadian Arctic Contaminants Assessment Report (CACAR) II, Northern Contaminants Program, Indian Affairs and Northern Development, Ottawa.
- Canadian Council of Ministers of the Environment (CCME). 1999a. *Canadian Environmental Quality Guidelines*. Canadian Council of Ministers of the Environment. Winnipeg, MB.
- Canadian Council of Ministers of the Environment (CCME). 2006. Canadian soil quality guidelines for the protection of environment and human health: Introduction. In Canadian Council of Ministers of the Environment. *Canadian environmental quality guidelines*. Winnipeg, MB.
- Carter, M.R, and E. G. Gregorich, Eds. 2008. Canadian Society of Soil Science. Sampling and Methods of Analysis 2nd ed. Taylor & Francis Group, LLC.
- Environmental Dynamics Inc. (EDI), 2013. Casino Project: Vegetation Baseline Report. Project #: 13-Y-0045, Yukon.
- Gamberg, M. 2008. Contaminants in Arctic Moose and Caribou 2006. Technical Report. Northern Contaminants Program.



Horizon Ecosystem Consultants, 2010. Minto Mine Environmental Baseline Ecosystems and Vegetation Report.

Teck Cominco, 2005. Summary of Mine Related Fugitive Dust Studies. Red Dog Mine, Alaska.

# **APPENDIX A**

**CONTROL PLOT SUMMARIES** 

#### PLOT M07



Status: Permanent (Control, soil sampled)

Location: UTM: 0383864E, 6944289N

## **Vegetation Plot Summary**

Shrub species cover	$At_5Pl_4W_1$
Age in years (dominant species)	20
Height in meters (avg dominant species)	8
Soil moisture and nutrient values (SMR/SNR)	3/C
Crown cover for polygon in %	40
Succession Stage	Young forest
Aspect ( <sup>0</sup> )	204
Elevation (m)	890
Slope %	22
Meso slope position	Upper
Drainage	Well
Coarse woody debris%/Snags#	11/2

**Site description:** South west facing open forest. Fire regeneration. Bare ground ~20% covered with leaf litter. Poorly developed herb layer, 6% grass (Calamagrostis purpurascens).

Plant community: Trembling Aspen – Pine - Bunchgrass

**Comments**: Selected control for mixed aspen/pine forest, southern aspect, outside of mine influences.

#### **PLOT M80**



**Status:** Permanent (Control, soil sampled)

Location: UTM: 0384380E, 6947083N

### **Vegetation Plot Summary**

Shrub species cover	$PI_5W_3At_2$
Age in years (dominant species)	15
Height in meters (avg dominant species)	5
Soil moisture and nutrient values (SMR/SNR)	3/В
Crown cover for polygon in %	40
Succession Stage	Young forest
Aspect ( <sup>0</sup> )	140
Elevation (m)	817
Slope %	10
Meso slope position	Middle
Drainage	Well
Coarse woody debris%/Snags#	5/0

**Site description:** South east facing slope, poorly developed herb layer, mainly moss/lichen with bare soil patches, about 10% exposed rocks.

Plant community: Pine - Willow - Aspen

**Comments**: Helicopter access

## PLOT M90A



**Status:** Permanent (soil sample)

Location: UTM: 0387045E, 6947197N

## **Vegetation Plot Summary**

Plant species cover	$At_5Sw_3Pl_2$
Age in years (dominant species)	75
Height in meters (avg dominant species)	10
Soil moisture and nutrient values (SMR/SNR)	3/C
Crown cover for polygon in %	40
Succession Stage	Mature forest
Aspect ( <sup>0</sup> )	179
Elevation (m)	792
Slope %	22
Meso slope position	Middle
Drainage	Well
Coarse woody debris%/Snags#	2/1

**Site description**: South facing slope ground cover predominantly kinnikinnick (*Arctostaphylos uva-ursi*) and grass (*Calamagrostis purpurascens*). Large canopy gaps with grassland attributes

Plant community: Aspen - White Spruce - Pine (grassland)

**Comments:** Minto Road 200m south of plot

# **APPENDIX B**

SOIL AND VEGETATION LAB RESULTS 2009 AND 2010



Your Project #: MIN-09-05 REVEGETATION MONITOR Your C.O.C. #: 08304612, F143924, F143925

#### Attention: Colleen Roche

MINTO EXPLORATIONS LTD. #900 - 999 WEST HASTINGS ST. VANCOUVER, BC CANADA V6C2W2

Report Date: 2009/10/06

#### **CERTIFICATE OF ANALYSIS**

#### **MAXXAM JOB #: A953654** Received: 2009/09/25, 01:05

Sample Matrix: Soil # Samples Received: 3

		Date	Date		
Analyses	Quantity	Extracted	Analyzed	Laboratory Method	Analytical Method
Cation Exchange Capacity ()	3	2009/10/02	2009/10/06	EENVSOP-00034	EPA SW846 6010C
Conductivity (Soluble)	3	2009/09/30	2009/10/01	BRN SOP-00267 R3.0	Based Carter 18.3.1
Elements by ICPMS (total)	3	2009/10/01	2009/10/01	BRN SOP-00203 R5.0	Based on EPA 200.8
pH (2:1 DI Water Extract)	3	2009/10/01	2009/10/01	BRN SOP-00266 R6.0	Carter, SSMA 16.2
Saturated Paste	3	2009/09/30	2009/10/01	BRN SOP-00268 R5.0	Carter SSMA 18.2.2
Sublet (ORGANICS) Ø	3	N/A	2009/10/05		
Total Kjeldahl Nitrogen - Soil (14)	3	2009/10/02	2009/10/02	CAL SOP-00072	SM - 4500N
TOC Soil Subcontract g	3	2009/10/02	2009/10/02		

Sample Matrix: VEGETABLES # Samples Received: 24

		Date	Date		
Analyses	Quantity	Extracted	Analyzed	Laboratory Method	Analytical Method
Elements by CRC ICPMS (total) - Plant	24	2009/10/02	2009/10/02	BRN SOP-00206 R7.0	Based on EPA 200.8

\* Results relate only to the items tested.

(1) This test was performed by Maxxam Calgary

(2) This test was performed by Ext. Sublet from Vancouver

(3) This test was performed by Maxxam Bedford(From Burnaby)

(4) SCC/CAEAL

Encryption Key

Please direct all questions regarding this Certificate of Analysis to your Project Manager.

VIREN THAKER, BBY Customer Service Email: VIREN.THAKER@MaxxamAnalytics.com Phone# (604) 444-4808 Ext:232

Maxxam has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per section 5.10.2 of ISO/IEC 17025:2005(E), signing the reports. SCC and CALA have approved this reporting process and electronic report format.

Total cover pages: 1 Maxxam Analytics International Corporation o/a Maxxam Analytics Burnaby: 8577 Commerce Court V5A 4N5 Telephone(604) 444-4808 Fax(604) 444-4511



WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

Maxxam Job #: A953654 Report Date: 2009/10/06

#### **RESULTS OF CHEMICAL ANALYSES OF SOIL**

Maxxam ID		Q95936		Q95937	Q95938		
Sampling Date		2009/09/21		2009/09/21	2009/09/21		
	Units	TOE OF TAILINGS SOIL	QC Batch	SOIL SAMPLE LOWER IROD	SOIL SAMPLE UPPER IROD	RDL	QC Batch
Misc. Inorganics							
Total Kjeldahl Nitrogen	mg/kg	3500(1)	3461533	1500(1)	570(1)	100	3461533
Parameter							
Subcontract Parameter	N/A	ATTACHED	3463366	ATTACHED	ATTACHED	N/A	3465804
Elements				-	-		
Cation exchange capacity	cmol+/Kg	35	3461568	24	16	10	3461568
Soluble Parameters							
Soluble Conductivity	uS/cm	2580	3456164	402	284	1	3456164
Saturation %	%	160	3455655	57	47	1	3455655

N/A = Not Applicable

RDL = Reportable Detection Limit

(1) - Detection limits raised due to dilution to bring analyte within the calibrated range.



WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

Maxxam Job #: A953654 Report Date: 2009/10/06

### ELEMENTS BY ATOMIC SPECTROSCOPY (VEGETABLES)

Maxxam ID		Q95926	Q95927	Q95928	Q95929	Q95930	Q95931	Q95932	Q95933	Q95934		
Sampling Date		2009/09/22	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21		
	Units	YUKON RIVER PLANE-LEAF WILLOW LEAVES	COPPER KEEL BIRCH TWIGS	COPPER KEEL BIRCH LEAVES	WASTE ROCK DUMP 1ST LEVEL LEAF WILLLOW TWIGS	TOE OF WASTE ROCK 1ST LIFT WILLOW TWIGS (LITTLE TREE)	PLANE-LEAF WILLOW TOE OF WASTE ROCK DUMP 1ST LEVEL	TOE OF WASTE ROCK DUMP-WILLOW LEAVES (LITTLE)	YUKON RIVER LITTLE TREE	YUKON RIVER LITTLE TREE WILLOW TWIGS	RDL	QC Batch
Total Metals by ICPMS			•		•	•		•	•			
Total Aluminum (Al)	mg/kg	46	27	34	149	158	1740	1120	40	17	1	3461873
Total Antimony (Sb)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Arsenic (As)	mg/kg	0.10	<0.01	0.01	0.07	0.07	0.66	0.40	0.04	0.02	0.01	3461873
Total Barium (Ba)	mg/kg	14.8	58.9	143	3.9	4.7	20.3	13.9	109	8.9	0.1	3461873
Total Beryllium (Be)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Bismuth (Bi)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Boron (B)	mg/kg	50	8	47	12	8	25	26	73	9	5	3461873
Total Cadmium (Cd)	mg/kg	0.51	0.06	0.03	1.15	1.68	2.92	4.78	6.77	0.20	0.01	3461873
Total Calcium (Ca)	mg/kg	28200	6330	20200	6780	3570	41100	19200	31700	6410	10	3461873
Total Chromium (Cr)	mg/kg	1.4	<0.5	<0.5	<0.5	<0.5	1.5	<0.5	<0.5	<0.5	0.5	3461873
Total Cobalt (Co)	mg/kg	0.4	<0.1	<0.1	0.1	0.2	1.0	1.3	0.2	<0.1	0.1	3461873
Total Copper (Cu)	mg/kg	7.7	7.2	6.6	20.4	18.8	145	96.5	3.5	7.5	0.5	3461873
Total Iron (Fe)	mg/kg	97	71	71	199	216	2280	1540	73	33	10	3461873
Total Lead (Pb)	mg/kg	0.19	0.07	0.06	0.08	0.07	0.65	0.48	0.14	0.09	0.01	3461873
Total Magnesium (Mg)	mg/kg	5210	606	1840	1020	692	8880	6400	4180	743	10	3461873
Total Manganese (Mn)	mg/kg	37.9	22.2	107	55.1	83.5	447	954	136	5.8	0.1	3461873
Total Mercury (Hg)	mg/kg	0.02	<0.01	0.01	<0.01	<0.01	0.02	0.02	0.02	<0.01	0.01	3461873
Total Molybdenum (Mo)	mg/kg	1.1	<0.1	0.4	<0.1	0.1	1.3	2.1	1.8	<0.1	0.1	3461873
Total Nickel (Ni)	mg/kg	3.0	0.3	0.2	0.6	0.6	1.7	1.6	0.7	0.8	0.1	3461873
Total Phosphorus (P)	mg/kg	4270	1350	1420	920	890	856	1100	6820	1330	10	3461873
Total Potassium (K)	mg/kg	8270	2410	6090	2710	2330	9460	8170	3700	2560	10	3461873
Total Selenium (Se)	mg/kg	0.89	0.02	0.01	0.99	0.27	3.77	1.00	0.29	0.30	0.01	3461873
Total Silver (Ag)	mg/kg	<0.05	< 0.05	< 0.05	<0.05	< 0.05	<0.05	< 0.05	< 0.05	<0.05	0.05	3461873
Total Sodium (Na)	mg/kg	10	<10	13	12	11	92	27	<10	<10	10	3461873
Total Strontium (Sr)	mg/kg	113	13.1	31.1	52.8	27.2	293	123	184	29.0	0.1	3461873
Total Thallium (TI)	mg/kg	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05	0.05	3461873
Total Tin (Sn)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Titanium (Ti)	mg/kg	2	1	2	5	6	65	44	2	<1	1	3461873
Total Uranium (U)	mg/kg	<0.05	< 0.05	< 0.05	<0.05	< 0.05	0.07	< 0.05	<0.05	<0.05	0.05	3461873
Total Vanadium (V)	mg/kg	<2	<2	<2	<2	<2	5	3	<2	<2	2	3461873
Total Zinc (Zn)	mg/kg	60.5	97.6	127	70.3	44.9	101	41.4	142	56.5	0.1	3461873



WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

Maxxam Job #: A953654 Report Date: 2009/10/06

### ELEMENTS BY ATOMIC SPECTROSCOPY (VEGETABLES)

Maxxam ID		Q95935	Q95939	Q95940	Q95941	Q95942	Q95943	Q95944	Q95945		
Sampling Date		2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21		
	Units	YUKON RIVER	TUFTED	SHEEP	VIOLET	R.M.	TUFTED	VIOLET	GLAUCOUS	RDL	QC Batch
		PLANE-LEAF	HAIRGRASS	FESCUE	WHEATGRASS	FESCUE	HAIRGRASS	WHEATGRASS	BLUEGRASS		
		WILLOW TWIGS	LOWER IROD	LOWER IROD	LOWER IROD	LOWER	TOE OF	TOE OF	TOE OF		
						IROD	TAILINGS	TAILINGS	TAILINGS		
Total Metals by ICPMS		1	1	1	1		1	1	1		1
Total Aluminum (Al)	mg/kg	33	1060	978	702	559	1160	795	637	1	3461873
Total Antimony (Sb)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Arsenic (As)	mg/kg	0.03	0.39	0.31	0.17	0.19	0.21	0.16	0.22	0.01	3461873
Total Barium (Ba)	mg/kg	61.4	76.0	47.6	20.4	25.6	25.0	21.8	73.1	0.1	3461873
Total Beryllium (Be)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Bismuth (Bi)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Boron (B)	mg/kg	16	<5	<5	<5	<5	<5	<5	6	5	3461873
Total Cadmium (Cd)	mg/kg	3.81	0.22	0.17	0.09	0.06	0.08	0.09	0.35	0.01	3461873
Total Calcium (Ca)	mg/kg	12400	4480	3630	4000	1880	2810	3500	8690	10	3461873
Total Chromium (Cr)	mg/kg	<0.5	1.0	0.9	0.6	2.1	1.5	1.6	0.7	0.5	3461873
Total Cobalt (Co)	mg/kg	<0.1	0.7	0.6	0.3	0.4	0.7	0.5	0.8	0.1	3461873
Total Copper (Cu)	mg/kg	5.3	100	81.3	58.5	49.9	213	133	113	0.5	3461873
Total Iron (Fe)	mg/kg	54	1750	1570	1000	882	2610	1800	1460	10	3461873
Total Lead (Pb)	mg/kg	0.15	0.49	0.49	0.32	0.33	0.52	0.44	0.47	0.01	3461873
Total Magnesium (Mg)	mg/kg	830	1550	1430	1310	666	1180	1210	3930	10	3461873
Total Manganese (Mn)	mg/kg	35.6	354	366	173	205	150	212	593	0.1	3461873
Total Mercury (Hg)	mg/kg	0.01	0.01	0.01	<0.01	<0.01	0.01	0.01	0.01	0.01	3461873
Total Molybdenum (Mo)	mg/kg	1.0	2.6	1.4	1.0	1.1	1.2	1.1	2.3	0.1	3461873
Total Nickel (Ni)	mg/kg	0.4	2.5	0.9	0.5	1.8	1.2	1.1	1.4	0.1	3461873
Total Phosphorus (P)	mg/kg	1250	830	666	178	604	309	608	1090	10	3461873
Total Potassium (K)	mg/kg	3110	5880	4650	2500	2870	1770	6240	9710	10	3461873
Total Selenium (Se)	mg/kg	0.26	0.24	0.13	0.24	0.12	0.24	0.19	0.21	0.01	3461873
Total Silver (Ag)	mg/kg	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	0.09	0.06	0.06	0.05	3461873
Total Sodium (Na)	mg/kg	<10	23	23	17	14	33	29	31	10	3461873
Total Strontium (Sr)	mg/kg	58.7	24.5	17.5	18.3	10.1	15.6	17.6	42.3	0.1	3461873
Total Thallium (TI)	mg/kg	<0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	0.05	3461873
Total Tin (Sn)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461873
Total Titanium (Ti)	mg/kg	1	50	47	29	26	80	56	43	1	3461873
Total Uranium (U)	mg/kg	<0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	< 0.05	0.05	3461873
Total Vanadium (V)	mg/kg	<2	4	3	<2	<2	5	3	3	2	3461873
Total Zinc (Zn)	mg/kg	128	55.1	28.0	19.8	24.0	25.3	18.5	123	0.1	3461873



WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

Maxxam Job #: A953654 Report Date: 2009/10/06

### ELEMENTS BY ATOMIC SPECTROSCOPY (VEGETABLES)

Maxxam ID		Q95946		Q95947	Q95948	Q95949	Q95950	Q95951	Q95952		
Sampling Date		2009/09/21		2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21	2009/09/21		
	Units	R.M. FESCUE	QC Batch	SHEEP	VIOLET	TUFTED	SHEEP	GLAUCOUS	R.M.	RDL	QC Batch
		TOE OF		FESCUE TOE	WHEATGRASS	HAIRGRASS	FESCUE	BLUEGRASS	FESCUE		
		TAILINGS		OF TAILINGS	UPPER IROD						
Total Metals by ICPMS			1		1	1	1		1		
Total Aluminum (Al)	mg/kg	1320	3461873	601	855	1150	320	363	340	1	3461891
Total Antimony (Sb)	mg/kg	<0.1	3461873	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461891
Total Arsenic (As)	mg/kg	0.35	3461873	0.13	0.32	0.48	0.16	0.27	0.16	0.01	3461891
Total Barium (Ba)	mg/kg	90.4	3461873	31.6	71.0	63.6	25.8	151	28.6	0.1	3461891
Total Beryllium (Be)	mg/kg	<0.1	3461873	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461891
Total Bismuth (Bi)	mg/kg	<0.1	3461873	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461891
Total Boron (B)	mg/kg	<5	3461873	<5	<5	7	<5	6	<5	5	3461891
Total Cadmium (Cd)	mg/kg	0.19	3461873	0.19	0.17	0.26	0.10	0.11	0.03	0.01	3461891
Total Calcium (Ca)	mg/kg	5380	3461873	3630	4010	4260	2690	5410	1700	10	3461891
Total Chromium (Cr)	mg/kg	3.1	3461873	0.9	0.9	1.3	<0.5	<0.5	<0.5	0.5	3461891
Total Cobalt (Co)	mg/kg	1.1	3461873	0.5	0.5	0.8	0.2	0.5	0.2	0.1	3461891
Total Copper (Cu)	mg/kg	233	3461873	108	65.0	114	26.2	39.1	25.0	0.5	3461891
Total Iron (Fe)	mg/kg	2880	3461873	1360	1380	1960	525	729	559	10	3461891
Total Lead (Pb)	mg/kg	0.88	3461873	0.70	0.52	0.65	0.69	0.43	0.20	0.01	3461891
Total Magnesium (Mg)	mg/kg	2600	3461873	1890	1380	1410	1020	2090	634	10	3461891
Total Manganese (Mn)	mg/kg	498	3461873	325	174	136	123	462	121	0.1	3461891
Total Mercury (Hg)	mg/kg	<0.01	3461873	0.01	<0.01	<0.01	<0.01	<0.01	<0.01	0.01	3461891
Total Molybdenum (Mo)	mg/kg	1.5	3461873	2.7	1.4	4.8	1.7	1.9	0.9	0.1	3461891
Total Nickel (Ni)	mg/kg	2.7	3461873	0.9	1.0	2.2	1.1	2.5	1.0	0.1	3461891
Total Phosphorus (P)	mg/kg	852	3461873	1080	439	1060	807	1030	585	10	3461891
Total Potassium (K)	mg/kg	4720	3461873	13300	5090	5690	5960	5180	3240	10	3461891
Total Selenium (Se)	mg/kg	0.30	3461873	0.15	0.15	0.21	0.07	0.20	0.07	0.01	3461891
Total Silver (Ag)	mg/kg	0.12	3461873	<0.05	<0.05	<0.05	<0.05	0.05	< 0.05	0.05	3461891
Total Sodium (Na)	mg/kg	40	3461873	28	20	29	16	15	19	10	3461891
Total Strontium (Sr)	mg/kg	30.1	3461873	20.9	21.5	21.1	12.5	29.3	9.0	0.1	3461891
Total Thallium (TI)	mg/kg	<0.05	3461873	<0.05	<0.05	<0.05	<0.05	<0.05	< 0.05	0.05	3461891
Total Tin (Sn)	mg/kg	0.1	3461873	<0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	3461891
Total Titanium (Ti)	mg/kg	91	3461873	45	48	57	16	17	18	1	3461891
Total Uranium (U)	mg/kg	<0.05	3461873	<0.05	<0.05	<0.05	<0.05	<0.05	< 0.05	0.05	3461891
Total Vanadium (V)	mg/kg	6	3461873	3	3	4	<2	<2	<2	2	3461891
Total Zinc (Zn)	mg/kg	89.3	3461873	44.0	13.6	34.7	21.0	98.3	18.8	0.1	3461891



WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

Maxxam Job #: A953654 Report Date: 2009/10/06

### **CSR/CCME METALS IN SOIL (SOIL)**

Maxxam ID		Q95936	Q95937	Q95938		
Sampling Date		2009/09/21	2009/09/21	2009/09/21		
	Units	TOE OF	SOIL SAMPLE LOWER IROD	SOIL SAMPLE	RDL	QC Batch
		TAILINGS SOIL		UPPER IROD		
Misc. Inorganics				· · · · · · ·		
Soluble (2:1) pH	pH Units	5.23	7.04	8.45	0.01	3458063
Total Metals by ICPMS	1	1				-1
Total Aluminum (Al)	mg/kg	15300	14200	12800	100	3459879
Total Antimony (Sb)	mg/kg	0.5	0.5	0.3	0.1	3459879
Total Arsenic (As)	mg/kg	6.5	5.3	6.5	0.2	3459879
Total Barium (Ba)	mg/kg	279	215	183	0.1	3459879
Total Beryllium (Be)	mg/kg	0.5	0.3	0.5	0.1	3459879
Total Bismuth (Bi)	mg/kg	0.1	0.1	<0.1	0.1	3459879
Total Cadmium (Cd)	mg/kg	0.29	0.25	0.15	0.05	3459879
Total Calcium (Ca)	mg/kg	8960	9890	11800	100	3459879
Total Chromium (Cr)	mg/kg	28	29	29	1	3459879
Total Cobalt (Co)	mg/kg	8.3	10.0	11.6	0.3	3459879
Total Copper (Cu)	mg/kg	163	123	59.6	0.5	3459879
Total Iron (Fe)	mg/kg	20900	24900	26100	100	3459879
Total Lead (Pb)	mg/kg	6.3	6.4	5.6	0.1	3459879
Total Magnesium (Mg)	mg/kg	6420	8330	11200	100	3459879
Total Manganese (Mn)	mg/kg	178	460	467	0.2	3459879
Total Mercury (Hg)	mg/kg	<0.05	<0.05	<0.05	0.05	3459879
Total Molybdenum (Mo)	mg/kg	2.1	1.3	0.6	0.1	3459879
Total Nickel (Ni)	mg/kg	23.6	32.1	53.7	0.8	3459879
Total Phosphorus (P)	mg/kg	586	742	858	10	3459879
Total Potassium (K)	mg/kg	787	1130	1470	100	3459879
Total Selenium (Se)	mg/kg	1.0	0.6	0.6	0.5	3459879
Total Silver (Ag)	mg/kg	0.14	0.12	0.09	0.05	3459879
Total Sodium (Na)	mg/kg	217	275	278	100	3459879
Total Strontium (Sr)	mg/kg	59.0	60.3	60.1	0.1	3459879
Total Thallium (TI)	mg/kg	0.09	0.10	0.11	0.05	3459879
Total Tin (Sn)	mg/kg	0.5	0.5	0.4	0.1	3459879
Total Titanium (Ti)	mg/kg	805	928	682	1	3459879
Total Vanadium (V)	mg/kg	62	64	59	2	3459879
Total Zinc (Zn)	mg/kg	69	71	58	1	3459879
Total Zirconium (Zr)	mg/kg	2.9	3.5	3.0	0.5	3459879



Maxxam Job #: A953654 Report Date: 2009/10/06

# Driven by service and Science www.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

#### QUALITY ASSURANCE REPORT

			Matrix	Spike	Spiked	Blank	Method Bla	nk	RF	D	QC Sta	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
3455655	Saturation %	2009/10/01					<1	%	9.1	25		
3456164	Soluble Conductivity	2009/10/01			98	80 - 120	<1	uS/cm	21.2	N/A		
3458063	Soluble (2:1) pH	2009/10/01			100	96 - 104			0.1	20		
3459879	Total Arsenic (As)	2009/10/01	99	75 - 125	98	75 - 125	<0.2	mg/kg			84	70 - 130
3459879	Total Beryllium (Be)	2009/10/01	113	75 - 125	105	75 - 125	<0.1	mg/kg				
3459879	Total Cadmium (Cd)	2009/10/01	108	75 - 125	100	75 - 125	<0.05	mg/kg			83	70 - 130
3459879	Total Chromium (Cr)	2009/10/01	105	75 - 125	98	75 - 125	<1	mg/kg			93	70 - 130
3459879	Total Cobalt (Co)	2009/10/01	105	75 - 125	101	75 - 125	<0.3	mg/kg			87	70 - 130
3459879	Total Copper (Cu)	2009/10/01	105	75 - 125	102	75 - 125	<0.5	mg/kg			89	70 - 130
3459879	Total Lead (Pb)	2009/10/01	108	75 - 125	95	75 - 125	<0.1	mg/kg	2.0	35	92	70 - 130
3459879	Total Mercury (Hg)	2009/10/01	109	75 - 125	97	75 - 125	<0.05	mg/kg				
3459879	Total Nickel (Ni)	2009/10/01	104	75 - 125	98	75 - 125	<0.8	mg/kg			89	70 - 130
3459879	Total Selenium (Se)	2009/10/01	109	75 - 125	107	75 - 125	<0.5	mg/kg				
3459879	Total Vanadium (V)	2009/10/01	119	75 - 125	113	75 - 125	<2	mg/kg			111	70 - 130
3459879	Total Zinc (Zn)	2009/10/01	NC	75 - 125	105	75 - 125	<1	mg/kg			90	70 - 130
3459879	Total Aluminum (Al)	2009/10/01					<100	mg/kg			105	70 - 130
3459879	Total Antimony (Sb)	2009/10/01					<0.1	mg/kg			93	70 - 130
3459879	Total Barium (Ba)	2009/10/01					<0.1	mg/kg			112	70 - 130
3459879	Total Calcium (Ca)	2009/10/01					<100	mg/kg			91	70 - 130
3459879	Total Iron (Fe)	2009/10/01					<100	mg/kg			98	70 - 130
3459879	Total Magnesium (Mg)	2009/10/01					<100	mg/kg			102	70 - 130
3459879	Total Manganese (Mn)	2009/10/01					<0.2	mg/kg			124	70 - 130
3459879	Total Molybdenum (Mo)	2009/10/01					<0.1	mg/kg			86	70 - 130
3459879	Total Phosphorus (P)	2009/10/01					<10	mg/kg			77	70 - 130
3459879	Total Silver (Ag)	2009/10/01					<0.05	mg/kg			83	70 - 130
3459879	Total Strontium (Sr)	2009/10/01					0.1, RDL=0.1	mg/kg			128	70 - 130
3459879	Total Thallium (TI)	2009/10/01					<0.05	mg/kg			76	70 - 130
3459879	Total Titanium (Ti)	2009/10/01					<1	mg/kg			111	70 - 130
3459879	Total Bismuth (Bi)	2009/10/01					<0.1	mg/kg				
3459879	Total Potassium (K)	2009/10/01					<100	mg/kg				
3459879	Total Sodium (Na)	2009/10/01					<100	mg/kg				
3459879	Total Tin (Sn)	2009/10/01					<0.1	mg/kg				
3459879	Total Zirconium (Zr)	2009/10/01					<0.5	mg/kg				
3461533	Total Kjeldahl Nitrogen	2009/10/02	NC	75 - 125	104	80 - 120	<10	mg/kg	18.2	35	84	60 - 121
3461568	Cation exchange capacity	2009/10/06							NC	35		
3461873	Total Arsenic (As)	2009/10/02	108	75 - 125	105	75 - 125	<0.01	mg/kg	12.0	35		
3461873	Total Beryllium (Be)	2009/10/02	110	75 - 125	110	75 - 125	<0.1	mg/kg	NC	35		
3461873	Total Cadmium (Cd)	2009/10/02	111	75 - 125	112	75 - 125	<0.01	mg/kg	2.4	35		
3461873	Total Chromium (Cr)	2009/10/02	107	75 - 125	108	75 - 125	<0.5	mg/kg	NC	35		
3461873	Total Cobalt (Co)	2009/10/02	107	75 - 125	108	75 - 125	<0.1	mg/kg	NC	35		



Maxxam Job #: A953654 Report Date: 2009/10/06

Driven by service and Science www.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

#### QUALITY ASSURANCE REPORT

			Matrix S	Spike	Spiked I	Blank	Method Bla	nk	RF	P	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
3461873	Total Copper (Cu)	2009/10/02	106	75 - 125	107	75 - 125	<0.5	mg/kg	0.2	35	-	
3461873	Total Lead (Pb)	2009/10/02	105	75 - 125	111	75 - 125	<0.01	mg/kg	0.3	35		
3461873	Total Mercury (Hg)	2009/10/02	103	75 - 125	107	75 - 125	0.01, RDL=0.01	mg/kg	NC	35		
3461873	Total Nickel (Ni)	2009/10/02	106	75 - 125	107	75 - 125	<0.1	mg/kg	2.6	35		
3461873	Total Selenium (Se)	2009/10/02	112	75 - 125	114	75 - 125	0.01, RDL=0.01	mg/kg	9.6	35		
3461873	Total Uranium (U)	2009/10/02	110	75 - 125	113	75 - 125	<0.05	mg/kg	NC	35		
3461873	Total Vanadium (V)	2009/10/02	111	75 - 125	107	75 - 125	<2	mg/kg	NC	35		
3461873	Total Zinc (Zn)	2009/10/02	NC	75 - 125	112	75 - 125	<0.1	mg/kg	1.5	35		
3461873	Total Aluminum (Al)	2009/10/02					1, RDL=1	mg/kg	2.2	35		
3461873	Total Antimony (Sb)	2009/10/02					<0.1	mg/kg	NC	35		
3461873	Total Barium (Ba)	2009/10/02					<0.1	mg/kg	2.0	35		
3461873	Total Bismuth (Bi)	2009/10/02					<0.1	mg/kg	NC	35		
3461873	Total Boron (B)	2009/10/02					<5	mg/kg	1.1	35		
3461873	Total Calcium (Ca)	2009/10/02					<10	mg/kg	1.5	35		
3461873	Total Iron (Fe)	2009/10/02					<10	mg/kg	11.2	35		
3461873	Total Magnesium (Mg)	2009/10/02					<10	mg/kg	0.5	35		
3461873	Total Manganese (Mn)	2009/10/02					<0.1	mg/kg	1.9	35		
3461873	Total Molybdenum (Mo)	2009/10/02					<0.1	mg/kg	1.2	35		
3461873	Total Phosphorus (P)	2009/10/02					<10	mg/kg	1.5	35		
3461873	Total Potassium (K)	2009/10/02					<10	mg/kg	0.5	35		
3461873	Total Silver (Ag)	2009/10/02					<0.05	mg/kg	NC	35		
3461873	Total Sodium (Na)	2009/10/02					<10	mg/kg	NC	35		
3461873	Total Strontium (Sr)	2009/10/02					<0.1	mg/kg	1.6	35		
3461873	Total Thallium (TI)	2009/10/02					<0.05	mg/kg	NC	35		
3461873	Total Tin (Sn)	2009/10/02					<0.1	mg/kg	NC	35		
3461873	Total Titanium (Ti)	2009/10/02					<1	mg/kg	NC	35		
3461891	Total Arsenic (As)	2009/10/02	110	75 - 125	111	75 - 125	<0.01	mg/kg	5.7	35		
3461891	Total Beryllium (Be)	2009/10/02	111	75 - 125	110	75 - 125	<0.1	mg/kg	NC	35		
3461891	Total Cadmium (Cd)	2009/10/02	115	75 - 125	115	75 - 125	<0.01	mg/kg	7.7	35		
3461891	Total Chromium (Cr)	2009/10/02	109	75 - 125	112	75 - 125	<0.5	mg/kg	NC	35		
3461891	Total Cobalt (Co)	2009/10/02	107	75 - 125	110	75 - 125	<0.1	mg/kg	NC	35		
3461891	Total Copper (Cu)	2009/10/02	NC	75 - 125	110	75 - 125	<0.5	mg/kg	0.09	35		
3461891	Total Lead (Pb)	2009/10/02	107	75 - 125	110	75 - 125	<0.01	mg/kg	1	35		
3461891	Total Mercury (Hg)	2009/10/02	104	75 - 125	104	75 - 125	<0.01	mg/kg	NC	35		
3461891	Total Nickel (Ni)	2009/10/02	107	75 - 125	110	75 - 125	<0.1	mg/kg	7.4	35		
3461891	Total Selenium (Se)	2009/10/02	110	75 - 125	114	75 - 125	0.01, RDL=0.01	mg/kg	2.9	35		
3461891	Total Uranium (U)	2009/10/02	110	75 - 125	111	75 - 125	<0.05	mg/kg	NC	35		
3461891	Total Vanadium (V)	2009/10/02	111	75 - 125	111	75 - 125	<2	mg/kg	NC	35		
3461891	Total Zinc (Zn)	2009/10/02	NC	75 - 125	115	75 - 125	<0.1	mg/kg	0.3	35		
3461891	Total Aluminum (Al)	2009/10/02					1, RDL=1	mg/kg	0.08	35		



Maxxam Job #: A953654 Report Date: 2009/10/06 WWW.maxxamanalytics.com MINTO EXPLORATIONS LTD. Client Project #: MIN-09-05 REVEGETATION MONITOR

#### QUALITY ASSURANCE REPORT

			Matrix S	Spike	Spiked	Blank	Method Bla	ink	RF	D	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
3461891	Total Antimony (Sb)	2009/10/02					<0.1	mg/kg	NC	35		
3461891	Total Barium (Ba)	2009/10/02					<0.1	mg/kg	0.4	35		
3461891	Total Bismuth (Bi)	2009/10/02					<0.1	mg/kg	NC	35		
3461891	Total Boron (B)	2009/10/02					<5	mg/kg	NC	35		
3461891	Total Calcium (Ca)	2009/10/02					<10	mg/kg	1.7	35		
3461891	Total Iron (Fe)	2009/10/02					<10	mg/kg	1.6	35		
3461891	Total Magnesium (Mg)	2009/10/02					<10	mg/kg	0.9	35		
3461891	Total Manganese (Mn)	2009/10/02					<0.1	mg/kg	0.4	35		
3461891	Total Molybdenum (Mo)	2009/10/02					<0.1	mg/kg	1	35		
3461891	Total Phosphorus (P)	2009/10/02					<10	mg/kg	0.7	35		
3461891	Total Potassium (K)	2009/10/02					<10	mg/kg	1.5	35		
3461891	Total Silver (Ag)	2009/10/02					<0.05	mg/kg	NC	35		
3461891	Total Sodium (Na)	2009/10/02					<10	mg/kg	NC	35		
3461891	Total Strontium (Sr)	2009/10/02					<0.1	mg/kg	0.3	35		
3461891	Total Thallium (TI)	2009/10/02					<0.05	mg/kg	NC	35		
3461891	Total Tin (Sn)	2009/10/02					<0.1	mg/kg	NC	35		
3461891	Total Titanium (Ti)	2009/10/02					<1	mg/kg	0.9	35		

N/A = Not Applicable

RDL = Reportable Detection Limit

RPD = Relative Percent Difference

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A blank matrix to which a known amount of the analyte has been added. Used to evaluate analyte recovery.

Spiked Blank: A blank matrix to which a known amount of the analyte has been added. Used to evaluate analyte recovery.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.

NC (Matrix Spike): The recovery in the matrix spike was not calculated. The relative difference between the concentration in the parent sample and the spiked amount was not sufficiently significant to permit a reliable recovery calculation.

NC (RPD): The RPD was not calculated. The level of analyte detected in the parent sample and its duplicate was not sufficiently significant to permit a reliable calculation.

	Maxxa	(Ast) 484-4511	8577 Commerce C Burnaby, BC V5A www.maxxamanal	4N5	Fax.: (604)	144-4511			8	083	<b>NIIN</b> 04612	סמע הפיי	ANAL	PAGE	_1_OF
	Analyti	ics Inc		Aa	536	54		LAB US MAXXA	E ONLY M JOB #	4	NALYS	SIS REQU	JEST	COC #	ONLY
٠	COMPANY NAME: Minto Explorations Ltd.		CLIENT PROJECT NO. MIN-09-05 Reve						( <u>, , , , , , , , , , , , , , , , , , , </u>		<u></u>	3 USE ONLY			
	COMPANY ADDRESS:		TEL	<u> </u>											
				accesscons r@mintomi					2						
	SAMPLER NAME (PRINT):	PROJECT MANA		LAB	ORATORY CONTAC	τ:									
	Stu Withers	Scott Keese	y/Colleen Roche		nberley Webbe										
				MATRIX	SA	MPLING									
				R R R	DATE	TIME	s								
	FIELD SAMPLE ID		MAXXAM LAB #	GROUNDWATE SURFACE WAT DRINKING WAT SOIL	OTHER	- 2012 - 2012 (m) - 1	# CONTAINERS	s						5	
				RFACE W	ē		CONT	ICP Metals					+		
			and the second of the second	5 8 8				9							
	1 Yukon River Plane-leaf Willow Leave	es	(LAB USE ONLY)		x 2009/09/22	16:00	1	×							H.
	2 Copper Keel Birch Twigs				x 2009/09/21	17:00	1	x	-0 0 - 10000						
	3 Copper Keel Birch Leaves		1/2		x 2009/09/21	17:00	1	x							Π.
	4 Waste Roch Dump 14/14	evel Leaf Will	an tungs		-		T	x							
	5 Toe of Waste Ruch 1st li	ift willow-	huigs (11)	e)			I	X							
	· Plune-leaf willow - toe	e of waster	rack dunis	+ evel			i	×							
	7 The of waste Rock Pum	np-willow	leaves (11.	He			1	X			•				
	* Yuhon River little tr	ee +					1	X							
		ree willow					1	X					10		
		leaf willow					1	×							
	" Tor of Tailings	soil					1	X					4		
	12 Soil sample lon	er Ind				2	1	X			·				-
	TAT (Turnaround Time)		SPECIAL DETECTION	LIMITS / CONT/	AMINANT TYPE:			CC CS	ME R	ARRIVAL	water bandi	LAB US DUE DATE:	C UNEY	LOG IN C	
	LESS THAN 5 DAY TAT MUST PR 7041 HAVE PRIOR APPROVAL	r							TIER 1 HER	TEMPERA	TURE °C:	1			
	Some exceptions apply - ACCOUNTING please contact laboratory	G CONTACT:	SPECIAL REPORTING	OR BILLING IN	STRUCTIONS:		1	# JARS							
	STANDARD 5 BUSINESS DAYS X RUSH 3 BUSINESS DAYS RELINQUINS	HED BY SAMPLER:	DATE:		TIME:		-075	RECEIV	ED BY:	1		\$ \$	<del></del>	L	
	RUSH 2 BUSINESS DAYS S. Withers	S	DD/MM/YY 2	3/09/09		20:00						-and T			
	OTHER BUSINESS DAYS		DATE: DD/MM/YY Page 10 of	13	TIME:			RECEIV	ED BY:	÷					
			DATE:		TIME:	υς		RECEIV	ED BY LA	BORATORY	, HU				

									-			•								ĸ		2	OF_,	7
Maxam	8577 Commerce Court Pl Burnaby, BC V5A 4N5 www.maxxamanalytics.com Toll	hone: (604) 444-4 Fax: (604) 444-4 Free: 1-800-440-	808 511 4808	A-C	1(2	654	MAX	N-OF-	<u>CUS1</u> 08 #	UDY	HEC					QUES		:51	F	1	43	92	<u>0F_</u> 24	2
COMPANY NAME: MINHO COMPANY ADDRESS:	PH. #: E-mail: FAX #: CLIENT PROJECT ID: (#)										B	u s I	EO	NL	<b>Y</b>					R L	- 04			4
SAMPLER NAME (PRINT):	MIN-09-05 Revegetation N	Nonitoring Sept 09	VPH МТВЕ		5 1-4 PLUS BTEX	4S 2-4)	1 PLUS BTEX) PHENOLS BY GCMS					LIDS (NFR)	100		4									
St Withers		Colleen Kodad SAMPLING BURGES	BTEX / LH L BTEX / 1 VOC'S / VPH D		PAH L LEPH/HEPH L CCME-PHC (FRACTIONS 1-4 PLUS BTEX)	CCME-PHCS (FRACTIONS 2-4)	CCME BTEX (FRACTION 1 PLUS BTEX) PHENOLS BY 4AAP C PHENOLS BY		Metals Field Preserved?	Total Metals Field Preserved? NITRATE NITRITE		TOTAL SUSPENDED SOLIDS (NFR)		LEACHABLE LEAU (AA) L	2					5				НОГР
<sup>1</sup> Soil sample Uppe <sup>2</sup> Tufted hairgnuss <sup>3</sup> Sheep Fescue	Lower Irpd														×									
* Violet Wheatard	s Lower Ira	\$		8															2 2 2 2 2 2 2 2 2 2 2					
5 R.M. Fescue Lou 6 Tuffed hairgrass 7 Vislet Wheatgras	The of Tailings									-												-14 Y	-	<u> </u>
<sup>8</sup> Glaucous Bluegr <sup>9</sup> R.M. Fescue	use Toe of tailings										3 3 3 1 1 1 1 3 1 1 1 1 1 1 1 1 1 1 1 1		w 11 0.07.5										4	
10 Sheep Fescue	Toe of Tailings			9	0. 									-	2 2 3			•						
12 TAT (Turnaround Time) <5 DAY TAT MUST HAVE PRIOR APPROVAL	P.O. NUMBER / QUQTÉ NUMBER:	SPECIAL DETECTION	I LIMITS	/ CON	ITAMIN	IANT T	YPE:	[				ARRIVA		PERATU	RE °C:	LA DUE D	A <b>B</b> USI DATE:	E ON	ILY		G IN C			
*some exceptions apply please contact lab STANDARD 5 BUSINESS DAYS RUSH 3 BUSINESS DAYS RUSH 2 BUSINESS DAYS UBCENT 1 BUSINESS DAYS	ACCOUNTING CONTACT:	SPECIAL REPORTING	) or bil	LING I	NSTR	UCTION	is:	]		ER IRS USE	<b>D</b>		8	5			P.D.C.				121		18	
URGENT 1 BUSINESS DAY	RELINQUISHED BY SAMPLER: RELINQUISHED BY: *		DATE: DD/MM/ DATE:		11 of	13	TIME:		<u></u>									Ŭ.			<u>822</u>		0 CANE	
CHICTODY			DD/MM	w.			1	1241					- 0.00											

Maxan		V.	ON TINO		ra	X: (604	) 444-	-4511	AM	77	00	A							1200						75	1	101	20	E
			nalytics	.com	Phon Fa Toll Fre	e: 1-80	0-440	0-480	3''	~ /			MAX	XAM	JOB #	F			A	NAL	<b>SIS</b>	REQ	UEST		F	T	439	92	0
COMPANY NAME:		H. #: ·mail:						1 22	1 38 m		έρ φ Έ <u>μ</u> ι	и на И М П	8 2			L	AB	μ	SE	0	ILY	ĥ.		· - (8) (		- 300 - 4			*
Minto COMPANY ADDRESS:	E	X #:									10	2		Г				_											
COMPANY ADDRESS:	C	LIENT PF	ROJECT	ID: (#)		20.02	999306 - 89	-			3		S S		Q Q	2	ļ.		8	3 3		8	67	20		2			1
	12	MIN	J-04	1-05	E.				2	1	0		GCN	550); 5003	ZZ	Z		HATE	8	8					5	8	0000		52
2	Í.	leve	eret	ng sey/	sin			MTBE			3TE	5	R N	٦L			VIA	SULPHATE				1	2				<i>.</i> 2	1	
	Ŕ	A	Vani	10.44	Co m	LA	9				Sn	Ē	OLS	0	YES	YES	AMMONIA	N N	Ŷ	(TCLP)	(TCLP)	8	a a						
SAMPLER NAME (PRINT):		LON I	TPIT	ng	sep		1	JL!			4 PL	(†	을 흘	Ogi			₹[		<u>ځ</u>	lΕ	Ę			8	•		6	1	
	P		MANAGE	:H: -	1 11	0		/VPH	Ē			S SN G		RAL	2 d3	.pev		SIDE		$ \Box $			8			8	3		
She Withers		xoff	Kee	Sey/	Collet	en Ro	sur		X Re	H	NOL			MINERAL O&G	Itere	eser	E	FLUORIDE	WAD	A)	(A)							11	ĺ
	a a the second	Caller 1	MATR	IX O	S	AMPLIN	G	<u></u> ∎		ГЕРН/НЕРН	CCME-PHC (FRACTIONS 1-4 PLUS BTEX)	CCME-PHCS (FRACTIONS 2-4) COME BTEX (FRACTION 1 PLUS BTEX)	PHENOLS BY 4AAP PHENOLS BY GOMS		Field Filtered? Field Preserved?	Total Metals Field Preserved?	NITRITE	E	DUAL SUSPENDED SULIUS (NFH)	LEACHABLE LEAD (AA)	BTEX (AA)						s		
FIELD	MAXXAM LAB # (Lab Use On	* * 6		OTHER OTHER * CONTAINERS			۳		Ŧ	EP	E	USC IN	BY 4	ЧL		Fiel	_[		AD AD		E 81				1				
SAMPLE ID	LAB #	<u>_</u> = 3	SHERE		DATE	TIME	HEADSPACE VAPOUR		VOC's / VPH		H	¥∣ ₽	SIC	TOTAL O&G	Dissolved Metals	etals	μ	CHLORIDE	CYANIDE SAD	ABL	EACHABLE						2	1	ĺ
U	la dran Cae Ou	<b>7</b>					AD	ы Ц	VOC'S	PAH	WE	WE NE	ENC	IAL	ssolv	al M	NITRATE	Ľů	ANIT	ACH	ACH				-				
<u> </u>				-   #	DD/MM/YY		Ŧ	6	× B	đ	ŭ	8 8	히효	2	őž	<u>d</u>	Z	요 6	2  8	5 <u> </u>	Щ		$\square$		1 2001				L
Violet Wheato	rass uppe	rin	od						2																		Ĩ		
Tuffed Huinmis	ممدا ح						4	i.	1000																	10 10	1		-0
Clear Com	Star Star		1				1			1 -				-			-	-	-				-+-	-	+ +	_	_		_
shoup tescue	Upper .	100	4		1				Bernari		5 				35 545			1											
Violet Wheatg Tufted Itaingras Sheep fescue Glaucous Bli R.M. Fescue	regniss	porer	170	od /	and the second second							8	12						8			8	6						
R.M. Epsy.	Lacor -	31		1	e.							an is			0						-			•		1983	2	$\square$	Ē
				1-	1	<u> </u>	-	++	-	-		1		-	-		-		-	in the	in the second	_	<u>- 17 - 17 - 18</u>		+	-		$\mathbb{H}$	
	10 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	-801 Just		++					_			87 			0) 22			0	8									8	
	te de go pe ser de an	S <sup>all</sup> Kor Sec. 43									2	•		63	8	a 8	1			44 C	1.00							ΙT	
	5	· · · ·																	-		2.					8	-		
360M	1999 - 1997 - 19				6	•				$\vdash$				1	-	- 1		-			1								4
	al and a set of a				110											2-40	2	1939				8							
0											2	8	15		8	3		AF)			0.0	0.0			8 9			Π	
1	1 L A S C I	24. S												_	-			-			-		1	-		-		H	_
2 .		1.55		/	<u>- 124 ()</u>		04 00		- 2075 - 407 - 407	$\vdash$		-	-	- 008-7	100		_		1) 	$\left  \right $				-			4-4		_
		D <sup>ar</sup> ang					Ľ,		6									3			1	8	245 - 77		2				
TAT (Turnaround Time)	P.O. NUMBER	QUQTE	NUMBE	R:	SPE	CIAL DE	TECTIC	ON LIM	TS/C	ONTA	MINAN	IT TYP	PE:						55	-	2.3.2		LABL		NLY	5	230) (R	ųψ.	
<5 DAY TAT MUST HAVE PRIOR APPROVAL																			RIVAL 7	EMPER	ATURE	°C: DU	E DATE	1		LOG	IN CH	ECK:	1
*some exceptions apply													<del>1</del> 0.			HER	NER 1												
please contact lab	ACCOUNTING	CONTAC	:T:		SPE	CIAL RE	PORTIN	IG OR	BILLIN	G INS	TRUC	TIONS	3:		# SOIL J AND NO		SED	1											
ANDARD 5 BUSINESS DAYS					1									6	AND NO	)T SUBI	MITTEE	):			×	-1099 2	3						
ISH 3 BHOINEGO DAVO					1														38		35								
USH 3 BUSINESS DAYS USH 2 BUSINESS DAYS	]				ļ																								
	]	BV CAL	MDIED.													- 5%	1.00		1104			1	- 10-				-		
SH 2 BUSINESS DAYS		BY SAN	MPLER:					DAT	E: Pag	ge 12	2 of 13	3	TIME:			1946	RE	CEIVE	DBY	•			<u>.)</u>	1					

2**3**5

17

ĩ

		8577 Commerce Burnaby, BC V5 www.maxxamana	A 4N	5	Fa		44-4808 44-4511 440-4808		CH	IAIN	1-01	FC	us K	τοε	Y	RE	coi	RD	AN	ID A	ANA	LYS		1	
Ma	difi alytics Inc	www.moxeman	<u>11100</u>				-			USE I XAM .			0.94 20	/ / A	NA	ALY	/SI	s R	EC	QUE	EST				CA 27
COMPANY NAME:	75	CLIENT PROJECT N			<u>1998 - 1999 -</u>	n an				$\overline{\mathbf{X}}$	ШĮ	T	ğ			1	AÐU	ISE (	NLŸ		i i			- 	
Vinto Explorations Ltd.		MIN-09-05 Rev	egeta	atior	n Mon	itoring Sept 09	9					4	ゴク	5				5							1
OMPANY ADDRESS:		TEL.: 🛥												الخ							)			3	
9	e	E-MAIL: <u>SCOTTO</u> <u>COILEE</u> FAX:				<u>ting.ca</u> .com	20						Sol	SUB, Calgary	(algary,	5	5	H S	Fertility		Sol	ĸ	-	いま	
AMPLER NAME (PRINT):	PROJECT MANA				1 C	ATORY CONTACT							ŝ	S	S		1		F	Ħ	j	C	¥	F	
Stu Withers	Scott Keese	y/Colleen Roch	s			erley Webber						8	C:	-	ジ				à	2	j.		-	13	
0.45			$\vdash$	MATE	RIX T	SAN						3	Pacific	AL.	3			ľ	9	3	ľ,	Z	X		
FIELD SAMPI	.e id	MAXXAM LAB #	GROUNDWATER SLIDEACE WATED	DRINKING WATER	SOIL	DATE DD/MM/YY	TIME	# CONTAINERS	ICP Metals -	pH/EC -	Texture -	26	satio +	じ 个	î	Nutrients	/	3	Basic	2	0, P P	H0		ora	ר
1 Upper IROD Soils		(LAB OSE UNLT)			x	09/21/2009	13:00	્ય	×	x	x	-	×		-	x	-1	ester e	·				- Alexandre		
2 Lower IROD Soils					x	09/21/2009	15:00	1	x	x	x	x	x	x	x	x	1	s,					T		
3 Toe of Tailings Soils					x	09/21/2009	11:00	1	x	x	x	x	x	x	x	x		1	-		1	Star 1	T		
4 Upper IROD Violet Wheatgras	S			8	x	09/21/2009	13:00	1	x						-		3	76							
5 Upper IROD Tufted Hairgrass	8 6 8 <u>80</u>				x	09/21/2009	13:00	1	x		100					T		00							
6 Upper IROD R.M. Fescue				-	x	09/21/2009	13:00	1	x			0.0													
7 Upper IROD Sheep Fescue	www.				x	09/21/2009	13:00	1	x																
8 Upper IROD Glaucous Bluegr	ass		H	G 14	x	09/21/2009	13:00	1	x			~												3000	
9 Lower IROD Violet Wheatgras	S			T	x	09/21/2009	15:00	1	x								<u>, - 10 - 10 - 10 - 10 - 10 - 10 - 10 - 1</u>			100					
10 Lower IROD Tufted Hairgrass	n inge og koneste		Ħ	3	x	09/21/2009	15:00	1	x																
11 Lower IROD R.M. Fescue					x	09/21/2009	15:00	1	x			d o						a	3.A2						
12 Lower IROD Sheep Fescue					x	09/21/2009	15:00	1	x			1997		0.00						5			a R		
PO N TAT (Turnaround Time)	UMBER OR QUOTE NUMBER:	SPECIAL DETECTIO	N LIMI	rs/c	ONTAN	INANT TYPE:				CCME			ARRI	VAL				Xorocococ p	DAT	distanting is	ONLY	V.T. South States	)g in (	CHECK	<:
LESS THAN 5 DAY TAT MUST PR HAVE PRIOR APPROVAL	7041	1								AB TI			TEM	PERA	TURE	e °C:	6								
* Some exceptions apply - ACCC	DUNTING CONTACT:	SPECIAL REPORTIN	GORI	BILLIN		RUCTIONS:			# JA	RS US	5.02		n.												
please contact laboratory		Bill To Minto Exp	loratio	ons l	Ltd.																				2
SH 3 BUSINESS DAYS RELI	NQUINSHED BY SAMPLER:	DATE: DD/MM/YY	23/0	9/09		TIME:	20:00		REC	EIVE	) BY:						A MARCO AND		2	900 900					
GENT 1 BUSINESS DAY RELI	NQUINSHED BY:	DATE: DD/MM/YY				TIME:			REC	EIVE	BY:	ł.			***					<u> </u>					
	NQUINSHED BY:	DATE: DD/MM/YY			14.50	TIME:			REC	EIVE	BY	LABO	RAT	ORY:											
RECORD	0000				7	Page 13 of 13	3	0.470.00				11	1			100					COCFO	RM - BC -	2007082	<u>n</u>	



Your Project #: MIN - 110466 Your C.O.C. #: 08322883, 08322884

#### Attention: Scott Keesey

ACCESS CONSULTING GROUP #3 Calcite 151 Industrial Road WHITEHORSE, YT CANADA Y1A 3C8

Report Date: 2010/10/07

# CERTIFICATE OF ANALYSIS

#### MAXXAM JOB #: B092008 Received: 2010/09/27, 08:30

Sample Matrix: VEGETATION # Samples Received: 10

		Date	Date		
Analyses	Quantity	Extracted	Analyzed	Laboratory Method	Analytical Method
Elements by CRC ICPMS (total) - Plant	10	2010/09/30	2010/10/05	BRN SOP-00206 R7.0	Based on EPA 200.8

Sample Matrix: Soil # Samples Received: 12

		Date	Date	
Analyses	Quantity	Extracted	Analyzed Laboratory Method	Analytical Method
Cation Exchange Capacity ()	12	2010/10/01	2010/10/01 AB SOP-00042	EPA 200.7
Conductance - soil	12	2010/10/01	2010/10/01 BRN SOP-00269 R2.0	Based on SM - 18.2.4
Elements by ICPMS (total)	12	2010/09/30	2010/09/30 BRN SOP-00203 R5.0	Based on EPA 200.8
Potassium (Available) 🐧	12	2010/10/01	2010/10/01 AB SOP-00042	EPA 200.7
Nitrate-N (Available) 🐧	12	2010/10/01	2010/10/01 AB SOP-00023	SM 4110-B
Phosphorus (Available by ICP) 🐧	12	2010/10/01	2010/10/01 AB SOP-00042	EPA 200.7
pH (2:1 DI Water Extract)	12	2010/09/30	2010/09/30 BRN SOP-00266 R6.0	Carter, SSMA 16.2
Sublet (Inorganics) Ø	12	N/A	2010/09/30	
Texture by Hydrometer ()	12	N/A	2010/10/01 CAL SOP-00033	MMFSPA Ch9
Texture Class ()	12	N/A	2010/10/01 CAL SOP-00033	MMFSPA Ch9

\* Results relate only to the items tested.

(1) This test was performed by Maxxam Calgary

(2) This test was performed by Ext. Sublet from Vancouver

Encryption Key

Please direct all questions regarding this Certificate of Analysis to your Project Manager.

KIMBERLEY WEBBER, BBY Customer Service Email: kim.webber@maxxamanalytics.com Phone# (604) 638-3254

Maxxam has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per section 5.10.2 of ISO/IEC 17025:2005(E), signing the reports. For Service Group specific validation please refer to the Validation Signature Page. Total cover pages: 1



Maxxam Job #: B092008 Report Date: 2010/10/07 ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

# NPK (AVAILABLE)

Maxxam ID		X23895	X23896	X23897	X23898	X23899	X23900		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	RECLAMATION	RECLAMATION	RECLAMATION	RECLAMATION	R1 (IROD)	R1 (IROD)	RDL	QC Batch
		B TOE OF	F MINTO CR	E MINTO RD	D TOE OF DAM	PLOT A	PLOT B		
		WASTE ROCK	FLAME	KM 2	S.				
Nutrients									
Available (NH4F) Nitrogen (N)	mg/kg	<2	<2	<2	<2	<2	<2	2	4305435
Available (NH4F) Phosphorus (P)	mg/kg	<1	<1	22	3	<1	<1	1	4305771
Available (NH4OAc) Potassium (K)	mg/kg	73	38	60	40	30	51	2	4305594

Maxxam ID		X23901	X23902	X23903	X23904	X23905	X23906		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	R3 TAILINGS	R3 TAILINGS	R3 TAILINGS	R4 MINTO	R4 MINTO	R4 MINTO	RDL	QC Batch
		DUMP PLOT	DUMP PLOT	DUMP PLOT	RD KM 3	RD KM 3	R KM 3		
		Α	В	C	PLOT A	PLOT B	PLOT C		
Nutrients									
Available (NH4F) Nitrogen (N)	mg/kg	<2	<2	<2	<2	<2	<2	2	4305435
Available (NH4F) Phosphorus (P)	mg/kg	<1	<1	<1	5	23	<1	1	4305771
Available (NH4OAc) Potassium (K)	mg/kg	57	50	47	35	64	33	2	4305594



www.maxxamanalytics.com ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

### **ELEMENTS BY ATOMIC SPECTROSCOPY (VEGETATION)**

Maxxam ID		X23975	X23976	X23977	X23978	X23979		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	RECLAMATION (B) TOE OF WASTE ROCK - GRASS FESTUCA OVINA	RECLAMATION (B) TOE OF WASTE ROCK - GRASS AGROPYRON VIOLA	PLOT R1 (IROD) TREMBLING ASPEN	PLOT R1 (IROD) LITTLE TREE WILLOW	PLOT R1 (IROD) GREY LEAF WILLOW	RDL	QC Batch
Total Metals by ICPMS								
Total Aluminum (Al)	mg/kg	669	415	248	663	959	1	4303157
Total Antimony (Sb)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Arsenic (As)	mg/kg	0.36	0.22	0.13	0.31	0.49	0.01	4303157
Total Barium (Ba)	mg/kg	46.6	36.5	47.7	34.6	26.8	0.1	4303157
Total Beryllium (Be)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Bismuth (Bi)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Boron (B)	mg/kg	<5	5	18	37	59	5	4303157
Total Cadmium (Cd)	mg/kg	0.14	0.16	2.80	6.02	2.44	0.01	4303157
Total Calcium (Ca)	mg/kg	4110	4580	23300	25000	16900	10	4303157
Total Chromium (Cr)	mg/kg	4.4	2.1	1.9	0.8	1.8	0.5	4303157
Total Cobalt (Co)	mg/kg	0.5	0.3	1.5	1.9	1.8	0.1	4303157
Total Copper (Cu)	mg/kg	56.7	34.9	20.7	48.0	77.1	0.5	4303157
Total Iron (Fe)	mg/kg	1170	726	477	1140	1620	10	4303157
Total Lead (Pb)	mg/kg	0.36	0.24	0.18	0.46	0.53	0.01	4303157
Total Magnesium (Mg)	mg/kg	1410	1030	2740	8000	4540	10	4303157
Total Manganese (Mn)	mg/kg	406	199	149	787	245	0.1	4303157
Total Mercury (Hg)	mg/kg	<0.01	<0.01	<0.01	<0.01	<0.01	0.01	4303157
Total Molybdenum (Mo)	mg/kg	3.7	1.8	1.2	2.4	1.3	0.1	4303157
Total Nickel (Ni)	mg/kg	2.8	2.0	2.8	10.9	5.6	0.1	4303157
Total Phosphorus (P)	mg/kg	1300	621	3200	8630	4430	10	4303157
Total Potassium (K)	mg/kg	11300	6070	8530	11100	13400	10	4303157
Total Selenium (Se)	mg/kg	0.44	0.27	0.09	0.35	0.12	0.01	4303157
Total Silver (Ag)	mg/kg	<0.05	<0.05	<0.05	<0.05	<0.05	0.05	4303157
Total Sodium (Na)	mg/kg	24	21	17	39	35	10	4303157
Total Strontium (Sr)	mg/kg	29.9	34.4	98.9	97.3	76.9	0.1	4303157
Total Thallium (TI)	mg/kg	<0.05	<0.05	<0.05	<0.05	< 0.05	0.05	4303157
Total Tin (Sn)	mg/kg	<0.1	<0.1	<0.1	<0.1	0.2	0.1	4303157
Total Titanium (Ti)	mg/kg	41	25	10	26	31	1	4303157
Total Uranium (U)	mg/kg	<0.05	<0.05	<0.05	< 0.05	< 0.05	0.05	4303157
Total Vanadium (V)	mg/kg	2	<2	<2	2	3	2	4303157
Total Zinc (Zn)	mg/kg	23.6	9.8	321	452	248	0.1	4303157



Maxxam Job #: B092008 Report Date: 2010/10/07 ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

### **ELEMENTS BY ATOMIC SPECTROSCOPY (VEGETATION)**

Maxxam ID		X23980	X23981	X23982	X23983	X23984		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	PLOT R3 TAILINGS	PLOT R3 TAILINGS	PLOT R3 TAILINGS	RECLAMATION F	R4 KM 3 MINTO	RDL	QC Batch
		TOE GREY LEAF	TOE LITTLE TREE	TOE GRASS	MINTO CR GREY	RD GREY LEAF		
		WILLOW	WILLOW	CALAMAGROSH'S	LEAF WILLOW	WILLOW		
Total Metals by ICPMS		ı			1			1
Total Aluminum (Al)	mg/kg	660	314	935	194	197	1	4303157
Total Antimony (Sb)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Arsenic (As)	mg/kg	0.17	0.09	0.24	0.06	0.06	0.01	4303157
Total Barium (Ba)	mg/kg	19.2	10.2	62.4	22.3	85.5	0.1	4303157
Total Beryllium (Be)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Bismuth (Bi)	mg/kg	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4303157
Total Boron (B)	mg/kg	36	37	9	56	80	5	4303157
Total Cadmium (Cd)	mg/kg	1.65	1.30	0.11	0.65	1.01	0.01	4303157
Total Calcium (Ca)	mg/kg	18400	15000	5510	20300	14900	10	4303157
Total Chromium (Cr)	mg/kg	1.1	0.7	4.5	0.7	1.0	0.5	4303157
Total Cobalt (Co)	mg/kg	1.2	1.2	0.7	0.9	2.3	0.1	4303157
Total Copper (Cu)	mg/kg	187	86.0	209	39.4	11.0	0.5	4303157
Total Iron (Fe)	mg/kg	1610	744	2230	406	361	10	4303157
Total Lead (Pb)	mg/kg	0.39	0.28	0.48	0.13	0.14	0.01	4303157
Total Magnesium (Mg)	mg/kg	3880	4620	2040	4940	2520	10	4303157
Total Manganese (Mn)	mg/kg	219	395	854	159	553	0.1	4303157
Total Mercury (Hg)	mg/kg	<0.01	<0.01	<0.01	<0.01	<0.01	0.01	4303157
Total Molybdenum (Mo)	mg/kg	2.1	1.8	3.1	0.3	1.9	0.1	4303157
Total Nickel (Ni)	mg/kg	3.3	3.3	2.7	6.6	2.6	0.1	4303157
Total Phosphorus (P)	mg/kg	2130	1840	701	4770	2900	10	4303157
Total Potassium (K)	mg/kg	14700	13500	4940	13100	9620	10	4303157
Total Selenium (Se)	mg/kg	0.24	0.13	0.28	0.06	0.01	0.01	4303157
Total Silver (Ag)	mg/kg	0.07	<0.05	0.14	<0.05	<0.05	0.05	4303157
Total Sodium (Na)	mg/kg	59	88	36	16	24	10	4303157
Total Strontium (Sr)	mg/kg	69.5	51.0	31.1	163	128	0.1	4303157
Total Thallium (TI)	mg/kg	<0.05	<0.05	<0.05	<0.05	<0.05	0.05	4303157
Total Tin (Sn)	mg/kg	<0.1	<0.1	0.1	0.1	<0.1	0.1	4303157
Total Titanium (Ti)	mg/kg	35	20	59	11	13	1	4303157
Total Uranium (U)	mg/kg	<0.05	<0.05	<0.05	<0.05	<0.05	0.05	4303157
Total Vanadium (V)	mg/kg	3	<2	4	<2	<2	2	4303157
Total Zinc (Zn)	mg/kg	168	104	28.2	101	102	0.1	4303157



Maxxam Job #: B092008 Report Date: 2010/10/07 ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

#### **RESULTS OF CHEMICAL ANALYSES OF SOIL**

Maxxam ID		X23895	X23896	X23897	X23898	X23899		X23900		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		2010/09/15		
	Units	RECLAMATION	RECLAMATION	RECLAMATION	RECLAMATION	R1 (IROD)	QC Batch	R1 (IROD)	RDL	QC Batch
		B TOE OF	F MINTO CR	E MINTO RD	D TOE OF DAM	PLOT A		PLOT B		
		WASTE ROCK	FLAME	KM 2	S.					
CONVENTIONALS										
Soluble (5:1) Conductivity	uS/cm	105	154	33	70	149	4306513	135	1	4306513
Parameter										
Subcontract Parameter	N/A	ATTACHED	ATTACHED	ATTACHED	ATTACHED	ATTACHED	4311892	ATTACHED	N/A	4311892
Elements		-								
Cation exchange capacity	cmol+/Kg	14	25	<10	<10	24	4304356	22	10	4304359
Physical Properties										
% sand by hydrometer	%	59	75	76	81	57	4304707	63	2	4304707
% silt by hydrometer	%	22	17	17	11	34	4304707	29	2	4304707
Clay Content	%	19	8	7	8	9	4304707	8	2	4304707
Texture	N/A	SANDY LOAM	SANDY LOAM	SANDY LOAM	LOAMY SAND	SANDY LOAM	4294603	SANDY LOAM	N/A	4294603

Maxxam ID		X23901	X23902	X23903	X23904	X23905	X23906		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	R3 TAILINGS DUMP PLOT A	R3 TAILINGS DUMP PLOT B	R3 TAILINGS DUMP PLOT C	R4 MINTO RD KM 3 PLOT A	R4 MINTO RD KM 3 PLOT B	R4 MINTO R KM 3 PLOT C	RDL	QC Batch
CONVENTIONALS									
Soluble (5:1) Conductivity	uS/cm	102	136	105	16	33	17	1	4306513
Parameter									
Subcontract Parameter	N/A	ATTACHED	ATTACHED	ATTACHED	ATTACHED	ATTACHED	ATTACHED	N/A	4311892
Elements									
Cation exchange capacity	cmol+/Kg	23	25	24	<10	19	11	10	4304359
Physical Properties									
% sand by hydrometer	%	52	43	58	69	71	89	2	4304707
% silt by hydrometer	%	39	48	34	22	20	8	2	4304707
Clay Content	%	9	9	8	9	9	3	2	4304707
Texture	N/A	LOAM	LOAM	SANDY LOAM	SANDY LOAM	SANDY LOAM	SAND	N/A	4294603



Maxxam Job #: B092008 Report Date: 2010/10/07 ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

# **CSR/CCME METALS IN SOIL (SOIL)**

Maxxam ID		X23895	X23896	X23897	X23898	X23899	X23900		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	RECLAMATION	RECLAMATION	RECLAMATION	RECLAMATION	R1 (IROD)	R1 (IROD)	RDL	QC Batch
		B TOE OF	F MINTO CR	E MINTO RD	D TOE OF DAM	PLOT A	PLOT B		
		WASTE ROCK	FLAME	KM 2	S.				
Physical Properties		i	i		i	1			
Soluble (2:1) pH	pH Units	8.16	8.29	6.00	7.79	7.36	8.13	0.01	4302430
Total Metals by ICPMS		i	i	i	i				
Total Aluminum (Al)	mg/kg	13000	9880	11900	10200	12700	13300	100	4302308
Total Antimony (Sb)	mg/kg	0.8	0.3	0.2	0.2	0.4	0.4	0.1	4302308
Total Arsenic (As)	mg/kg	5.7	3.7	2.6	3.3	6.2	7.0	0.2	4302308
Total Barium (Ba)	mg/kg	207	151	181	121	215	254	0.1	4302308
Total Beryllium (Be)	mg/kg	0.5	0.3	0.4	0.4	0.4	0.3	0.1	4302308
Total Bismuth (Bi)	mg/kg	0.1	<0.1	<0.1	<0.1	<0.1	<0.1	0.1	4302308
Total Cadmium (Cd)	mg/kg	0.46	0.09	0.10	0.09	0.13	0.20	0.05	4302308
Total Calcium (Ca)	mg/kg	7740	8550	2680	5340	9930	13600	100	4302308
Total Chromium (Cr)	mg/kg	21	16	14	12	27	25	1	4302308
Total Cobalt (Co)	mg/kg	10.8	7.1	6.2	7.9	10.3	11.1	0.3	4302308
Total Copper (Cu)	mg/kg	687	23.6	6.7	79.4	79.2	179	0.5	4302308
Total Iron (Fe)	mg/kg	25400	19800	18100	23100	23600	26200	100	4302308
Total Lead (Pb)	mg/kg	7.5	4.2	3.8	3.0	6.1	6.0	0.1	4302308
Total Magnesium (Mg)	mg/kg	7610	6210	4510	6710	8160	9120	100	4302308
Total Manganese (Mn)	mg/kg	488	439	395	586	382	574	0.2	4302308
Total Mercury (Hg)	mg/kg	<0.05	<0.05	<0.05	<0.05	< 0.05	< 0.05	0.05	4302308
Total Molybdenum (Mo)	mg/kg	1.9	0.5	0.4	0.6	0.7	0.8	0.1	4302308
Total Nickel (Ni)	mg/kg	24.0	15.1	9.2	11.4	37.7	31.8	0.8	4302308
Total Phosphorus (P)	mg/kg	793	718	527	845	910	957	10	4302308
Total Potassium (K)	mg/kg	2220	1330	1740	2200	1170	2660	100	4302308
Total Selenium (Se)	mg/kg	1.0	<0.5	<0.5	<0.5	<0.5	<0.5	0.5	4302308
Total Silver (Ag)	mg/kg	0.10	0.05	<0.05	<0.05	0.06	0.06	0.05	4302308
Total Sodium (Na)	mg/kg	127	198	<100	103	258	297	100	4302308
Total Strontium (Sr)	mg/kg	50.4	60.7	23.3	24.9	53.3	57.8	0.1	4302308
Total Thallium (TI)	mg/kg	0.14	0.06	0.07	0.09	0.08	0.12	0.05	4302308
Total Tin (Sn)	mg/kg	0.4	0.3	0.3	0.3	0.4	0.4	0.1	4302308
Total Titanium (Ti)	mg/kg	538	467	484	580	655	832	1	4302308
Total Vanadium (V)	mg/kg	50	41	41	52	55	60	2	4302308
Total Zinc (Zn)	mg/kg	89	54	54	61	54	72	1	4302308
Total Zirconium (Zr)	mg/kg	4.0	1.5	<0.5	1.6	2.6	2.3	0.5	4302308



Maxxam Job #: B092008 Report Date: 2010/10/07 ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

# **CSR/CCME METALS IN SOIL (SOIL)**

Maxxam ID		X23901	X23902	X23903	X23904	X23905	X23906		
Sampling Date		2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15	2010/09/15		
	Units	R3 TAILINGS	R3 TAILINGS	R3 TAILINGS	R4 MINTO	R4 MINTO	R4 MINTO	RDL	QC Batch
		DUMP PLOT	DUMP PLOT	DUMP PLOT	RD KM 3	RD KM 3	R KM 3		
		A	В	C	PLOT A	PLOT B	PLOT C		
Physical Properties									
Soluble (2:1) pH	pH Units	7.79	8.04	7.76	6.75	6.13	6.88	0.01	4302430
Total Metals by ICPMS			•						
Total Aluminum (Al)	mg/kg	11600	11400	10600	7430	9940	10900	100	4302308
Total Antimony (Sb)	mg/kg	0.5	0.5	0.4	0.5	0.3	0.1	0.1	4302308
Total Arsenic (As)	mg/kg	6.0	9.0	6.5	5.2	2.9	1.1	0.2	4302308
Total Barium (Ba)	mg/kg	187	187	185	143	174	131	0.1	4302308
Total Beryllium (Be)	mg/kg	0.4	0.3	0.4	0.3	0.3	0.4	0.1	4302308
Total Bismuth (Bi)	mg/kg	<0.1	0.1	0.1	<0.1	<0.1	<0.1	0.1	4302308
Total Cadmium (Cd)	mg/kg	0.22	0.27	0.25	0.21	0.10	<0.05	0.05	4302308
Total Calcium (Ca)	mg/kg	8780	11400	9280	3550	3250	4570	100	4302308
Total Chromium (Cr)	mg/kg	25	25	23	20	13	8	1	4302308
Total Cobalt (Co)	mg/kg	9.9	10.4	9.7	7.4	5.3	6.5	0.3	4302308
Total Copper (Cu)	mg/kg	96.4	114	422	19.9	9.8	7.5	0.5	4302308
Total Iron (Fe)	mg/kg	22800	23600	22900	17000	17400	19500	100	4302308
Total Lead (Pb)	mg/kg	6.1	6.0	5.9	4.5	3.5	2.4	0.1	4302308
Total Magnesium (Mg)	mg/kg	6910	7130	6320	3240	3670	6060	100	4302308
Total Manganese (Mn)	mg/kg	366	392	493	325	307	519	0.2	4302308
Total Mercury (Hg)	mg/kg	<0.05	<0.05	<0.05	< 0.05	< 0.05	< 0.05	0.05	4302308
Total Molybdenum (Mo)	mg/kg	0.8	2.0	1.0	0.7	0.4	0.2	0.1	4302308
Total Nickel (Ni)	mg/kg	26.4	27.6	25.6	17.3	9.5	6.2	0.8	4302308
Total Phosphorus (P)	mg/kg	935	964	975	819	489	672	10	4302308
Total Potassium (K)	mg/kg	1140	934	1010	634	1220	1870	100	4302308
Total Selenium (Se)	mg/kg	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	0.5	4302308
Total Silver (Ag)	mg/kg	0.06	0.07	0.17	0.05	< 0.05	< 0.05	0.05	4302308
Total Sodium (Na)	mg/kg	256	267	237	<100	<100	<100	100	4302308
Total Strontium (Sr)	mg/kg	48.9	53.4	46.3	23.5	24.8	29.2	0.1	4302308
Total Thallium (TI)	mg/kg	0.08	0.08	0.07	0.06	0.05	0.06	0.05	4302308
Total Tin (Sn)	mg/kg	0.4	0.3	0.3	0.2	0.3	0.2	0.1	4302308
Total Titanium (Ti)	mg/kg	668	628	580	394	427	562	1	4302308
Total Vanadium (V)	mg/kg	55	55	52	36	38	38	2	4302308
Total Zinc (Zn)	mg/kg	61	59	60	45	40	67	1	4302308
Total Zirconium (Zr)	mg/kg	2.5	3.2	2.4	2.2	0.5	1.7	0.5	4302308



Driven by service and Science

www.maxxamanalytics.com ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

Package 1 9.0°C

Each temperature is the average of up to three cooler temperatures taken at receipt

General Comments



www.maxxamanalytics.com ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

#### QUALITY ASSURANCE REPORT

			Matrix S	Spike	Spiked	Blank	Method B	ank	RF	סי	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
4302308	Total Arsenic (As)	2010/10/01	103	75 - 125	104	75 - 125	<0.2	mg/kg	1.2	30	91	70 - 130
4302308	Total Beryllium (Be)	2010/10/01	103	75 - 125	107	75 - 125	<0.1	mg/kg	NC	30		
4302308	Total Cadmium (Cd)	2010/10/01	108	75 - 125	110	75 - 125	<0.05	mg/kg	1.5	30	95	70 - 130
4302308	Total Chromium (Cr)	2010/10/01	NC	75 - 125	99	75 - 125	<1	mg/kg	0.3	30	98	70 - 130
4302308	Total Cobalt (Co)	2010/10/01	101	75 - 125	101	75 - 125	<0.3	mg/kg	2.8	30	96	70 - 130
4302308	Total Copper (Cu)	2010/10/01	NC	75 - 125	105	75 - 125	<0.5	mg/kg	0.1	30	91	70 - 130
4302308	Total Lead (Pb)	2010/10/01	NC	75 - 125	106	75 - 125	<0.1	mg/kg	0.1	35	98	70 - 130
4302308	Total Mercury (Hg)	2010/10/01	92	75 - 125	96	75 - 125	<0.05	mg/kg	3.4	35		
4302308	Total Nickel (Ni)	2010/10/01	NC	75 - 125	102	75 - 125	<0.8	mg/kg	1.2	30	98	70 - 130
4302308	Total Selenium (Se)	2010/10/01	105	75 - 125	107	75 - 125	<0.5	mg/kg	NC	30		
4302308	Total Vanadium (V)	2010/10/01	NC	75 - 125	103	75 - 125	<2	mg/kg	0.9	30	100	70 - 130
4302308	Total Zinc (Zn)	2010/10/01	NC	75 - 125	108	75 - 125	<1	mg/kg	1.2	30	91	70 - 130
4302308	Total Aluminum (Al)	2010/10/01					<100	mg/kg	1.9	35	99	70 - 130
4302308	Total Antimony (Sb)	2010/10/01					<0.1	mg/kg	1.0	30	89	70 - 130
4302308	Total Barium (Ba)	2010/10/01					<0.1	mg/kg	2.0	35	106	70 - 130
4302308	Total Calcium (Ca)	2010/10/01					<100	mg/kg	2.3	30	94	70 - 130
4302308	Total Iron (Fe)	2010/10/01					<100	mg/kg	0.09	30	96	70 - 130
4302308	Total Magnesium (Mg)	2010/10/01					<100	mg/kg	1.5	30	96	70 - 130
4302308	Total Manganese (Mn)	2010/10/01					<0.2	mg/kg	0.2	30	97	70 - 130
4302308	Total Molybdenum (Mo)	2010/10/01					<0.1	mg/kg	1.5	35	102	70 - 130
4302308	Total Phosphorus (P)	2010/10/01					<10	mg/kg	2.5	30	98	70 - 130
4302308	Total Silver (Ag)	2010/10/01					<0.05	mg/kg	22.7	35	63(1)	70 - 130
4302308	Total Strontium (Sr)	2010/10/01					<0.1	mg/kg	0.09	35	91	70 - 130
4302308	Total Thallium (TI)	2010/10/01					<0.05	mg/kg	NC	30	84	70 - 130
4302308	Total Titanium (Ti)	2010/10/01					<1	mg/kg	1.4	35	100	70 - 130
4302308	Total Bismuth (Bi)	2010/10/01					<0.1	mg/kg	NC	30		
4302308	Total Potassium (K)	2010/10/01					<100	mg/kg	3.2	35		
4302308	Total Sodium (Na)	2010/10/01					<100	mg/kg	NC	35		
4302308	Total Tin (Sn)	2010/10/01					<0.1	mg/kg	2.8	35		
4302308	Total Zirconium (Zr)	2010/10/01					<0.5	mg/kg	NC	30		
4302430	Soluble (2:1) pH	2010/09/30			102	96 - 104			2.1	20		
4303157	Total Aluminum (Al)	2010/10/05					11, RDL=1(2)	mg/kg	7.9	35		
4303157	Total Antimony (Sb)	2010/10/05					<0.1	mg/kg	NC	35		
4303157	Total Arsenic (As)	2010/10/05					<0.01	mg/kg	13.3	35		
4303157	Total Barium (Ba)	2010/10/05					<0.1	mg/kg	4.9	35		
4303157	Total Beryllium (Be)	2010/10/05					<0.1	mg/kg	NC	35		
4303157	Total Bismuth (Bi)	2010/10/05					<0.1	mg/kg	NC	35		
4303157	Total Boron (B)	2010/10/05					<5	mg/kg	NC	35		
4303157	Total Cadmium (Cd)	2010/10/05					<0.01	mg/kg	7.0	35		
4303157	Total Calcium (Ca)	2010/10/05					25, RDL=10(3)	mg/kg	5.3	35		



www.maxxamanalytics.com ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

#### QUALITY ASSURANCE REPORT

			Matrix S	Spike	Spiked	Blank	Method E	lank	RP	D	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
4303157	Total Chromium (Cr)	2010/10/05					<0.5	mg/kg	37.1(1,4)	35		
4303157	Total Cobalt (Co)	2010/10/05					<0.1	mg/kg	NC	35		
4303157	Total Copper (Cu)	2010/10/05					<0.5	mg/kg	11.5	35		
4303157	Total Iron (Fe)	2010/10/05					<10	mg/kg	6.6	35		
4303157	Total Lead (Pb)	2010/10/05					<0.01	mg/kg	9.5	35		
4303157	Total Magnesium (Mg)	2010/10/05					<10	mg/kg	8.0	35		
4303157	Total Manganese (Mn)	2010/10/05					<0.1	mg/kg	3.2	35		
4303157	Total Mercury (Hg)	2010/10/05					<0.01	mg/kg	NC	35		
4303157	Total Molybdenum (Mo)	2010/10/05					<0.1	mg/kg	8.5	35		
4303157	Total Nickel (Ni)	2010/10/05					<0.1	mg/kg	25.2	35		
4303157	Total Phosphorus (P)	2010/10/05					<10	mg/kg	5.0	35		
4303157	Total Potassium (K)	2010/10/05					<10	mg/kg	6.0	35		
4303157	Total Selenium (Se)	2010/10/05					<0.01	mg/kg	1.3	35		
4303157	Total Silver (Ag)	2010/10/05					<0.05	mg/kg	NC	35		
4303157	Total Sodium (Na)	2010/10/05					<10	mg/kg	NC	35		
4303157	Total Strontium (Sr)	2010/10/05					<0.1	mg/kg	6.0	35		
4303157	Total Thallium (TI)	2010/10/05					<0.05	mg/kg	NC	35		
4303157	Total Tin (Sn)	2010/10/05					<0.1	mg/kg	NC	35		
4303157	Total Titanium (Ti)	2010/10/05					<1	mg/kg	4.6	35		
4303157	Total Uranium (U)	2010/10/05					<0.05	mg/kg	NC	35		
4303157	Total Vanadium (V)	2010/10/05					<2	mg/kg	NC	35		
4303157	Total Zinc (Zn)	2010/10/05					<0.1	mg/kg	2.7	35		
4304356	Cation exchange capacity	2010/10/01							NC	35		
4304359	Cation exchange capacity	2010/10/01							NC	35		
4304707	% sand by hydrometer	2010/10/01							1.9	35	110	89 - 111
4304707	% silt by hydrometer	2010/10/01							2.3	35	93	78 - 122
4304707	Clay Content	2010/10/01							NC	35	93	86 - 114
4305435	Available (NH4F) Nitrogen (N)	2010/10/01	100	80 - 120	109	90 - 111	<2	mg/kg	NC	35		
4305594	Available (NH4OAc) Potassium (K)	2010/10/01			95	80 - 120	<2	mg/kg	3.4	35	111	75 - 125



ACCESS CONSULTING GROUP Client Project #: MIN - 110466

Sampler Initials: LK

#### QUALITY ASSURANCE REPORT

			Matrix S	Spike	Spiked	Blank	Method Bl	ank	RF	D	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
4305771	Available (NH4F) Phosphorus (P)	2010/10/01			99	80 - 120	<1	mg/kg	NC	35		
4306513	Soluble (5:1) Conductivity	2010/10/01			100	80 - 120	1, RDL=1	uS/cm	2.3	35		

N/A = Not Applicable

RDL = Reportable Detection Limit

RPD = Relative Percent Difference

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A blank matrix to which a known amount of the analyte has been added. Used to evaluate analyte recovery.

Spiked Blank: A blank matrix to which a known amount of the analyte has been added. Used to evaluate analyte recovery.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.

NC (Matrix Spike): The recovery in the matrix spike was not calculated. The relative difference between the concentration in the parent sample and the spiked amount was not sufficiently significant to permit a reliable recovery calculation.

NC (RPD): The RPD was not calculated. The level of analyte detected in the parent sample and its duplicate was not sufficiently significant to permit a reliable calculation.

(1) - Recovery or RPD for this parameter is outside control limits. The overall quality control for this analysis meets acceptability criteria.

(2) - Blank outside acceptance criteria . All results higher than 10x Blank concentration.

(3) - Blank outside acceptance criteria. All results higher than 20x Blank concentration.

(4) - Duplicate RPD above control limit - Non-homogenous sample - Increased variability of results

Мах	analytics inc				BO92008	. AN	IALYS	SIS REQU	JEST	COC#	
COMPANY NAME: Access Consulting Group	۰ ۲	CLIENT PROJECT NO .: MIN - NO4	66								
COMPANY ADDRESS: #3 Calcite Business Center 151 Industrial Rd. Whitehorse, YT Y1A 2V3		TEL.: E-MAIL: FAX: 867-667-6680	а а								
SAMPLER NAME (PRINT): Lisa Knight	PROJECT MAN	AGER: LABO	RATORY CONTACT:	4	×	E	Y				
U FIELD SA	MPLE ID	GROUNDWATER GROUNDWATER SURFACE WATER BRINKING WATER SOIL OTHER	DATE TIME	# CONTAINERS	TOP Mell DH / EEC TOX HUC	C.N 12/1 CEC	Vutrien			•	
· Reclamation	B tocofulisk Ro		DD/MM/YY 15/09/10	ſ	XXXX	XXX	X		-		
2 Beclanation E	Minto ( - Flume	X	/	1	XXXX	1 1 1 1 1			<u></u>		
· Parlington	The of Dam 5.	X X		$\frac{1}{r}$	X×××	XXX	X			-	_
5 RI (TROD)	PIATA			1	XXXX	XXX	X				++
· RI (TROD)	PLAFB				XXXX	XXV					
1 P3 Tailings 1	Amo PlotA			1	XXXX	XXX	X				
· R3 Tailings	Dump Ploth			1	XXXX	XXX	X	i stratege			
· R3 Tuilings	Dimp Mote			ļ	XXXXX	XXX	×				
10 Ry Minto Ke	KM3 PlotA	×			XXXX	XXX	×				
"By minto Rd.	Km3 Plot B	X		1	XXXX	XXX	x				
12 BY Minto RK.	n3 Plotc				XXYX	XXX	- 7				
TAT (Tumaround Time) LESS THAN 5 DAY TAT MUST HAVE PRIOR APPROVAL	PO NUMBER OR QUOTE NUMBER	E SPECIAL DETECTION LIMITS / CONTAM	MINANT TYPE:		CCME CSR AB TIER 1 OTHER	ARRIVAL TEMPERATU	IRE °C:	DUE DATE:		LOG IN CH	ECK:
	ACCOUNTING CONTACT:	SPECIAL REPORTING OR BILLING INS	TRUCTIONS:		# JARS USED:	99	9				
JSH 3 BUSINESS DAYS JSH 2 BUSINESS DAYS RGENT 1 BUSINESS DAY	RELINQUINSHED BY SAMPLER: Lisa Knight	DATE: DD/MMYY 24/09/10	тіме: 17:30 ж.		RECEIVED BY:		201	*			
	RELINQUINSHED BY:	DATE:	TIME:		RECEIVED BY:						

Maxiam	8577 Commerce Court Burnaby, BC V5A 4N5 www.maxxamanalytics.com	Phone: (604) 44 Fax.: (604) 44 Toll-Free: 1-800~	14-4511 440-4808	СН	IAIN-OF	• (	08322	884	NAL		EQUEST
Analytics Inc			n an	MAX	XAM JOB #		ANALY		QUEST	COC#	in an
OMPANY NAME: ccess Consulting Group		1-110466		( <sup>796</sup> )							
DMPANY ADDRESS:	TEL.:	5 11-100	r.	-							5
3 Calcite Business Center 51 Industrial Rd. Vhitehorse, YT	E-MAIL:			1							
1A 2V/3	FAX: 867-667-6680			hh					3		
MPLER NAME (PRINT): Lisa Knight Skott		LABORATORY CONTACT		X							
Lisa Knight Skott E	MATRI	IX SAN	IPLING	- 1							
FIELD SAMPLE ID	GROUNDWATER SURFACE WATER DRINKING WATER		AMILE SMIT	ICP NP							
Reclamation B) Toe of Wast Pack		\$ 15/09/10	1	凶						72 7 7 4	
- Grass Festura ovina		X I	1	X							
- Grass Agropyron viola		×	I	×							
Plot RI (IROD) Trankling Aspe				X							
Plat RI(IROD) Little the Willow)		x	Ĩ	x							
Plot Ri " Grey leat willow		X		X							
Plot R \$3 Tuilings Tor. Greykat w		X	I I	X							100
Plat R3 " " Little Tree Wi		×	1	×							
Plot R3 " " Crass Cilancyo		X	1	X							
Reclariation F- Marto Cr G	ζ 2	×	1	×							
R4_Km 3 Minto he Greyku		×V		X							
TAT (Turnaround Time) LESS THAN 5 DAY TAT MUST HAVE PRIOR APPROVAL	R: SPECIAL DETECTION LIMITS / CO	ONTAMINANT TYPE:	- 1980-110 - 1		CCME CSR AB TIER 1 OTHER	ARRI TEMI	VAL PERATURE °C:	DUE DA	E	LOG IN	CHECK:
* Some exceptions apply - ACCOUNTING CONTACT: please contact laboratory IDARD 5 BUSINESS DAYS	SPECIAL REPORTING OR BILLING	G INSTRUCTIONS:	1,1,1,1,1,1,1,1,1,1,1,1,1,1,1,1,1,1,1,	# JA	RS USED:	-9	99				
I 3 BUSINESS DAYS RELINQUINSHED BY SAMPLER: I 2 BUSINESS DAYS JSA Kright	DATE: DD/MM/YY 24/01/10	TIME: /3. 30		REC	EIVED BY:						
ER BUSINESS DAYS RELINGUNSHED BY	DATE: DD/MM/YY 24/09/10	· 15:00		REC	CEIVED BY:		097	2710	5	25	
	DATE: DD/MM/YY	TIME: US	30	REC	CEIVED BY I	ABORAT		OF	え		
RECORD		Page 13 of 1	3	<u> </u>			<u> </u>		COCFORM	- BC - 200704	822

Exova	T: +1 (604) 514-3322
#104, 19575-55 A Ave.	F: +1 (604) 514-3323
Surrey, British Columbia	E: Surrey@exova.com
V3S 8P8, Canada	W: www.exova.com



	Report Number: 13619	765203		
	,			1 /
	V5G 1K5			·
Attn:	Kimberley Webber	P.O.:	Report Number.	1301913
Sampled By: Company:		Acct code:		

		Reference Number	765203-1	765203-2	765203-3	
		Sample Date	Sep 15, 2010	Sep 15, 2010	Sep 15, 2010	
		Sample Time	NA	NA	NA	
		Sample Location				
		Sample Description	X23895-01R \	X23896-01R \	X23897-01R \	
			Reclamation	Reclamation	Reclamation	
		Matrix	Soil	Soil	Soil	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Classification						
C:N Ratio			29	25	26	0.1
Nitrogen	Total	%	0.03	0.10	0.07	0.01
Organic Matter	Total	%	1.66	4.97	3.52	

Exova	T: +1 (604) 514-3322
#104, 19575-55 A Ave.	F: +1 (604) 514-3323
Surrey, British Columbia	E: Surrey@exova.com
V3S 8P8, Canada	W: www.exova.com



Bill To: Report To: Attn: Sampled By: Company:	Maxxam Analytics 4606 Canada Way Burnaby, BC, Canada V5G 1K5	Project: ID: Name: Location: LSD: P.O.: Acct code:	Job #B092008	Lot ID: Control Number: Date Received: Date Reported: Report Number:	Oct 4, 2010	
--	---	--	--------------	--	-------------	--

		Reference Number	765203-4	765203-5	765203-6	
		Sample Date	Sep 15, 2010	Sep 15, 2010	Sep 15, 2010	
		Sample Time	NA	NA	NA	
		Sample Location				
		Sample Description	X23898-01R \ Reclamation	X23899-01R \ R1 (IROD) Plot	X23900-01R \ R1 (IROD) Plot	
		Matrix	Soil	Soil	Soil	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Classification						
C:N Ratio			>50	23.0	17.9	0.1
Nitrogen	Total	%	<0.01	0.14	0.12	0.01
Organic Matter	Total	%	0.95	6.50	4.38	
Carbon	Total Organic	%	0.48	3.25	2.19	0.02

Exova	T: +1 (604) 514-3322
#104, 19575-55 A Ave.	F: +1 (604) 514-3323
Surrey, British Columbia	E: Surrey@exova.com
V3S 8P8, Canada	W: www.exova.com



Report To: Max 4606 Burr V5G	xam Analytics xam Analytics 6 Canada Way naby, BC, Canada 6 1K5 berley Webber	Project: ID: Name: Location: LSD: P.O.: Acct code:	Job #B092008	Lot ID: Control Number: Date Received: Date Reported: Report Number:	Oct 4, 2010
---------------------------------------	--	--	--------------	--	-------------

		Reference Number	765203-7	765203-8	765203-9	
		Sample Date	Sep 15, 2010	Sep 15, 2010	Sep 15, 2010	
		Sample Time	NA	NA	NA	
		Sample Location				
		Sample Description	X23901-01R \ R3	X23902-01R \ R3	X23903-01R \ R3	
			Tailings D	Tailings D	Tailings D	
		Matrix	Soil	Soil	Soil	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Classification						
C:N Ratio			17.3	13.7	16.4	0.1
Nitrogen	Total	%	0.22	0.18	0.17	0.01
Organic Matter	Total	%	7.63	4.87	5.59	
Carbon	Total Organic	%	3.82	2.44	2.79	0.02

Exova	T: +1 (604) 514-3322
#104, 19575-55 A Ave.	F: +1 (604) 514-3323
Surrey, British Columbia	E: Surrey@exova.com
V3S 8P8, Canada	W: www.exova.com



Bill To: Report To:	·····	Project: ID:	Job #B092008	Lot ID: Control Number:	765203
	4606 Canada Way	Name:		Date Received:	Sep 29, 2010
	Burnaby, BC, Canada	Location:		Date Reported:	Oct 4, 2010
	V5G 1K5	LSD:		Report Number:	1361913
Attn:	Kimberley Webber	P.O.:			
Sampled By:		Acct code:			
Company:					

		Reference Number	765203-10	765203-11	765203-12	
		Sample Date	Sep 15, 2010	Sep 15, 2010	Sep 15, 2010	
		Sample Time	NA	NA	NA	
		Sample Location				
		Sample Description	X23904-01R \ R4 Minto Rd K	X23905-01R \ R4 Minto Rd K	X23906-01R \ R4 Minto R KM	
		Matrix	Soil	Soil	Soil	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Classification						
C:N Ratio			>20	16.6	>10	0.1
Nitrogen	Total	%	<0.01	0.24	<0.01	0.01
Organic Matter	Total	%	0.49	7.84	0.22	
Carbon	Total Organic	%	0.24	3.92	0.11	0.02

Ardren Carnarl Approved by:

Andrew Garrard, BSc General Manager 
 Exova
 T: +1 (604) 514-3322

 #104, 19575-55 A Ave.
 F: +1 (604) 514-3323

 Surrey, British Columbia
 E: Surrey@exova.com

 V3S 8P8, Canada
 W: www.exova.com

#### **Methodology and Notes**



Bill To:	Maxxam Analytics	Project:		Lot ID:	765203
Report To:	Maxxam Analytics	ID:	Job #B092008	Control Number:	
	4606 Canada Way	Name:		Date Received:	Sep 29, 2010
	Burnaby, BC, Canada	Location:		Date Reported:	Oct 4, 2010
	V5G 1K5	LSD:		Report Number:	1361913
Attn:	Kimberley Webber	P.O.:			
Sampled By:		Acct code:			
Company:					

#### **Method of Analysis**

Method Name	Reference	Method	Date Analysis Started	Location
Total Carbon, Nitrogen & Sulfur by Leco Combustion	SSSA Book Series 5	* Nitrogen-Total, Ch 37	01-Oct-10	Exova Surrey
Total Carbon, Nitrogen & Sulfur by Leco Combustion	SSSA Book Series 5	<ul> <li>* Total Carbon, Organic Carbon, and Organic Matter, Ch 34</li> </ul>	01-Oct-10	Exova Surrey
		* Deference Mathed Madified		

Reference Method Modified

**Comments:** 

Maxam

Driven by services and Sciences www.maxxamanalytics.com ACCESS CONSULTING GROUP

Maxxam Job #: B079893 Report Date: 2010/09/15

Your P.O. #: MN-110466 Sampler Initials: LK

#### RESULTS OF CHEMICAL ANALYSES OF SOIL

Maxxam ID		W68609	W68610	W68611	W68612		
Sampling Date		2010/07/19	2010/07/22	2010/07/18	2010/07/20		
	Units	M07	M029	M035	M54A	RDL	QC Batch
Parameter							
Subcontract Parameter	N/A	ATTACHED	ATTACHED	ATTACHED	ATTACHED	N/A	4091595
Elements							
Cation exchange capacity	cmol+/Kg	<10	19	12	<10	10	4248901

Maxxam ID		W68613	W68614	W68615	W68616	W68617	W68618		
Sampling Date		2010/07/21	2010/07/21	2010/07/21	2010/07/21	2010/07/22	2010/07/22		
	Units	M76A	M80	M85	M87	M90	M93	RDL	QC Batch
Parameter									
Subcontract Parameter	N/A	ATTACHED	ATTACHED	ATTACHED	ATTACHED	ATTACHED	ATTACHED	N/A	4091595
Several second in the second sec	1967	A CONTRACT OF							
Elements		ATT MOTION	in the fee						

#### ELEMENTS BY ATOMIC SPECTROSCOPY (SOIL)

Maxxam ID		W68609	W68610	W68611	W68612	W68613	W68614	W68615	W68616	W68617	W68618		
Sampling Date		2010/07/19	2010/07/22	2010/07/18	2010/07/20	2010/07/21	2010/07/21	2010/07/21	2010/07/21	2010/07/22	2010/07/22		
	Units	M07	M029	M035	M54A	M76A	M80	M85	M87	M90	M93	RDL	QC Batch
Total Metals by ICP													
Total Sulphur (S)	mg/kg	45	65	52	67	65	42	47	82	53	36	5	4255008

N/A - Not Applicable RDL - Reportable Detection Limit

Page 2 of 8

Maxam

Driven by service and Sciences www.maxxamanalytics.com ACCESS CONSULTING GROUP

Your P.O. #: MN-110466 Sampler Initials: LK

Maxxam ID		W68618		
Sampling Date		2010/07/22		
	Units	M93	RDL	QC Batch
Misc. Inorganics				
Soluble (2:1) pH	pH Units	5.68	0.01	4244124
Total Metals by ICPMS				
Total Aluminum (Al)	mg/kg	12900	100	4244137
Total Antimony (Sb)	mg/kg	0.4	0.1	4244137
Total Arsenic (As)	mg/kg	5.1	0.2	4244137
Total Barlum (Ba)	mg/kg	138	0.1	4244137
Total Beryllium (Be)	mg/kg	0.3	0.1	4244137
Total Bismuth (BI)	mg/kg	<0.1	0.1	4244137
Total Cadmium (Cd)	mg/kg	<0.05	0.05	4244137
Total Calcium (Ca)	mg/kg	3150	100	4244137
Total Chromium (Cr)	mg/kg	26	1	4244137
Total Cobalt (Co)	mg/kg	6.5	0.3	4244137
Total Copper (Cu)	mg/kg	14.9	0.5	4244137
Total Iron (Fe)	mg/kg	20900	100	4244137
Total Lead (Pb)	mg/kg	5.7	0.1	4244137
Total Magnesium (Mg)	mg/kg	4740	100	4244137
Total Manganese (Mn)	mg/kg	219	0.2	4244137
Total Mercury (Hg)	mg/kg	<0.05	0.05	4244137
Total Molybdenum (Mo)	mg/kg	0.4	0.1	4244137
Total Nickel (NI)	mg/kg	14.9	0.8	4244137
Total Phosphorus (P)	mg/kg	252	10	4244137
Total Potassium (K)	mg/kg	563	100	4244137
Total Selenium (Se)	mg/kg	<0.5	0.5	4244137
Total Sliver (Aq)	mg/kg	<0.05	0.05	4244137
Total Sodium (Na)	mg/kg	<100	100	4244137
Total Strontium (Sr)	mg/kg	25.7	0.1	4244137
Total Thailum (TI)	mg/kg	<0.05	0.05	4244137
Total Tin (Sn)	mg/kg	0.3	0.1	4244137
Total Titanium (Ti)	mg/kg	753	1	4244137
Total Vanadium (V)	mg/kg	52	2	4244137
Total Zinc (Zn)	mg/kg	43	1	4244137
Total Zirconium (Zr)	mg/kg	2.8	0.5	4244137

**CSR/CCME METALS IN SOIL (SOIL)** 

RDL - Reportable Detection Limit

Page 4 of 8

Ma<u>Xam</u>

Driven by service and Sciences www.maxxamanalytics.com ACCESS CONSULTING GROUP

Maxxam Job #: 8079893 Report Date: 2010/09/15

Your P.O. #: MN-110466 Sampler Initials: LK

#### QUALITY ASSURANCE REPORT

			Matrix	Spike	8piked	Blank	Metho	i Blank	Ri	סי	QC Sta	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	<b>QC Limits</b>	% Recovery	QC Limits
4244124	Soluble (2:1) pH	2010/09/10			102	96 - 104			0.9	20		
4244137	Total Arsenic (As)	2010/09/10	101	75-125	97	75-125	⊲0.2	mg/kg	1.7	30	98	70-130
4244137	Total Beryllum (Be)	2010/09/10	100	75-125	95	75 - 125	⊲.1	maka	NC	30		
4244137	Total Cadmium (Cd)	2010/09/10	105	75-125	100	75 - 125	<0.05	maka	NC	30	93	70-130
4244137	Total Chromium (Cr)	2010/09/10	100	75-125	96	75-125	4	mg/kg	1.8	30	99	70-130
4244137	Total Cobalt (Co)	2010/09/10	100	75-125	96	75 - 125	<b>⊲</b> 3	maka	3.4	30	95	70-130
4244137	Total Copper (Cu)	2010/09/10	100	75-125	101	75 - 125	<0.5	maka	1.9	30	90	70-130
4244137	Total Lead (Pb)	2010/09/10	101	75-125	99	75-125	⊲0.1	mg/kg	3.5	35	98	70-130
4244137	Total Mercury (Hg)	2010/09/10	85	75-125	85	75-125	<0.05	mg/kg	NC	35		
4244137	Total Nickel (NI)	2010/09/10	99	75-125	98	75-125	<0.8	malka	1.8	30	93	70-130
4244137	Total Scienium (Sc)	2010/09/10	101	75-125	102	75-125	<0.5	malka	NC	30		
4244137	Total Vanadium (V)	2010/09/10	NC	75-125	98	75-125	-2	mg/kg	0.9	30	101	70-130
4244137	Total Zinc (Zn)	2010/09/10	NC	75-125	105	75-125	<1	malka	4.1	30	89	70-130
4244137	Total Aluminum (Al)	2010/09/10					<100	malka	6.9	35	98	70-130
4244137	Total Antimony (Sb)	2010/09/10					⊲0.1	mg/kg	NC	30	107	70-130
4244137	Total Barlum (Ba)	2010/09/10					⊲0.1	mg/kg	2.4	35	104	70-130
4244137	Total Calcium (Ca)	2010/09/10					<100	maka	6.1	30	93	70-130
4244137	Total Iron (Fe)	2010/09/10					<100	maika	2.6	30	95	70-130
4244137	Total Magnesium (Mg)	2010/09/10					<100	mg/kg	8.7	30	95	70-130
4244137	Total Manganese (Mn)	2010/09/10					⊲0.2	maka	2.9	30	101	70-130
4244137	Total Molybdenum (Mo)	2010/09/10					⊲0.1	maka	NC	35	103	70-130
4244137	Total Phosphorus (P)	2010/09/10					<10	malka	4.3	30	90	70-130
4244137	Total Silver (Ag)	2010/09/10					<0.05	malka	NC	35	78	70-130
4244137	Total Strontium (Sr)	2010/09/10					⊲0.1	maka	3.7	35	96	70-130
4244137	Total Thailium (TI)	2010/09/10					<0.05	malka	NC	30	86	70-130
4244137	Total Titanium (TI)	2010/09/10					<1	malka	3.3	35	99	70-130
4244137	Total Bismuth (BI)	2010/09/10					⊲0.1	maka	NC	30		
4244137	Total Potassium (K)	2010/09/10					<100	maka	1.1	35		
4244137	Total Sodium (Na)	2010/09/10					<100	malka	NC	35		
4244137	Total Tin (Sn)	2010/09/10					⊲0.1	maka	NC	35		
4244137	Total Zirconium (Zr)	2010/09/10					<0.5	malka	NC	30		

Page 6 of 8

MaXam

Dervan by savera and Science ACCESS CONSULTING GROUP

Your P.O. #: MN-110466 Sampler Initials: LK

#### QUALITY ASSURANCE REPORT

			Matrix 8	pike	Spiked E	Blank	Method	i Blank	RP	סי	QC Star	ndard
QC Batch	Parameter	Date	% Recovery	QC Limits	% Recovery	QC Limits	Value	Units	Value (%)	QC Limits	% Recovery	QC Limits
4248901	Cation exchange capacity	2010/09/10							NC	35		
4255008	Total Sulphur (S)	2010/09/13					۷	mg/kg	7.8	30		

N/A - Not Applicable

RPD = Relative Percent Difference Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A blank matrix to which a known amount of the analyte has been added. Used to evaluate analyte recovery.

Splited Blank: A blank matrix which a known amount of the analyte has been added. Used to evaluate analyte recovery. Method Blank: A blank matrix containing all reagents used in the analytic all procedure. Used to identify laboratory containination. NC (Matrix Splite): The recovery in the matrix splite was not calculated. The relative difference between the concentration in the parent sample and the splited amount was not sufficiently significant to permit a reliable recovery.

calculation.

NC (RPD): The RPD was not calculated. The level of analyte detected in the parent sample and its duplicate was not sufficiently significant to permit a reliable calculation.

Page 7 of 8

١	лаху	kam		, BC, VSA, A Otaman <u>ahy</u>	tics.cor		ix (9534) 44 Il - Fireer 1-800-4			l												Page		_	_
	./	Analytics inc		08 198	32190		100			器衣	10	Der Der	3	83)   {	A	NAL	YS	IS R	EQ	UES	π	0004	5 048.5	20	3
	ease Consulting Group		SUBNI IM	idu jah nkaj						15	<b>3</b> 93	15 Y	73.7	E j	87.72	he	21.44	1991 1	HE YZ	3/452	-	ગ્રેસ્ટ્રાં	32	5 <u>6,9</u>	5
0 51 1/	PARY ANGREES: De cite Businese Cente Inclustrial Rd. Rehorad, YT 4 2V3 FLERMAN (JAMP)		14.; 58881.		ന്നരത്രം ത്രദ <u>േഷ</u> സ് <u>രീണ</u>	ndhwg											• 000 C 2773								
	a Kright, Brett Elliot	PROJECT MAD Scott Kees	101110				Arokropi ach natiditi yaha			S.		3						1	20.0						
		- Constraint of South	5		50513			PUNG		St oC		pue			5										
	FIELD S	AMPLEID			SURFACE ANTER THESE HITCH	104	cate:		# 201751-C20	cat on exchange ro: oOEC	C N Rabo	% Digaric Maher and FCC	lara Metals	Sulpaur	H			104 T T T T T T T T T T T T T T T T T T T	Patient Science				100M		
1	M87	y 100	1 24			8	18/07/2010		x	x	x	C. Starter	-	x	x	-	-	-		Ť	+	+	Ħ		Ē
>	MC29					8	22/0/2010		8	×	x	х	X.	3	x			15							
2	VIC35		1. 1.	+ 210		*	CHOSICOVAL		8	8	8	¥.	X	X	X	- î	1	L j			1			1	
ę.	.M54A		1. 3	1.0		x	20/07/2010		x	x	X	×	X.	X.	×	1					á				
24	M/6A	- 15- 10- 10-	100	Se			21/0712010		8	8	8	×	×	2	ж.	1	1							$ \rightarrow $	
-	0eM		1.7×94			X.	2110/12010		×	×	x		-	-	x	_	1	_	_					_	_
	М9Б		10.00	a de la	1.	K	2* /07/2010		8	X	x	8 -	· · ·	×	×	_	_				aa i		ad and		
_	M97 M90	· · · · ·	2	AT SE	1	×	71/07/2012		*	.*	2		-	х	x	+	5			a		+	+	+	_
_	M93		6407-1A	2.5.5		8	22/07/2010		8	X	8	<u> </u>	-	100	X	+		1	÷			-	+	+	_
8	ngas,	MI		-		×	22/07/2015		8	. *	x	8	×	8	8	+-	ţ.	-	11 1			-	+	+	_
<u>а</u>	all contractions with		10000	1997 A.	11		N	-18 and		-	, 13			+	+	+	+	-	-				+		-
-		FO NUMBER OF SUBJE ROMOUR	CO. 1010	2012/00/0	MITS72	OK LAD	NANT TTE	101-2	<u></u>	i i	teve		-	776	1.00		e é a	5361	saids	100	3036 C	0.372	225	5346	R.
	141 ("UNASARA" MU) SA TRANADAY "AT MIST IGAT PRADA APPROVA	MN-110466									382 4874 91-49	a	- 16	RRA	ML -	REI		JUE	LATE.	ł		LOCIN	CH30K		
P	Some exceptions apply - Kaso contact valoratory Alen III sing site site races	ACCOUNTING CONTACT.	SPECIAL R	EFORTINGC	1F BILLIN	ig not	RIGITZLA			¥ 14	HÅ J	54 D2		26	d i										
H H SEN	3 EUS NESS DAVIS	ic instance) devisave re- Paul leglis	DATE? DDMM/YY	248	00/201	0	TMC -	14:00		FEC	87E	D BY,					_								
1.77	DUSIKESS DAYS	BE NGUNSTED BY	DATE: DOMENTY				TNE			HEC	EJVE:	2 HY													

١	лаху	kam		, BC, VSA, A Otaman <u>ahy</u>	tics.cor		ix (9534) 44 Il - Fireer 1-800-4			l												Page		_	_
	./	Analytics inc		08 198	32190		100			器衣	10	Der Der	3	83)   {	A	NAL	YS	IS R	EQ	UES	π	0004	5 048.5	20	3
	ease Consulting Group		SUBNI IM	idu jah nkaj						15	<b>3</b> 93	15 Y	73.7	E j	87.72	he d	144	1991 1	HE YZ	3/452	-	ગ્રેસ્ટ્રાં	32	5 <u>6.9</u>	5
0 51 1/	PARY ANGREES: De cite Businese Cente Inclustrial Rd. Rehorad, YT 4 2V3 FLERMAN (JAMP)		14.; 58881.		ന്നരത്രം ത്രദ <u>േഷ</u> സ് <u>രീണ</u>	ndhwg											• 000 C 2773								
	a Kright, Brett Elliot	PROJECT MAD Scott Kees	101110				Arokropi ach natiditi yaha			S.		3						1	20.0						
		- Constraint of South	5		50513			PUNG		St oC		pue			5										
	FIELD S	AMPLEID			SURFACE ANTER THESE HITCH	104	cate:		# 201751-C20	cat on exchange ro: oOEC	C N Rabo	% Digaric Maher and FCC	lara Metals	Sulpaur	H			104 T T T T T T T T T T T T T T T T T T T	Patient Science				100M		
1	MC7	y 100	1 24			8	18/07/2010		x	x	x	(Colorador)	-	x	x	-	-	-		Ť	+	+	Ħ		Ē
>	MC29					8	22/0/2010		8	×	x	х	X.	3	x			15							
2	VIC35		1. 1.	+ 210		*	CHOSICOVAL		8	8	8	¥.	X	X	X	- î	1	L j			1			1	
ę.	.M54A		1. 3	1.0		x	20/07/2010		x	x	X	×	X.	X.	×	1					á				
24	M/6A	- 15- 10- 10-	100	Se			21/0712010		8	8	8	×	×	2	ж.	1	1							$ \rightarrow $	
-	0eM		1.7×94			X.	2110/12010		×	×	x		-	-	x	_	1	_	_					_	_
	М9Б		10.00	a de la	1.	K	2* /07/2010		8	X	x	8 -	· · ·	×	×	_	_				aa i		ad and		
_	M97 M90	· · · · ·	2	AT SE	1	×	71/07/2012		*	.*	2		-	х	x	+	5			a.		+	+	+	_
_	M93		6407-1A	2.5.5		8	22/07/2010		8	X	8	<u> </u>	-	100	X	+		1	÷			-	+	+	_
8	ngas,	MI		-		*	22/07/2015		8	. *	x	8	×	8	8	+-	ţ.	-	11 1			-	+	+	_
<u>а</u>	all contractions with		10000	1997 A.	11		N	-18 and		-	, 13			+	+	+	+	-	-				+		-
-		FO NUMBER OF SUBJE ROMOUR	CO. 1010	2012/00/0	MITS72	OK LAD	NANT TTE	101-2	<u></u>	i i	teve		-	776	1.00		e é a	536	saids	100	3036 C	0.372	225	5346	R.
	141 ("UNASARA" MU) SA TRANADAY "AT MIST IGAT PRADA APPROVA	MN-110466									382 4874 91-49	a	- 16	RRA	ML -	REI		JUE	LATE.	ł		LOCIN	CH30K		
P	Some exceptions apply - Kaso contact valoratory Alen III sing site site races	ACCOUNTING CONTACT.	SPECIAL R	EFORTINGC	1F BILLIN	ig not	RIGITZLA			+ 14	HÅ J	54 D2		26	d i										
H H SEN	3 EUS NESS DAVIS	ic instance) devisave re- Paul leglis	DATE? DDMM/YY	248	00/201	0	TMC -	14.00		FEC	87E	D BY,					_								
1.77	DUSIKESS DAYS	BE NGUNSTED BY	DATE: DOMENTY				TNE			HEC	EJVE:	2 HY													

Exove	T: +1 (804) 514-3322
#104, 19575-55 A Ave.	F: +1 (804) 514-3323
Surrey, British Columbia	E: Surrey@excva.com
V3S 8P8, Cenada	W: www.exova.com



BIII To:	Maxxam Analytics	Project:		Lot ID:	760926
Report To:	Maxxam Analytics	ID:		Control Number:	
	4606 Canada Way Name:			Date Received:	Sep 3, 2010
	Burnaby, BC, Canada	Location:		Date Reported:	
	V5G 1K5	LSD:		Report Number:	
Attn:	Kimberley Webber	P.O.:	B079893	nepor namoci.	1000014
Sampled By:		Acct code:			
Company:					

		Reference Number	760926-1	760926-2	760926-3	
		Sample Date		Aug 22, 2010	Aug 18, 2010	
		Sample Time Sample Location		NA	NA	
		Sample Description	W68609-01R \ M07	W68610-01R \ M029	W68611-01R \ M035	
		Matrix	Soll	Soll	Soll	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Analyte Classification		Units	Results	Results	Results	
		Units	Results 40	Results	Results	
Classification	Total	Units %				Limit
Classification C:N Ratio	Totai Totai		40	15	>50	Limit

Exove	T: +1 (804) 514-3322
#104, 19575-55 A Ave.	F: +1 (804) 514-3323
Surrey, British Columbia	E: Surrey@excva.com
V38 8P8, Cenada	W: www.exova.com



BIII To:	Maxxam Analytics	Project:		Lot ID:	760926
Report To:	Maxxam Analytics	ID:		Control Number:	
	4606 Canada Way	Name:		Date Received:	Sep 3, 2010
	Burnaby, BC, Canada	Location:		Date Reported:	
	V5G 1K5	LSD:		Report Number:	
Attn:	Kimberley Webber	P.O.:	B079893		
Sampled By:		Acct code:			
Company:					

		Reference Number Sample Date		760926-5 Aug 21, 2010	760926-6 Aug 21, 2010	
		Sample Time	NA	NA	NA	
		Sample Location Sample Description		W68613-01R \ M76A	W68614-01R \ M80	
		Matrix	Soll	Soll	Soll	
Analyte		Units	Results	Results	Results	Nominal Detection Limit
Classification						
C:N Ratio			45	25	31	0.1
Nitrogen	Total	%	0.04	0.05	0.04	0.01
Organic Matter	Total	%	3.98	2.38	2.22	
Carbon	Total Organic	%	1.99	1.19	1.11	0.02

Exove	T: +1 (804) 514-3322
#104, 19575-55 A Ave.	F: +1 (804) 514-3323
Surrey, British Columbia	E: Surrey@excva.com
V3S 8P8, Cenada	W: www.exova.com



Report To:	Maxxam Analytics Maxxam Analytics 4606 Canada Way Burnaby, BC, Canada VSG 1K5 Kimberley Webber	Project: ID: Name: Location: LSD: P.O.:	8079093	Lot ID: Control Number: Date Received: Date Reported: Report Number:	Sep 14, 2010
Sampled By: Company:	,	Acct code:			

		Reference Number Sample Date Sample Time Sample Location	Aug 21, 2010 NA	760926-8 Aug 21, 2010 NA	760926-9 Aug 22, 2010 NA	
			W68615-01R \ M85	W68616-01R \ M87	W68617-01R \ M90	
		Matrix	Soll	Soll	Soll	
Analyte		Units	Results	Results	Results	Nominal Detection
Classification						
C:N Ratio			28	30	27	0.1
Nitrogen	Total	%	0.03	0.06	0.03	0.01
Organic Matter	Total	%	1.78	3.59	1.81	
Carbon	Total Organic	%	0.89	1.79	0.90	0.02

Exove	T: +1 (804) 514-3322
#104, 19575-55 A Ave.	F: +1 (804) 514-3323
Surrey, British Columbia	E: Surrey@exova.com
V3S 8P8, Ceneda	W: www.exova.com



Report To: Attn: Sampled By:	Maxxam Analytics Maxxam Analytics 4606 Canada Way Burnaby, BC, Canada VSG 1K5 Kimberley Webber	Project: ID: Name: Location: LSD: P.O.: Acct code:	B079893	Lot ID: Control Number: Date Received: Date Reported: Report Number:	Sep 14, 2010	
Company:						


		Reference Number Sample Date Sample Time Sample Location	Aug 22, 2010 NA			
		Sample Description Matrix				
Analyte		Units	Results	Results	Results	Nominal Detection
Classification						
C:N Ratio			28			0.1
Nitrogen	Total	%	0.02			0.01
Organic Matter	Total	%	1.15			
Carbon	Total Organic	%	0.57			0.02

Approved by: Andrew Connerl

Andrew Garrard, BSc General Manager

Terms and Conditions: www.exova.ca/terms&conditions

Exove	T: +1 (804) 514-3322
#104, 19575-55 A Ave.	F: +1 (804) 514-3323
Surrey, British Columbia	E: Surrey@exove.com
V38 8P8, Ceneda	W: www.exova.com





Report To:	Maxxam Analytics Maxxam Analytics 4606 Canada Way Burnaby, BC, Canada V5G 1K5 Kimberley Webber	Project: ID: Name: Location: LSD: P.O.: Acct code:	B079693	Lot ID: Control Number: Date Received: Date Reported: Report Number:	Sep 14, 2010
Company:					

#### Method of Analysis

Method Name	Reference	Method	Date Analysis Started	Location
Total Carbon, Nitrogen & Sulfur by Leco Combustion	SSSA Book Series 5	* Nitrogen-Total, Ch 37	09-Sep-10	Exova Surrey
Total Carbon, Nitrogen & Sulfur by Leco Combustion	SSSA Book Series 5	<ul> <li>Total Carbon, Organic Carbon, and Organic Matter, Ch 34</li> </ul>	09-Sep-10	Exova Surrey
		* Reference Method Modified		

Comments:

Please direct any inquiries regarding this report to our Client Services group. Results relate only to samples as submitted. The test report shall not be reproduced except in full, without the written approval of the laboratory. Terms and Conditions: www.exova.cohemstconditions

# **APPENDIX C**

**ACCESS ECOSYSTEM FORM** 



PROJECT ID:

# WEATHER:

PLOT #:	SURVEYORS:	DATE:	START TIME:	END TIME:
TYPE/ # OF SAMPLES:		РНОТО #'S:		

GPS ZONE	E
	Ν
ASPECT (°)	
SLOPE (%)	
ELEVATION (m)	

	SC	DIL DRAINA	GE		SI	IR	
VR	V	ERY RAPIDLY	1	Α	VEF	RY POOR	
R	R	APIDLY		В	POOR		
w	۷	VELL		С	ME	DIUM	
MW	Ν	<b>IODERATELY</b>	WELL	D	RIC	Н	
I	11	MPERFECTLY		Е	VEF	RY RICH	
Р	Р	OORLY		F	SAL	INE	
VP	V	'ERY POORLY		SM	R (if	trained)	
	SEEPAGE				0 VERY XERI		
Р	Р	RESENT		1	XERIX		
Α	Α	BSENT		2	SUBXERIC		
Оре	en '	Water Pres	ent (%)	ß	SUBMESIC		
Plot				4	MESIC		
				5	SUBHYGRIC		
RO	СКЛ	SUBSTRA	FES (%)	6	HYGRIC		
COBB	LES	5/ STONES		7	SUE	BHYDRIC	
BEDRO	C	К		8	HY	ORIC	
				9	AQ	UATIC	
		SITE C	LASSIFIC	ΑΤΙΟ	N		
		←UNIFO	RM TO VA	RIABLI	$E \rightarrow$		
1		2	3	4	ļ	5	

HUMUS FORM (ENTER X, if trained)							
MOR	MO						
MORMODER	MM						
MODER	MD						
MULLMODER	MR						
MULL	MU						
SOIL COLOUR (ENTER X)							
DARK	D						
MEDIUM	М						
LIGHT	L						
NOT APPLICABLE	N/A						

SURFACE SHAPE			MICROTOPOGRAPHY				PLOT POSITION MESO				
CV	CONCAVE		SM	SMOOT	ГН		С	CREST			
СХ	CONVEX		мо	MOD. N	MOUNDE	D	UP	UPPER SLOPE			
ST	STRAIGHT		ST	STRONGLY			MS	MID SLOPE			
				MOUN	DED						
UN	UNDULATI	NG	EX	EX EXTREMELY				EXTREMELY		LS	LOWER SLOPE
				MOUN	DED						
	SURFACE C	OMPOSITIO	ом (ми	ST EQUA	L 100%)		Т	TOE			
ROCK	COBBLE	GRAVEL	SOIL	VEG ORG. CWD			D	DEPRESSION			
							L	LEVEL			

# **COMMENTS/ SITE DISTURBANCES/ SAMPLES**

VEGETATION COVE TREE LAYER ( SHRUB LAYER ( HERB LAYER ( MOSS LAYER ( SPECIES	(A) (B) (C)	m) A	ILDLIFE SIG R ROOT DIG 2 (ht Main Cover	iGING) m) A	TRACKS, I TREE 3 ( htn Sub-canopy	LAYE	ER (A			R, DEN, ETC.) (E A1 (htm) Dominant %	MPHASIZ	m)	/SE, GRAZINO A3 (ht Sub-canop	m)
					CUDUD		<b>FD</b> (	<b>D</b> )						
SPECIES	B1 (2r	n – 10m) 🦻	%	32 (<2m	SHRUB	LAY		B) PECIES		B1 (2m – 1	0m) %		B2 (<2m) %	6
01 20120	(				,		•••	20.20			,			
				TR	ee regen	VERA		N <1m	1	<u> </u>				
SPECIES %						SPECIES %					_			
											_			-
			LAYER (C	-				<b>A</b> (		MOSS LAYE			HEN LAYE	-
SPECIES	%	SPECIES		%	SPECIE	5		%	SPECI	ES	%	SPECI	ES	%
HEIGHT (M)		SUCCESS	IONAL STA	GE CONTRACT			STRI		L STAGE					
		50000					SINC							

<u>SITE SKETCH:</u> (1 cm = \_\_\_\_\_) (JUST DOMINANT PLANTS, SHRUBS AND TREES)